PRESERVATION PLANNING FOR ST. ELIZABETHS WEST CAMPUS CEMETERY, ST. ELIZABETHS HOSPITAL, WASHINGTON, DC





PRESERVATION PLANNING FOR ST. ELIZABETHS WEST CAMPUS CEMETERY, ST. ELIZABETHS HOSPITAL, WASHINGTON, DC

Research Contribution 472

Michael Trinkley Debi Hacker

Chicora Foundation, Inc.
PO Box 8664 • 861 Arbutus Drive
Columbia, SC 29202-8664
803/787-6910
www.chicora.org

June 2007

© 2007 by Chicora Foundation, Inc. All rights reserved. No part of this publication may be reproduced or transcribed in any form without permission of Chicora Foundation, Inc. except for brief quotations used in reviews. Full credit must be given to the authors and publisher.

ISBN 978-1-58317-071-7 ISSN 0882-2041

The paper in this book meets the guidelines for permanence and durability of the Committee on Production Guidelines for Book Longevity of the Council on Library Resources. ∞

The neglected cemeteries . . . insult life itself, for death is an inevitable consequence of birth. By treating the disposal of the dead as though the problem were one of refuse collection, society devalues life.

-- James Stevens Curl, *A Celebration of Death*

MANAGEMENT SUMMARY

The St. Elizabeths West Campus cemetery is an exceptionally historic resource for the District of Columbia, and especially for the hospital grounds. In fact, the cemetery is a portion of the grounds listed on the National Register of Historic Places. This is recognized by the General Services Administration (GSA), as evidenced by this study. Cemeteries, however, are very different from virtually all other types of properties that GSA administers.

- They are sacred sites consecrated within are the remains of loved ones deserving of the utmost of care and respect.
- They are artistic sites, such as sculpture gardens or outdoor museums, representing permanent collections of three-dimensional artifacts requiring the same level of care that museums provide.
- They are archives storehouses of genealogical information, representing our individual and collective pasts.
- And they are scenic landscapes like parks or open spaces, but requiring far more focused and specific care.

In sum, cemeteries are social, historic, architectural, and archaeological artifacts. When there is little else physically remaining of a community's earliest history, the local cemetery provides a unique tie to the past that would otherwise be lost.

Therefore cemeteries require very specific consideration and different care from the other types of open sites found in most communities.

In the case of the St. Elizabeths West Campus cemetery, the cemetery includes both military dead from the Civil War, as well as what were termed "friendless" patients, buried by the hospital "without ceremony." The cemetery reflects an extraordinarily rich history; yet, this history was not sufficient to prevent the hospital from recreating the graveyard's history and developing a myth of a white cross that persists even today.

In addition, over the years the West Campus cemetery has failed to receive the care and attention that it both deserves and requires. As a result of these years of deferred maintenance, a number of issues – many of them critical and costly – require the immediate attention of the GSA.

This report evaluates these needs, classifying them into three broad categories:

- Those issues that are so critical typically reflecting broad administrative issues and issues that if delayed will result in significantly greater costs – that require immediate attention during the first fiscal or calendar year after receipt of this study.
- ❖ Those issues that, while significant and reflecting on-going deterioration and concerns, can be spread over the next 2 to 3 years. This allows some budgeting flexibility, but this flexibility should not be misconstrued as a reason to ignore the seriousness of the issues.
- Finally, those issues that represent ongoing maintenance and preservation issues. These costs can be spread over the following three to five years. Like

the Second Priority issues, this budgetary flexibility should not be interpreted as allowing these issues to slide since further delay will only increase the cost of necessary actions.

The First Priority Issues have a budget of approximately \$51,200.

- The bulk of these costs are for work recommended by Bartlett on the cemetery trees, including the removal of four (but not including stump grinding which is not appropriate in a cemetery context), replanting four oaks, pruning all of the trees in the cemetery, and basic fertilization. The total estimated for these activities is \$41,000.
- The other major expenditure involves first priority conservation needs, including the repair of several stones, consolidation treatments, and replacement of 22 stones. These costs are estimated to be about \$10,000.
- ❖ We also recommend the removal of the existing cemetery sign on the stone wall. The name "Civil War Cemetery" is inappropriate since the cemetery was initially intended for the use of patients and by all accounts continued serving that function throughout its history. The existing sign as perpetuates the myth of the white cross created late in the cemetery's history and having no basis in reality. The cost of removal is estimated to be \$200.
- Other actions have negligible costs since they are administrative or planning related. For example, we recommend that all decisions concerning the cemetery be made in the context of the Secretary of the Interior's Standards for Preservation and that all historic fabric be preserved whenever possible.
- We recommend that security patrols continue on a regular basis, although an

- effort should be made to allow public access at reasonable times.
- In terms of planning, it is critical that the setting be protected from visual intrusions. It is equally critical that planning incorporate clear provisions for the cemetery's adequate long-term maintenance, clearly a responsibility of the government.
- ❖ Current maintenance should be continued, but improved. For example, we have noted a great deal of recent stone damage from mowers and trimmer lines. Crews responsible for the cemetery upkeep should be held accountable for all damage; mower decks should be padded; and trimmer line should not exceed 0.065 inch.

Second priority issues are estimated to cost about \$115,000, although this may be spread out over several years.

- ❖ Approximately \$52,000 will be needed to establish an appropriate turf grass for the cemetery. This is not simply an aesthetics issue; a good turf grass will minimize maintenance and reduce damage to the stones.
- We recommend \$15,000 for additional historical research. In particular this research should seek to identify the civilians patients buried in the cemetery. It is important that GSA give a voice to these "friendless" individuals who currently lay forgotten in unmarked graves.
- An additional \$15,000 is allocated to the improvement of the vista and road shoulders on the route to the cemetery. This will involve removing downed timber, refuse, and other debris. The access road should remain graveled, although it requires approximately \$8,000 of work to stabilize the road base.

- Second priority conservation treatments, consisting largely of stone resetting, are estimated to cost approximately \$15,000. This work may be combined with the Phase 1 work at a savings to the government.
- ❖ Placement of new informational and regulatory signage is estimated to cost \$5,000, although this figure will vary with the type of signage chosen. We provide critical regulatory information that should be posted. The informational signage should balance the story of the military dead with the burial of civilian patients from St. Elizabeths. Both stories must be told.
- ❖ Finally, we recommend that the iron Confederate crosses, apparently placed on graves prior to the federal government allowing use of military stones at public expense, should be recast, using the one recovered as a model. These should be reinstalled in the cemetery, while the original is conserved and stored in a suitable repository, such as the Smithsonian Institution. A sum of \$5,000 is allotted to this task.

The items listed as third priority are those that can be spread over five years – perhaps extending into FY 2012-2013. These issues, however, are no less significant and will have a cost of about \$66,700 (not reflecting inflation or continued deterioration; nor does the cost reflect the on-going salaries of the staff needed to maintain the cemetery). These costs are also similar to those previously outlined, but are able to be postponed *short-term*.

- ❖ The cemetery's conservation status should be re-evaluated in five years, at an estimated cost of \$5,000.
- ❖ The largest budget allocation is \$40,400 for the completion of the Bartlett recommendations, including necessary cabling and bracing, pest control activities, and lightning protection.

❖ Finally, we allocate \$21,300 for the replacement of the chain link fence with a more historically appropriate wood picket fence, based on the available historic photograph.

While the allocation of just over \$233,000 is not inconsequential, it represents a small sum given the extensive work proposed for the remainder of the St. Elizabeths Campus. In addition, much of the work necessary at the cemetery is the result of deferred maintenance, with damage accumulating over the cemetery's 150 year history. Failure to act will not save the taxpayers money, it is result in the loss of this historic resource.

It is equally critical that the cemetery not be "lost" in the planning process. Long-term care and maintenance are critical for the resource's survival.

TABLE OF CONTENTS

List of Figures		vii
List of Tables		viii
Introduction		1
The Project	1	
Preservation Fundamentals	2	
The Cemetery Location	4	
The Setting and Context	5	
Factors Affecting the Landscape Character	8	
Recommendations	9	
Historic Context		11
The Hospital	11	
The West Campus Cemetery	19	
Summary	34	
Access and Pedestrian Issues		37
Access	37	
Pedestrian Access	38	
Recommendations	39	
Lighting and Security Issues		41
Cemetery Lighting	41	
Vandalism	41	
Hardening Targets	41	
Recommendations	42	
Cemetery Fixtures and Furnishings		43
Cemetery Fence	43	
Historic Ironwork	44	
Other Amenities	44	
Recommendations	44	
Landscape Maintenance		45
Staffing	45	
Cemetery Vegetation	46	
Turfgrass Issues	50	
Recommendations	55	
Other Maintenance Issues		57
The Entrance	57	
Signage	57	
Military Stones	58	

Monument Maintenance	60	
Recommendations	64	
Cemetery Boundary Assessment		65
ERT Geophysical Study	65	
Penetrometer Study	65	
The Fence and Property Boundary	67	
Trash Outside the Fence	67	
Conclusions	68	
Recommendations	68	
Priorities and Funding Levels		71
Recommended Priorities	71	
Sources Cited		75
Appendix 1. Resume for Michael Trinkley		79
Appendix 2. Monument Inventory		85
Appendix 3. List of Individuals Identified		527
Map of the West Campus Cemetery		Pocket on rear cover

APPENDIX 2. MONUMENT INVENTORY

Following are inventory forms for each of the markers identified in the West Campus cemetery during our January 2007 work. These forms include pertinent information concerning the monument itself, including the type, the stone type, and the marker size. Also included is a complete transcription of the marker. We provide brief observations concerning the condition of the marker and grave, such as the amount of tilt, physical damage, and orientation. Each stone has also been photographed, providing visual documentation of its condition and placement at the time of this study.

Each stone is listed with two numbers: the one on the top is the stone number – which has been carved into the stone and reflects the ordering of the stones in the cemetery. The bottom number is that assigned by ZAI and is alphabetical. By including both numbers we hope that it will be easier for future caregivers and researchers to identify and track these stones. In Appendix 3 we provide a series of lists that correlate these numbers, as well as what has been called the "Entry Number" – yet a third numbering system in use at the cemetery.

Under "Recommendations" we provide brief conservation treatments, as well as a priority. The priority recommendation (included under "comments") is based on five levels of need:

- 1. Objects that are unstable and require treatment as soon as possible. Examples include stones that are broken and laying loose in the cemetery since these are subject to additional damage or theft (there are eight markers for which treatments are proposed). Also included as Priority 1 stones are those so damaged that we recommend replacement (22 stones are recommended for replacement). These actions should occur within the current fiscal or calendar year.
- 2. Objects that are unstable and likely to experience additional, ongoing deterioration. If ignored, the cost of these treatments will escalate as the stones become more seriously damaged. We have placed 106 markers in this category. All of these treatments are resetting stones that are so tilted they are at a higher than normal risk of damage. This work should take place over the next 2-3 years.
- 3. Objects appear stable at present, but they should be re-inspected in 5-10 years to determine if the condition has changed. We include 79 markers. Some are tilted, but not so much that we recommend resetting.
- 4. Irreparable. These objects have either suffered so much damage or have so little original fabric remaining that repairs are not possible using available techniques. There are four stones that fall into this category – all represent mid-sections or bases without engraving or other identifying features.

The original stones in Priority 1 recommended for replacement should be either destroyed or conveyed to a museum with documentation that all are duplicates. It is important (and a requirement of the VA) that multiple government stones for the same individual do not exist since this is likely to pose problems in the future.


PRESERVATION PLANNING FOR ST. ELIZABETHS WEST CAMPUS CEMETERY

For those replacement stones where the information is too illegible to read we recommend that the replacements simply be engraved "U.S. Soldier" – the traditional wording for unknown dead. While it is regrettable that graves are lost, guesses should not be made concerning the information.

The costs identified in the preceding report are based on the treatment being carried out by a stone conservator subscribing to the Code of Ethics and Standards of Practice of the American Institute for Conservation of Historic and Artistic Works, the minimum credentials that should be demanded by the GSA. The costs are based on 2007 salary rates and supply costs. It would be reasonable to add a minimum of 8% additional per year delay beyond 2007 (although some costs, such as chemical supplies, are escalating far more rapidly). The costs do not include travel, per diem, or lodging since these fluctuate dramatically and since the per object cost declines as more treatments are proposed.

All information given and recommended in the treatment proposals is based on our research and is believed to be accurate. However, no guarantee, either expressed or implied, is made with respect to the proposals. As stones are taken apart it is possible to discovered hidden damage.

THIS PAGE IS INTENTIONALLY BLANK




ZAI #: 55 Row #: 3 Photo No: **Cemetery:** St. Elizabeths West **Grave #:** 3 Name(s) on marker: Cobb, Frederick Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: **Inscription:** 3/FRED'K. COBB/CO. C/102TH/OHIO INF. Reverse: other: Material: | marble granite **Gravestone Size (inches):** Height: 20 Width: 10 Thickness: 2 **Condition of Marker:** weathered cracked > broken vandalized loose unattached biologicals stained repaired portions missing: upper left corner tilted: degrees: 45 E-W N-S Other: **Grave Orientation:** East Marker inscription faces what direction: 75° Condition of Grave: probably displaced from proper location in Row 1; grave satisfactory Date: 1/23/07 **Surveyor:** D. Hacker Recommendations \boxtimes Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year (2) ongoing, requires Clean with D/2 & rinse Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 3






ZAI #: 133 **Row #:** 1 Photo No: **Cemetery:** St. Elizabeths West Grave #: 3a Name(s) on marker: Frank, George Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: **Inscription:** B/GEO. FRANK/CO. A/16TH/U.S.C. INF. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 21 Width: 10 Thickness: 2 Condition of Marker: weathered | cracked > broken \rightarrow vandalized unattached loose biologicals stained portions missing: upper right corner repaired Other: flat on ground tilted: degrees: N-S **Grave Orientation:** NA Marker inscription faces what direction: 0 $^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/22/07 Recommendations Reset/level in ground; align to existing row **Priority:** ☐ Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 3A






ZAI #: 166 Row #: 1 Photo No: **Cemetery:** St. Elizabeths West **Grave #: 7** Name(s) on marker: Hill, C.M. Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 7/C.M. HILL/CO. H/3D U.S./INF. Reverse: | marble granite other: Material: **Gravestone Size (inches):** Height: 8 Width: 8 Thickness: 2 Condition of Marker: cracked > broken 7 vandalized weathered | unattached loose biologicals stained repaired portions missing: Base of tombstone tilted: degrees: E-W N-S Other: **Grave Orientation:** NA Marker inscription faces what direction: 0° Condition of Grave: Top half of stone only. Found flat on ground at base of tree #634; returned to probable appropriate location. Surveyor: D. Hacker Date: 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next ☐ Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 7







ZAI #: 15 **Row #:** 1 Photo No: **Cemetery:** St. Elizabeths West **Grave #: 8** Name(s) on marker: Augustus, James Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 8/JAMES AUGUSTUS/CO.A/11TH/U.S. INF. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 17 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken 7 vandalized unattached loose biologicals stained repaired portions missing: chips right edge tilted: degrees: 50 E-W N-S **Grave Orientation:** East Marker inscription faces what direction: 80° **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/22/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 8

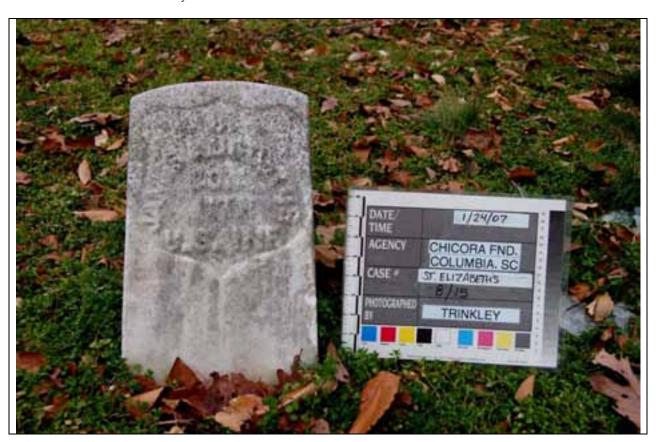




ZAI #: 340 **Row #:** 1 Photo No: **Cemetery:** St. Elizabeths West Grave #: 9 Name(s) on marker: Torbert, Peter Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: **Inscription:** 9/PETER TORBERT/8TH/N.Y. H.A. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 16 Width: 10 Thickness: 2 Condition of Marker: weathered 7 cracked broken \rightarrow vandalized unattached loose biologicals stained repaired portions missing: chips left middle tilted: degrees: 10 E-W N-S Other: mower damage **Grave Orientation:** East Marker inscription faces what direction: $80\,^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/22/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 9






ZAI #: 150 **Row #: 2** Photo No: **Cemetery:** St. Elizabeths West Grave #: 10 Name(s) on marker: Gum, Henry Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 10/HENRY GUM/CO. M/2D OHIO/CAV. Reverse: Material: | marble granite other: Gravestone Size (inches): Height: 10 Width: 10 Thickness: 2 Condition of Marker: weathered | cracked broken vandalized unattached loose biologicals X stained portions missing: repaired tilted: degrees: 15 E-W 5 N-S Other: **Grave Orientation:** East Marker inscription faces what direction: 60° Condition of Grave: This stone is probably in the wrong location; should be in Row 1 **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 10






ZAI #: 124 **Row #:** 1 Photo No: **Cemetery:** St. Elizabeths West Grave #: 14 Name(s) on marker: Faulkner, Henry Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 14/HENRY FAULKNER/CO. H/10TH/TENN.INF.. Reverse: Material: marble granite other: Gravestone Size (inches): Height: 20 Width: 10 Thickness: 2 Condition of Marker: weathered 7 cracked broken √vandalized unattached loose biologicals stained repaired portions missing: chips right and left sides tilted: degrees: 10 E-W N-S Other: **Grave Orientation:** East Marker inscription faces what direction: 80° **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/22/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 14





ZAI #: 37 Row #: 1 Photo No: **Cemetery:** St. Elizabeths West **Grave #: 15** Name(s) on marker: Bole, C.G. Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 15/C.G. BOLE/SGT./CO. I 8TH/N.Y. H.A. **Reverse:** marble granite other: Material: Gravestone Size (inches): Height: 20 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken 7 vandalized unattached loose biologicals stained repaired portions missing: tilted: degrees: 10 E-W Other: slight spalling at bottom N-S front **Grave Orientation:** East Marker inscription faces what direction: $80\,^{\rm o}$ **Condition of Grave:** satisfactory Date: 1/22/07 Surveyor: D. Hacker Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 15






ZAI #: 138 Row #: 1 Photo No: **Cemetery:** St. Elizabeths West Grave #: 18 Name(s) on marker: Gatrell, O.G. Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 18/O.G. GATRELL/CO. D/14TH N.J./INF. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 19 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken vandalized unattached loose biologicals X stained portions missing: repaired tilted: degrees: 15 E-W 10 N-S Other: **Grave Orientation:** East Marker inscription faces what direction: $80\,^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/22/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 18






ZAI #: 231 Row #: 1 Photo No: **Cemetery:** St. Elizabeths West Grave #: 19 Name(s) on marker: Mcbride, Andrew Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 19/AND'W. McBRIDE/CO. B/18TH/V.R.C. Reverse: Material: marble granite other: **Gravestone Size (inches):** Height: 15 Width: 10 Thickness: 2 Condition of Marker: weathered 7 cracked broken \[\text{vandalized} \] unattached loose biologicals stained repaired portions missing: chips at left base - mower damage tilted: degrees: 40 E-W 15 N-S Other: spalling in shield **Grave Orientation:** East Marker inscription faces what direction: 80° **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/22/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, re-

Current Condition Photograph on Rear

inspect in 5 years

Grave #: 19






Cemetery: St. Elizabeths West	Grave #: 20	ZAI #: 187	Row #: 1	Photo No:
Name(s) on marker: Keef, E.D.				
Type of Marker/Monument:: G	overnment Issue:	:		
	⊠ "Civil W □ General □ Other:	Var" – shield		
Inscription: 20/E.D. KEEF/CO.	B/54TH/N.Y. IN	IF.		
Reverse:				
Material: Marble	granite	other:		
Gravestone Size (inches): Ho	eight: 14	Width: 10	Thick	ness: 2
una rep	attached 🔲	cracked [loose [portions missing: 0 / 5 N-S	☐ broken ☑ biologicals chip right corner Other:	☐ vandalized ☑ stained
Grave Orientation: East	Marker ins	cription faces wha	at direction: 80 °	
Condition of Grave: satisfactory	7			
Surveyor: D. Hacker		:	Date: 1/22/07	
	Recom	mendations		
☐ Reset/level in ground; align ☐ Drill/pin to maintain histori ☐ Consolidate w/ HCT & OH- ☐ Consider replacement with ☐ Clean with D/2 & rinse ☐ Other:	c fabric 100 treatment	treatmer fiscal (2) ongoin treatm (3) no trea	ng, requires eent next 2-3 years atment required, re et in 5 years	3

Current Condition Photograph on Rear

Grave #: 20






ZAI #: 5 Row #: 1 Photo No: **Cemetery:** St. Elizabeths West Grave #: 21 Name(s) on marker: Allen, Jacob Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 21/JACOB ALLEN/CO. D/18TH N.Y./H.A. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 15 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken √vandalized unattached loose biologicals stained repaired portions missing: chip upper left corner ★ tilted: degrees: 5 E-W Other: N-S **Grave Orientation:** East Marker inscription faces what direction: E80 $^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/22/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 21





ZAI #: 209 Row #: 1 Photo No: **Cemetery:** St. Elizabeths West Grave #: 22 Name(s) on marker: Lawnell, William Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 22/WM. LAWNELL/CO []/183D/OHIO INF. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 14 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken √vandalized unattached loose biologicals stained repaired portions missing: ★ tilted: degrees: 5 E-W N-S Other: **Grave Orientation:** East Marker inscription faces what direction: E80 $^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/22/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 22






Cemetery: St. Elizabeths West	Grave #: 2 3	ZAI #: 36	Row #: 1	Photo No:
Name(s) on marker: Bluholcer,	Jonathan			
Type of Marker/Monument:: G	overnment Issue:	;		
	⊠ "Civil V □ General □ Other:	Var" – shield		
Inscription: 23/JONATHAN BI	LUHOLCER/CO.	К/15ТН/ОНІО І	NF.	
Reverse:				
Material: Marble	granite	other:		
Gravestone Size (inches): H	eight: 17	Width: 10	Thick	eness: 2
☐ un ☐ rep	attached 🔲	cracked loose portions missing: V N-S	☐ broken ☑ biologicals chip left side Other: mower da	□ vandalized □ stained amage
Grave Orientation: East	Marker ins	cription faces wh	at direction: $75^{\rm o}$	
Condition of Grave: satisfactory	y			
Surveyor: D. Hacker			Date: 1/22/07	
	Recom	mendations		
☐ Reset/level in ground; align ☐ Drill/pin to maintain histor ☐ Consolidate w/ HCT & OH- ☐ Consider replacement with ☐ Clean with D/2 & rinse ☐ Other:	ic fabric 100 treatment	treatmer fiscal (2) ongoing treatmer (3) no treatmer	ng, requires nent next 2-3 years atment required, re ct in 5 years	3

Grave #: 23






ZAI #: 103 Row #: 1 Photo No: **Cemetery:** St. Elizabeths West Grave #: 24 Name(s) on marker: Deurett, Isaac J. Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 24/ISAAC J. DEURETT/-----[note: the line carved at the end of this inscription indicates that the government did not have his assignment information] **Reverse:** Material: | marble granite other: **Gravestone Size (inches):** Height: 16 Width: 10 Thickness: 2 **Condition of Marker:** weathered cracked broken vandalized unattached loose ⊠ biologicals repaired portions missing: N-S Other: **Grave Orientation:** East Marker inscription faces what direction: 70 $^{\rm o}$ **Condition of Grave:** satisfactory Surveyor: D. Hacker **Date:** 1/22/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal vear (2) ongoing, requires Clean with D/2 & rinse Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 24






ZAI #: 288 Row #: 1 Photo No: **Cemetery:** St. Elizabeths West Grave #: 25 Name(s) on marker: Salley, L.M. Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: **Inscription:** 25/L.M. SALLEY/ME. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 14 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken vandalized unattached loose biologicals X stained repaired portions missing: ★ tilted: degrees: 5 E-W N-S Other: **Grave Orientation:** East Marker inscription faces what direction: $E60^{\circ}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/22/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 25





ZAI #: 301 **Row #:** 1 Photo No: **Cemetery:** St. Elizabeths West Grave #: 26 Name(s) on marker: Short, Nelson Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 26/NELSON SHORT/CO.C/ [1/INF. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 15 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken vandalized unattached loose biologicals stained repaired portions missing: tilted: degrees: 10 E-W 15 N-S Other: **Grave Orientation:** East Marker inscription faces what direction: $E60^{\circ}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/22/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 26






Cemetery: St. Elizabeths West	Grave #: 28	ZAI #: 353	Row #: 1	Photo No:
Name(s) on marker: West, J.A.				
Type of Marker/Monument:: G	overnment Issue:	:		
	⊠ "Civil W □ General □ Other:	Var" – shield		
Inscription: 28/J.A. WEST/CO.	C/25TH OHIO/I	INF.		
Reverse:				
Material: Marble	granite	other:		
Gravestone Size (inches): H	eight: 18	Width: 10	Thick	eness: 2
☐ un ☐ rep	attached 🔲	cracked [loose [portions missing: W 5 N-S	□ broken ⊠ biologicals Other:	☐ vandalized ☑ stained
Grave Orientation: East	Marker ins	cription faces wha	at direction: E60 °	
Condition of Grave: satisfactory	y			
Surveyor: D. Hacker			Date: 1/22/07	
_		mendations		
 ☐ Reset/level in ground; align ☐ Drill/pin to maintain histor ☐ Consolidate w/ HCT & OH- ☐ Consider replacement with ☐ Clean with D/2 & rinse ☐ Other: 	ic fabric 100 treatment	treatmer fiscal (2) ongoing treatm (3) no treatment from the first	ng, requires nent next 2-3 years atment required, re et in 5 years	3

Grave #: 28







ZAI #: 361 **Row #:** 1 Photo No: **Cemetery:** St. Elizabeths West **Grave #: 28a** Name(s) on marker: Winterbottom, Jno. Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 28A/JNO. WINTERBOTTOM/4TH R.I./BATTERY **Reverse:** marble granite other: Material: **Gravestone Size (inches):** Height: 18 Width: 10 Thickness: 2 Condition of Marker: 7 cracked broken weathered vandalized unattached loose biologicals stained repaired portions missing: chips lower right, prob mower damage X tilted: degrees: 10 E-W 10 N-S Other: **Grave Orientation:** East Marker inscription faces what direction: $E60\,^{\rm o}$ **Condition of Grave:** Date: 1/22/07 Surveyor: D. Hacker Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 28A

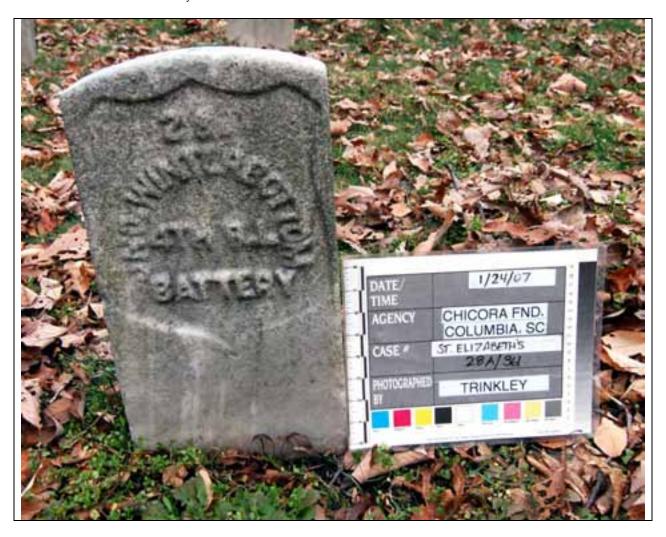




ZAI #: 162 **Row #:** 1 Photo No: **Cemetery:** St. Elizabeths West Grave #: 29 Name(s) on marker: Henn, F.N. Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: **Inscription:** 29/F.N. HENN/ORD./[]P Reverse: Material: | marble granite other: Gravestone Size (inches): Height: 15 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken vandalized unattached loose biologicals stained repaired portions missing: chips lower left - mower damage tilted: degrees: 5 E-W 5 N-S Other: spalling on lower right **Grave Orientation:** East Marker inscription faces what direction: $E60^{\circ}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/22/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 29






ZAI #: 130 **Row #:** 1 Photo No: **Cemetery:** St. Elizabeths West Grave #: 30 Name(s) on marker: Ford, J.C. Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: **Inscription:** 30/J.C. FORD/CO. F/18TH WIS./INF. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 16 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken \[\text{vandalized} \] unattached loose biologicals stained repaired portions missing: chips mid left side - mower damage tilted: degrees: 2 E-W 5 N-S Other: **Grave Orientation:** East Marker inscription faces what direction: 70 $^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/22/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years (4) irreparable

Grave #: 30






Cemetery: St. Elizabeths West	Grave #: 31	ZAI #: 358	Row #: 1	Photo No:
Name(s) on marker: Williams,	Chas.			
Type of Marker/Monument:: C	Government Issue	:		
	⊠ "Civil V □ General □ Other:	Var" – shield l		
Inscription: 31/CHAS. WILLIA	MS/CO. H/39TH	I N.Y./INF.		
Reverse:				
Material: Marble	granite	other:		
Gravestone Size (inches): H	eight: 15	Width: 10	Thick	eness: 2
ur rej			☐ broken ☑ biologicals chips right and left Other:	☐ vandalized ☐ stained sides
Grave Orientation: East	Marker ins	cription faces wh	at direction: $50~^{\rm o}$	
Condition of Grave: satisfactor	у			
Surveyor: D. Hacker			Date: 1/22/07	
_		nmendations		
 ☐ Reset/level in ground; align ☐ Drill/pin to maintain histon ☐ Consolidate w/ HCT & OH ☐ Consider replacement with ☐ Clean with D/2 & rinse ☐ Other: 	ic fabric -100 treatment	treatn er fiscal (2) ongoi treatn (3) no tre	ng, requires nent next 2-3 years atment required, re ct in 5 years	3

Grave #: 31






ZAI #: 332 **Row #:** 1 Photo No: **Cemetery:** St. Elizabeths West **Grave #: 32** Name(s) on marker: Thompson, Jno. Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: **Inscription:** 32/JNO. THOMPSON/N.Y. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 20 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken vandalized unattached loose biologicals stained repaired portions missing: tilted: degrees: 25 E-W 10 N-S Other: **Grave Orientation:** East Marker inscription faces what direction: 70 $^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/22/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 32






Cemetery: St. Elizabeths West	Grave #: 33	ZAI #: 359	Row #: 1	Photo No:
Name(s) on marker: Wilson, Ge	orge			
Type of Marker/Monument:: G	overnment Issue	:		
	⊠ "Civil V □ General □ Other:	Var" – shield		
Inscription: 33/GEO. WILSON/	CO. I/5TH R.I./	H.A.		
Reverse:				
Material: Marble	granite	other:		
Gravestone Size (inches): He	eight: 15	Width: 10	Thick	aness: 2
una rep	ittached 🔲	cracked [loose [portions missing: E-W 5 N-S	□ broken ☑ biologicals Other:	☐ vandalized ☐ stained
Grave Orientation: East	Marker ins	cription faces wha	at direction: $80^{\rm o}$	
Condition of Grave: satisfactory	,			
Surveyor: D. Hacker			Date: 1/22/07	
		mendations		
☐ Reset/level in ground; align ☐ Drill/pin to maintain histori ☐ Consolidate w/ HCT & OH- ☐ Consider replacement with a ☐ Clean with D/2 & rinse ☐ Other:	c fabric 100 treatment	treatmer fiscal (2) ongoin treatm (3) no trea	ng, requires tent next 2-3 years atment required, re tt in 5 years	3

Grave #: 33






ZAI #: 212 **Row #:** 1 Photo No: **Cemetery:** St. Elizabeths West **Grave #: 34** Name(s) on marker: Leeds, William C. Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 34/WM. C. LEEDS/CO. K/9TH N.H./INF. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 14 Width: 10 Thickness: 2 Condition of Marker: weathered 7 cracked broken \rightarrow vandalized unattached loose biologicals stained repaired portions missing: tilted: degrees: 5 E-W 5 N-S Other: spray paint on top **Grave Orientation:** East Marker inscription faces what direction: 70 $^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/22/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 34





ZAI #: 322 **Row #:** 1 Photo No: **Cemetery:** St. Elizabeths West Grave #: 35 Name(s) on marker: Stewart, David Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 35/DAVID STEWART/CO. L/4TH/MICH. CAV. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 14 Width: 10 Thickness: 2 Condition of Marker: weathered cracked broken \rightarrow vandalized unattached loose biologicals stained repaired portions missing: ★ tilted: degrees: 5 E-W N-S Other: **Grave Orientation:** East Marker inscription faces what direction: 70° Condition of Grave: Tree #615 is located just southeast of this marker **Surveyor:** D. Hacker **Date:** 1/22/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 35






Cemetery: St. Elizabeths West	Grave #: 36	ZAI #: 107	Row #: 1	Photo No:
Name(s) on marker: Dopp, Cyr	us			
Type of Marker/Monument:: G	overnment Issue	:		
	⊠ "Civil V □ General □ Other:	Var" – shield		
Inscription: 36/CYRUS DOPP/	19TH/MICHIGA	N		
Reverse:				
Material: Marble	granite	other:		
Gravestone Size (inches): H	eight: 13	Width: 10	Thick	cness: 2
☐ un ☐ rep	athered	cracked [loose [portions missing: E-W 5 N-S	□ broken ☑ biologicals Other:	☐ vandalized ☐ stained
Grave Orientation: East	Marker ins	cription faces wha	nt direction: $70^{\rm o}$	
Condition of Grave: satisfactory	Y			
Surveyor: D. Hacker			Date: 1/22/07	
_		nmendations		
 ☐ Reset/level in ground; align ☐ Drill/pin to maintain histor ☐ Consolidate w/ HCT & OH- ☐ Consider replacement with ☐ Clean with D/2 & rinse ☐ Other: 	ic fabric 100 treatment	treatmer fiscal (2) ongoing treatmer (3) no treatmer (3)	ng, requires lent next 2-3 years atment required, re et in 5 years	3

Grave #: 36







ZAI #: 309 **Row #:** 1 Photo No: **Cemetery:** St. Elizabeths West Grave #: 37 Name(s) on marker: Smart, William Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 37/WM. SMART/CO. R/3D MO. CAV. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 17 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken vandalized unattached loose biologicals stained portions missing: repaired tilted: degrees: 40 E-W 5 N-S Other: **Grave Orientation:** East Marker inscription faces what direction: 70 $^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/22/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 37

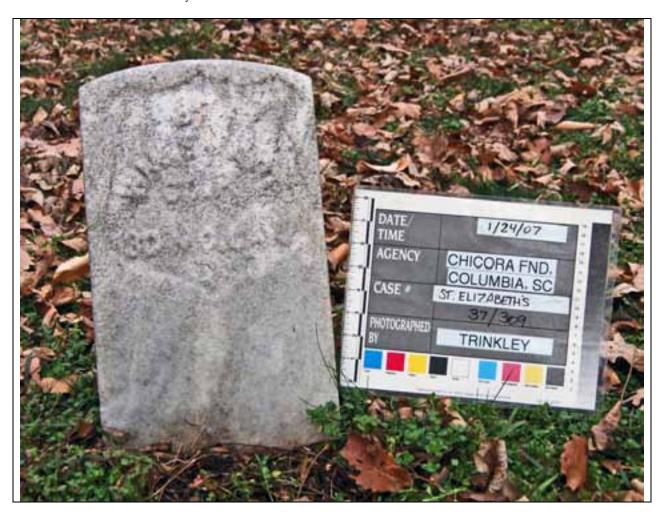




ZAI #: 157 **Row #:** 1 Photo No: **Cemetery:** St. Elizabeths West Grave #: 38 Name(s) on marker: Hayes, Peter Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: **Inscription:** 38/[PE]TER HAYES/CO. F/6TH N.Y./CAV. **Reverse:** marble granite other: Material: **Gravestone Size (inches):** Height: 11 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked √vandalized broken unattached loose biologicals stained portions missing: repaired tilted: degrees: 20 E-W 5 N-S Other: Abrasion to shield with loss of "PE" **Grave Orientation:** East Marker inscription faces what direction: 70 $^{\rm o}$ **Condition of Grave:** satisfactory Date: 1/22/07 Surveyor: D. Hacker Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 38





ZAI #: 197 **Row #:** 1 Photo No: **Cemetery:** St. Elizabeths West Grave #: 39 Name(s) on marker: Kluce, Theodore Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 39/TH[E]O. KLUCE/CO. A/20 U.S./CAV. Reverse: Material: marble granite other: **Gravestone Size (inches):** Height: 13 Width: 10 Thickness: 2 Condition of Marker: weathered 7 cracked broken vandalized unattached loose biologicals stained repaired portions missing: chips lower left side - mower damage tilted: degrees: 25 E-W 5 N-S **Grave Orientation:** East Marker inscription faces what direction: 60° **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/22/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 39






Cemetery: St. Elizabeths West	Grave #: 4 1	ZAI #: 144	Row #: 1	Photo No:
Name(s) on marker: Gray, Willi	am			
Type of Marker/Monument:: G	overnment Issue:	:		
	⊠ "Civil W □ General □ Other:	Var" – shield		
Inscription: []/WM. GRAY/C	O. []/3D. MO./0	CAV.		
Reverse:				
Material: 🔀 marble	granite	other:		
Gravestone Size (inches): He	ight: 15	Width: 10	Thicl	kness: 2
una rep	ıttached 🔲	portions missing:	□ broken □ biologicals base Other:	vandalized stained
Grave Orientation: East	Marker ins	cription faces wha	at direction: $70^{\rm o}$	
Condition of Grave: satisfactory				
Surveyor: D. Hacker			Date: 1/22/07	
	Recom	mendations		
 ☐ Reset/level in ground; align ☐ Drill/pin to maintain histori ☐ Consolidate w/ HCT & OH- ☐ Consider replacement with f ☐ Clean with D/2 & rinse ☐ Other: 	to existing row c fabric 100 treatment	(1) unstal treatn er fiscal (2) ongoi treatn (3) no tre	ng, requires nent next 2-3 years atment required, re ct in 5 years	2

Current Condition Photograph on Rear

Grave #: 41






ZAI #: 41 Row #: 1 Photo No: **Cemetery:** St. Elizabeths West Grave #: 47 Name(s) on marker: Brennan, James Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 47/JAMES BRENNAN/CO. C/34TH N.J./INF. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 19 Width: 10 Thickness: 2 Condition of Marker: weathered cracked > broken 7 vandalized unattached loose biologicals stained repaired portions missing: lower half tilted: degrees: E-W N-S Other: flat on ground **Grave Orientation:** NA Marker inscription faces what direction: **Condition of Grave:** Top of stone only; unable to locate base in ground; grave otherwise satisfactory. **Surveyor:** D. Hacker **Date:** 1/22/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 47






Cemetery: St. Elizabeths West	Grave #: 48	ZAI #: 79	Row #: 1	Photo No:
Name(s) on marker: Comings,	W. H.			
Type of Marker/Monument:: C	Government Issue:	:		
	⊠ "Civil V □ General □ Other:	Var" – shield		
Inscription: 48/W.H. COMINC	S/CO. I/15TH/N	I.J. INF.		
Reverse:				
Material: Marble	granite	other:		
Gravestone Size (inches): H	eight: 13	Width: 10	Thick	cness: 2
un rej	attached 🔲		broken biologicals extensive damage t Other: spalling	vandalized stained op, left side
Grave Orientation: East	Marker ins	cription faces wh	at direction: 70 °	
Condition of Grave: satisfactor	у			
Surveyor: D. Hacker			Date: 1/22/07	
_		mendations		
 ☑ Reset/level in ground; align ☑ Drill/pin to maintain histor ☑ Consolidate w/ HCT & OH ☑ Consider replacement with ☑ Clean with D/2 & rinse ☑ Other: 	-100 treatment	treatner fiscal (2) ongoi treatn (3) no tre	ng, requires nent next 2-3 years atment required, re ct in 5 years	2

Current Condition Photograph on Rear

Grave #: 48






ZAI #: 260 **Row #: 2** Photo No: **Cemetery:** St. Elizabeths West Grave #: 50 Name(s) on marker: Mulcahy, Michael Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: **Inscription:** 50/MICH'L. MULCAHY/CO. F/11TH/U.S. INF. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 8 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked > broken vandalized unattached loose biologicals stained portions missing: repaired tilted: degrees: 15 E-W N-S Other: **Grave Orientation:** East Marker inscription faces what direction: 70 $^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** ☐ Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 50






ZAI #: 86 Row #: 2 Photo No: **Cemetery:** St. Elizabeths West **Grave #:** 51 Name(s) on marker: Cook, William Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 51/WM. COOK/CO. []/8TH U.S./INF. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 16 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken √vandalized unattached loose biologicals stained repaired portions missing: tilted: degrees: 10 E-W N-S Other: **Grave Orientation:** East Marker inscription faces what direction: 60° **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 51






ZAI #: 259 **Row #: 2** Photo No: **Cemetery:** St. Elizabeths West Grave #: 60 Name(s) on marker: Morse, Elon Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 60/ELON MORSE/11TH/MASS./BATTERY Reverse: Material: | marble granite other: Gravestone Size (inches): Height: 16 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken vandalized unattached loose biologicals stained repaired portions missing: chips right and left sides tilted: degrees: 5 E-W 5 N-S Other: mower impact damage **Grave Orientation:** East Marker inscription faces what direction: 60° **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 60






ZAI #: 321 **Row #: 2** Photo No: **Cemetery:** St. Elizabeths West Grave #: 61 Name(s) on marker: Stanley, T.A. Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: **Inscription:** 61/T.A. STANLEY/CO. C/11TH U.S./INF. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 18 Width: 10 Thickness: 2 Condition of Marker: weathered 7 cracked broken √vandalized unattached loose biologicals stained repaired portions missing: chips right and left sides ★ tilted: degrees: 5 E-W Other: mower damage N-S **Grave Orientation:** East Marker inscription faces what direction: 60° **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 61





ZAI #: 106 Row #: 2 Photo No: **Cemetery:** St. Elizabeths West Grave #: 63 Name(s) on marker: Dolan, Patrick Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 63/PAT'K DOLAN/CO. I/10TH U.S./INF. Reverse: Material: | marble granite other: Gravestone Size (inches): Height: 19 Width: 10 Thickness: 2 Condition of Marker: vandalized weathered | 7 cracked broken unattached loose biologicals stained repaired portions missing: chip upper right top, left side tilted: degrees: 10 E-W 10 N-S Other: **Grave Orientation:** East Marker inscription faces what direction: 60° **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 63






ZAI #: 217 **Row #: 2** Photo No: **Cemetery:** St. Elizabeths West Grave #: 64 Name(s) on marker: Long, William Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 64/WM. LONG/CO. A/95TH N.Y./INF. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 19 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken vandalized unattached loose biologicals stained repaired portions missing: chip left side tilted: degrees: 5 E-W 5 N-S **Grave Orientation:** East Marker inscription faces what direction: 60° Condition of Grave: satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 64






ZAI #: 26 **Row #: 2** Photo No: **Cemetery:** St. Elizabeths West Grave #: 65 Name(s) on marker: Bechtel, Jonathon Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 65/JNO. BECHTEL/4TH/U.S. ART. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 19 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken √vandalized unattached loose biologicals stained repaired portions missing: chips right and left sides tilted: degrees: 10 E-W 5 N-S Other: mower damage **Grave Orientation:** East Marker inscription faces what direction: 60° Condition of Grave: satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 65






ZAI #: 256 **Row #: 2** Photo No: **Cemetery:** St. Elizabeths West Grave #: 67 Name(s) on marker: Malloy, Patrick Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 67/PAT'K. MALLOY/CO. F/27TH PA./INF. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 18 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken 7 vandalized unattached loose biologicals stained repaired portions missing: chip left mid section tilted: degrees: 10 E-W N-S Other: **Grave Orientation:** East Marker inscription faces what direction: 60° **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 67






ZAI #: 120 **Row #: 2** Photo No: **Cemetery:** St. Elizabeths West Grave #: 68 Name(s) on marker: Evaston, Fred. Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 68/FRED. EVASTON/CO. A/5TH WIS./INF. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 19 Width: 10 Thickness: 2 Condition of Marker: weathered 7 cracked broken \rightarrow vandalized unattached loose biologicals stained repaired portions missing: ★ tilted: degrees: 5 E-W Other: spall in face N-S **Grave Orientation:** East Marker inscription faces what direction: 60° **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 68






ZAI #: 248 **Row #: 2** Photo No: **Cemetery:** St. Elizabeths West Grave #: 69 Name(s) on marker: Menker, Henry Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 69/HENRY MENKER/88TH/CO./2D BATT'N./V.R.C. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 17 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken √vandalized unattached loose biologicals stained repaired portions missing: chips left side tilted: degrees: 10 E-W N-S **Grave Orientation:** East Marker inscription faces what direction: 50° Condition of Grave: **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, re-

Current Condition Photograph on Rear

inspect in 5 years

Grave #: 69






ZAI #: 310 **Row #: 2** Photo No: **Cemetery:** St. Elizabeths West Grave #: 72 Name(s) on marker: Smith, A.C. Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 72/A.C. SMITH/CO. B/15TH [ILL.]/INF. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 17 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken 7 vandalized unattached loose biologicals stained repaired portions missing: chip lower right tilted: degrees: 10 E-W 5 N-S Other: mower damage **Grave Orientation:** East Marker inscription faces what direction: 70 $^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 72






ZAI #: 114 **Row #: 2** Photo No: **Cemetery:** St. Elizabeths West Grave #: 74 Name(s) on marker: Duvall, Eugene Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 74/E[U]G[ENE] DUVALL/CO. []/[] N.Y./INF. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 17 Width: 10 Thickness: 2 Condition of Marker: weathered 7 cracked broken \rightarrow vandalized unattached loose biologicals stained repaired portions missing: chips top, lower right tilted: degrees: 10 E-W 10 N-S Other: mower damage **Grave Orientation:** East Marker inscription faces what direction: 60° Condition of Grave: satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 74






ZAI #: 44 **Row #:** 3 Photo No: **Cemetery:** St. Elizabeths West **Grave #: 75** Name(s) on marker: Brower, P.A. Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: **Inscription:** 75/P.A. BROWER/2D/U.S. ART. Reverse: other: Material: | marble granite Thickness: 2 **Gravestone Size (inches):** Height: 13 Width: 10 **Condition of Marker:** weathered cracked > broken vandalized unattached loose biologicals stained repaired portions missing: tilted: degrees: 40 E-W N-S Other: **Grave Orientation:** East Marker inscription faces what direction: 80° Condition of Grave: satisfactory Date: 1/23/07 **Surveyor:** D. Hacker Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 75





ZAI #: 19 **Row #: 2** Photo No: **Cemetery:** St. Elizabeths West Grave #: 76 Name(s) on marker: Bailey, Isaac Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 76/[ISA]AC [BA]ILEY/CO. F/[1]13TH OHIO Reverse: Material: | marble granite other: Gravestone Size (inches): Height: 18 Width: 10 Thickness: 2 Condition of Marker: weathered 7 cracked broken vandalized unattached loose biologicals stained repaired portions missing: chips right and left sides tilted: degrees: 5 E-W Other: new damage to right top N-S **Grave Orientation:** East Marker inscription faces what direction: $80\,^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 76






Cemetery: St. Elizabeths West	Grave #: 77	ZAI #: 188	Row #: 2	Photo No:
Name(s) on marker: Kellogg, A.	C.			
Type of Marker/Monument:: G	overnment Issue:	:		
		Var" – shield		
Inscription: 77/A.C. KELLOGG	/CO. A/49TH IN	ID./INF.		
Reverse:				
Material: Marble	granite	other:		
Gravestone Size (inches): He	eight: 16	Width: 10	Thick	ness: 2
una rep	nttached 🔲	- 0	broken biologicals right and left sides Other:	vandalized stained
Grave Orientation: East	Marker ins	cription faces wha	at direction: 80 °	
Condition of Grave: satisfactory	,			
Surveyor: D. Hacker			Date: 1/23/07	
	Recom	mendations		
☐ Reset/level in ground; align ☐ Drill/pin to maintain histori ☐ Consolidate w/ HCT & OH- ☐ Consider replacement with ☐ Clean with D/2 & rinse ☐ Other:	c fabric 100 treatment	treatmer fiscal (2) ongoin treatm (3) no trea	ng, requires tent next 2-3 years atment required, re tt in 5 years	3

Current Condition Photograph on Rear

Grave #: 77






ZAI #: 216 **Row #: 2** Photo No: **Cemetery:** St. Elizabeths West **Grave #: 78** Name(s) on marker: Lewis, James Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: **Inscription:** 78/JAMES LEWIS/CO. []/PA. H.A. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 17 Width: 10 Thickness: 2 Condition of Marker: weathered 7 cracked broken 7 vandalized unattached loose biologicals stained repaired portions missing: tilted: degrees: 10 E-W 5 N-S Other: mower damage **Grave Orientation:** East Marker inscription faces what direction: $100\,^{\circ}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 78






ZAI #: 141 **Row #: 2** Photo No: **Cemetery:** St. Elizabeths West Grave #: 79 Name(s) on marker: Goodwin, Elisha Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: **Inscription:** 79/ELISHA GOODWIN/CO. []/6TH MD./INF. Reverse: Material: marble granite other: **Gravestone Size (inches):** Height: 13 Width: 10 Thickness: 2 Condition of Marker: weathered 7 cracked broken √vandalized unattached loose biologicals stained repaired portions missing: chips left and right sides tilted: degrees: 20 E-W N-S **Grave Orientation:** East Marker inscription faces what direction: 80° Condition of Grave: satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 79






ZAI #: 357 **Row #: 2** Photo No: **Cemetery:** St. Elizabeths West Grave #: 80 Name(s) on marker: Willard, Rachbrook Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 80/RACHBROO[K] [WI]LLARD/CO. K/2D CAL./CAV. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 25 Width: 10 Thickness: 2 Condition of Marker: weathered 7 cracked broken 7 vandalized unattached loose biologicals stained repaired portions missing: chip right side tilted: degrees: 10 E-W 5 N-S Other: set high **Grave Orientation:** East Marker inscription faces what direction: $80\,^{\rm o}$ Condition of Grave: satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 80






ZAI #: 193 Row #: 3 Photo No: **Cemetery:** St. Elizabeths West **Grave #: 81** Name(s) on marker: Hesch, Moritz Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: **Inscription:** 81 / MORITZ [HE]SCH / CO. H /74TH / PA. INF. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 10 Width: 10 Thickness: 2 Condition of Marker: weathered | cracked vandalized × broken unattached loose biologicals stained repaired portions missing: base of stone tilted: degrees: E-W N-S Other: **Grave Orientation:** Marker inscription faces what direction: Condition of Grave: not associated with grave; probably transported downslope from Row 2 **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 81






ZAI #: 152 **Row #:** 3 Photo No: **Cemetery:** St. Elizabeths West Grave #: 82 Name(s) on marker: Hannah, Jonathon Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 82/JNO. HANNAH/U.S.A. Reverse: other: Material: | marble granite Thickness: 2 **Gravestone Size (inches):** Height: 22 Width: 10 Condition of Marker: weathered cracked > broken vandalized unattached loose biologicals stained portions missing: lower half of stone repaired tilted: degrees: E-W N-S Other: flat on ground **Grave Orientation:** Marker inscription faces what direction: **Condition of Grave:** satisfactory Date: 1/23/07 **Surveyor:** D. Hacker Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 82






ZAI #: 10 **Row #: 2** Photo No: **Cemetery:** St. Elizabeths West **Grave #: 97** Name(s) on marker: Anderson, Peter Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: PETER ANDERSON/CO. E/15TH/WIS. INF. Reverse: Material: marble granite other: **Gravestone Size (inches):** Height: 17 Width: 10 Thickness: 2 Condition of Marker: weathered 7 cracked broken √vandalized unattached loose biologicals stained repaired portions missing: chip upper left side tilted: degrees: 45 E-W 10 N-S Other: **Grave Orientation:** East Marker inscription faces what direction: 70° Condition of Grave: satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 97






Cemetery: St. Elizabeths West	Grave #: 99	ZAI #: 342	Row #: 3	Photo No:
Name(s) on marker: Trombley,	Peter			
Type of Marker/Monument:: G	overnment Issue	:		
- y r		Var" - shield		
Inscription: C/PETER TROMBI	EY/8TH/MICH	./INF.		
Reverse:				
Material: Marble	granite	other:		
Gravestone Size (inches): He	eight: 9	Width: 10	Thick	ness: 2
una rep	nttached 🔲	cracked [loose [portions missing: E-W N-S	broken biologicals lower half of stone Other: flat on g	vandalized stained
Grave Orientation: NA	Marker ins	cription faces wha	nt direction:	
Condition of Grave: satisfactory	7			
Surveyor: D. Hacker			Date: 1/23/07	
_		nmendations		
 ☐ Reset/level in ground; align ☐ Drill/pin to maintain histori ☐ Consolidate w/ HCT & OH- ☐ Consider replacement with ☐ Clean with D/2 & rinse ☐ Other: 	c fabric 100 treatment	treatmer fiscal (2) ongoing treatmer (3) no treatmer (3)	ng, requires lent next 2-3 years atment required, re tt in 5 years	1

Grave #: 99





ZAI #: 246 **Row #:** 3 Photo No: **Cemetery:** St. Elizabeths West **Grave #:** 103 Name(s) on marker: Mcpherson, Samuel Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: SAM[UEL] [McPHERSON]/CO. [I]/[2]2D PA./CAV. Reverse: Material: | marble granite other: Gravestone Size (inches): Height: 25 Width: 10 Thickness: 2 Condition of Marker: weathered 7 cracked > broken vandalized unattached loose biologicals stained repaired portions missing: center top & R. upper front corner tilted: degrees: 10 E-W N-S Other: **Grave Orientation:** East Marker inscription faces what direction: 65° Condition of Grave: satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 103






Cemetery: St. Elizabeths West	Grave #: 105	ZAI #: 33	Row #: 3	Photo No:
Name(s) on marker: Biekert, Joi	nathon			
Type of Marker/Monument:: G	overnment Issue:			
		/ar" – shield		
Inscription: 105/JNO. BIEKERT	/CO. E/41ST/N.`	Y. INF.		
Reverse:				
Material:	granite	other:		
Gravestone Size (inches): He	eight: 15	Width: 10	Thick	ness: 2
una rep	nttached 🔲 1		broken biologicals chips right and left Other:	vandalized stained sides
Grave Orientation: East	Marker inso	cription faces wh	at direction: 65 °	
Condition of Grave: satisfactory	7			
Surveyor: D. Hacker			Date: 1/23/07	
	Recom	mendations		
⊠ Reset/level in ground; align □ Drill/pin to maintain histori □ Consolidate w/ HCT & OH- □ Consider replacement with a clean with D/2 & rinse □ Other:	c fabric 100 treatment	treatn er fiscal (2) ongoi treatn (3) no tre	ng, requires nent next 2-3 years atment required, re ct in 5 years	2

Grave #: 105





ZAI #: 232 **Row #:** 3 Photo No: **Cemetery:** St. Elizabeths West **Grave #:** 106 Name(s) on marker: Mccormick, Daniel Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 106/DAN'L McCORMICK/CO. I/21ST U.S./CAV. Reverse: Material: | marble granite other: Gravestone Size (inches): Height: 18 Width: 10 Thickness: 2 Condition of Marker: weathered 7 cracked broken \rightarrow vandalized unattached loose biologicals stained repaired portions missing: chips right and left sides tilted: degrees: 15 E-W 10 N-S Other: **Grave Orientation:** East Marker inscription faces what direction: 50° **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 106





ZAI #: 318 **Row #:** 3 Photo No: **Cemetery:** St. Elizabeths West Grave #: 110 Name(s) on marker: Smith, S.M. Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 110/S.M. SMITH/CO. I/80 ME./INF. Reverse: other: Material: | marble granite **Gravestone Size (inches):** Height: 17 Width: 10 Thickness: 2 **Condition of Marker:** weathered cracked broken vandalized loose unattached biologicals stained portions missing: chips right and left sides repaired tilted: degrees: 10 E-W 15 N-S Other: center spall **Grave Orientation:** East Marker inscription faces what direction: 65° Condition of Grave: satisfactory Date: 1/23/07 **Surveyor:** D. Hacker Recommendations \boxtimes Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years (4) irreparable

Grave #: 110






Cemetery: St. Elizabeths West	Grave #: 111	ZAI #: 265	Row #: 3	Photo No:
Name(s) on marker: Oatses, D.	C.			
Type of Marker/Monument:: C	Government Issue:			
	⊠ "Civil W □ General □ Other:	Jar" – shield		
Inscription: 111/D.C. OATSES,	/CO. O/128TH IN	D./INF.		
Reverse:				
Material: Marble	granite	other:		
Gravestone Size (inches): H	eight: 15	Width: 10	Thick	ness: 2
un rej	attached 🔲		broken biologicals chips right and left Other:	vandalized stained corners, left side
Grave Orientation: East	Marker inso	cription faces wha	at direction: 85 °	
Condition of Grave: satisfactor	y			
Surveyor: D. Hacker			Date: 1/23/07	
_		mendations		
☐ Reset/level in ground; align ☐ Drill/pin to maintain histor ☐ Consolidate w/ HCT & OH ☐ Consider replacement with ☐ Clean with D/2 & rinse ☐ Other:	ic fabric -100 treatment	treatmer fiscal (2) ongoing treatmer (3) no tre	ng, requires nent next 2-3 years atment required, re ct in 5 years	2

Grave #: 111






ZAI #: 132 **Row #:** 3 Photo No: **Cemetery:** St. Elizabeths West **Grave #:** 113 Name(s) on marker: Fox, Newton Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: **Inscription:** 113/NEWTON FOX/39TH/ILL. INF. Reverse: other: Material: | marble granite **Gravestone Size (inches):** Height: 18 Width: 10 Thickness: 2 **Condition of Marker:** weathered cracked broken vandalized loose unattached ⊠ biologicals stained portions missing: chips right and left sides repaired tilted: degrees: 10 E-W N-S Other: **Grave Orientation:** East Marker inscription faces what direction: 65° Condition of Grave: satisfactory Date: 1/23/07 **Surveyor:** D. Hacker Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 113





Cemetery: St. Elizabeths West	Grave #: 116	ZAI #: 21	Row #: 3	Photo No:
Name(s) on marker: Barney, Te	eddo			
Type of Marker/Monument:: G	overnment Issue:			
	⊠ "Civil W □ General □ Other:	Jar" – shield		
Inscription: 116/TEDDO BARN	IEY/CO. A/1ST U	J.S./CAV.		
Reverse:				
Material: Marble	granite	other:		
Gravestone Size (inches): He	eight: 18	Width: 10	Thick	ness: 2
☐ un. ☐ rep	attached 🔲 1	cracked loose portions missing: W 5 N-S	broken biologicals chip left side Other:	vandalized stained
Grave Orientation: East	Marker inso	cription faces wh	at direction: 65 °	
Condition of Grave: satisfactory	7			
Surveyor: D. Hacker			Date: 1/23/07	
_		mendations		
☐ Reset/level in ground; align ☐ Drill/pin to maintain histor ☐ Consolidate w/ HCT & OH- ☐ Consider replacement with ☐ Clean with D/2 & rinse ☐ Other:	c fabric 100 treatment	treatmer fiscal (2) ongoing treatmer (3) no treatmer	ng, requires nent next 2-3 years atment required, re ct in 5 years	2


Grave #: 116






Cemetery: St. Elizabeths West	Grave #: 117	ZAI #: 271	Row #: 3	Photo No:
Name(s) on marker: Paine, D.C).			
Type of Marker/Monument:: G	overnment Issue:			
	⊠ "Civil W □ General □ Other:	Jar" – shield		
Inscription: 117/D.O. PAINE/O	CO. B/11TH PA./I	INF.		
Reverse:				
Material: Marble	granite	other:		
Gravestone Size (inches): H	eight: 19	Width: 10	Thick	ness: 2
☐ un ☐ rep	attached 🔲 1		broken biologicals chip/spall left side Other:	vandalized stained
Grave Orientation: East	Marker inso	cription faces wh	at direction: 60°	
Condition of Grave: satisfactor	y			
Surveyor: D. Hacker			Date: 1/23/07	
_		mendations		
 ☐ Reset/level in ground; align ☐ Drill/pin to maintain histor ☐ Consolidate w/ HCT & OH ☐ Consider replacement with ☐ Clean with D/2 & rinse ☐ Other: 	ic fabric 100 treatment	treatner fiscal (2) ongoi treatn (3) no tre	ng, requires nent next 2-3 years atment required, re ct in 5 years	3

Grave #: 117

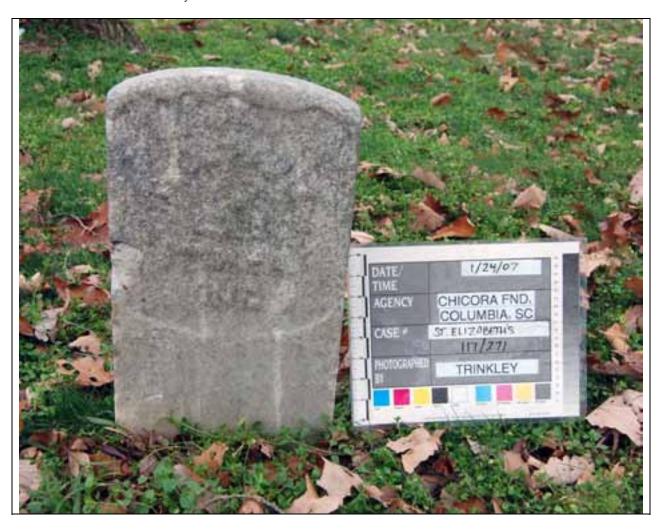



Cemetery: St. Elizabeths West	Grave #: 118	ZAI #: 39	Row #: 3	Photo No:
Name(s) on marker: Bradley, I	L.S.			
Type of Marker/Monument:: C	Government Issue:			
	⊠ "Civil W □ General □ Other:	ar" – shield		
Inscription: 118/L.S. BRADLE	Y/CO. C/18TH V.I	R.C.		
Reverse:				
Material: 🔀 marble	granite	other:		
Gravestone Size (inches): H	leight: 18	Width: 10	Thick	eness: 2
ur re	nattached 🔲 1		broken biologicals spall upper right co Other: mower da	
Grave Orientation: East	Marker inso	cription faces wh	at direction: $40^{ m o}$	
Condition of Grave: satifactory	7			
Surveyor: D. Hacker			Date: 1/23/07	
		mendations		
 ☐ Reset/level in ground; align ☐ Drill/pin to maintain histon ☐ Consolidate w/ HCT & OH ☐ Consider replacement with ☐ Clean with D/2 & rinse ☐ Other: 	ric fabric -100 treatment	treatr fiscal (2) ongo treatr (3) no tre	ing, requires nent next 2-3 years eatment required, re ect in 5 years	3

Grave #: 118





Cemetery: St. Elizabeths West	Grave #: 119	ZAI #: 334	Row #: 3	Photo No:
Name(s) on marker: Tilton, J.B	S.			
Type of Marker/Monument:: G	overnment Issue:			
	⊠ "Civil W □ General □ Other:	ar" – shield		
Inscription: 119/J.B.S. TILTON	I/CO. F/4TH N.H.	./INF.		
Reverse:				
Material: Marble	granite	other:		
Gravestone Size (inches): H	eight: 17	Width: 10	Thick	ness: 2
☐ un ☐ rep	attached 🔲 1		broken biologicals chips right and left: Other: mower da	
Grave Orientation: East	Marker inso	cription faces wha	at direction: 45 °	
Condition of Grave: satisfactor	y			
Surveyor: D. Hacker			Date: 1/23/07	
_		mendations		
 ☐ Reset/level in ground; align ☐ Drill/pin to maintain histor ☐ Consolidate w/ HCT & OH ☐ Consider replacement with ☐ Clean with D/2 & rinse ☐ Other: 	ic fabric 100 treatment	treatmer fiscal (2) ongoi treatm (3) no tre	ng, requires nent next 2-3 years atment required, re ct in 5 years	3


Grave #: 119






ZAI #: 291 Row #: 3 Photo No: **Cemetery:** St. Elizabeths West Grave #: 120 Name(s) on marker: Sauserauch, David Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 120/DAVID SAUSERAUCH/SGT./CO. H/23D KY./INF. Reverse: other: Material: | marble granite **Gravestone Size (inches):** Height: 18 Width: 10 Thickness: 2 Condition of Marker: weathered cracked broken vandalized loose unattached biologicals stained repaired portions missing: chip lower left side tilted: degrees: 10 E-W 5 N-S Other: mower damage **Grave Orientation:** East Marker inscription faces what direction: $40\,^{\rm o}$ Condition of Grave: satisfactory **Date:** 1/23/07 **Surveyor:** D. Hacker Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years (4) irreparable

Grave #: 120

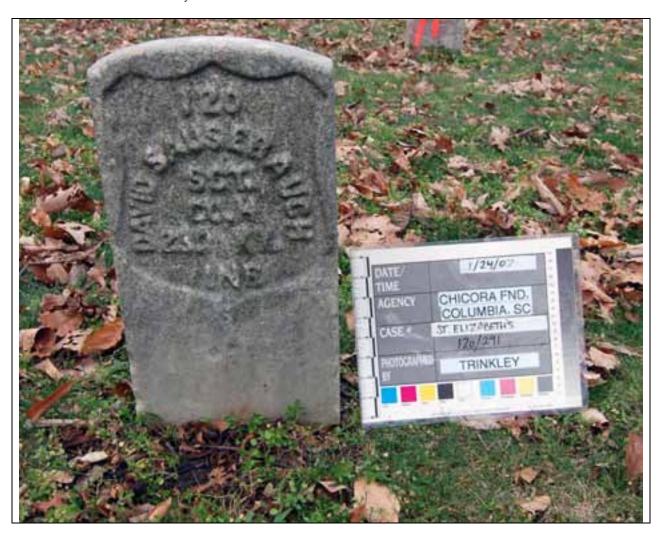




Cemetery: St. Elizabeths West	Grave #: 121	ZAI #: 313	Row #: 3	Photo No:
Name(s) on marker: Smith, C.A				
Type of Marker/Monument:: G	overnment Issue:			
		Var" - shield		
Inscription: 121/C.A. SMITH/C	CO. D/10TH U.S./	INF.		
Reverse:				
Material: Marble	granite	other:		
Gravestone Size (inches): He	eight: 19	Width: 10	Thick	ness: 2
una rep	nttached 🔲	portions missing:	□ broken ☑ biologicals chip left side Other: mower d	☐ vandalized ☐ stained amage
Grave Orientation: East	Marker ins	cription faces wha	at direction: 70 °	
Condition of Grave: satisfactory	7			
Surveyor: D. Hacker			Date: 1/23/07	
	Recom	mendations		
 ☐ Reset/level in ground; align ☐ Drill/pin to maintain histori ☐ Consolidate w/ HCT & OH- ☐ Consider replacement with ☐ Clean with D/2 & rinse ☐ Other: 	c fabric 100 treatment	treatmer fiscal (2) ongoing treatmer (3) no tre	ng, requires nent next 2-3 years atment required, re ct in 5 years	3

Grave #: 121






ZAI #: 18 **Row #:** 3 Photo No: **Cemetery:** St. Elizabeths West Grave #: 124 Name(s) on marker: Bacley, Freeman Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: **Inscription:** 124/FREEMAN BACLEY/CO. F/37TH/WIS. INF. Reverse: other: Material: | marble granite Height: 15 **Gravestone Size (inches):** Width: 10 Thickness: 2 Condition of Marker: weathered cracked broken vandalized loose unattached ⊠ biologicals stained repaired portions missing: chips right side tilted: degrees: 5 E-W 5 N-S Other: mower damage **Grave Orientation:** East Marker inscription faces what direction: 75° **Condition of Grave:** satisfactory **Date:** 1/23/07 **Surveyor:** D. Hacker Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 124






ZAI #: 145 **Row #:** 3 Photo No: **Cemetery:** St. Elizabeths West Grave #: 126 Name(s) on marker: Green, Leonard Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: **Inscription:** 126/LEONARD GREEN/CO. E/72D IND./INF. Reverse: other: Material: | marble granite **Gravestone Size (inches):** Height: 18 Width: 10 Thickness: 2 **Condition of Marker:** weathered cracked broken vandalized unattached loose biologicals stained repaired portions missing: tilted: degrees: 10 E-W 5 N-S Other: **Grave Orientation:** East Marker inscription faces what direction: 75° Condition of Grave: satisfactory **Date:** 1/23/07 **Surveyor:** D. Hacker Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 126






Cemetery: St. Elizabeths West	Grave #: 127	ZAI #: 174	Row #: 3	Photo No:
Name(s) on marker: Howie, J.J				
Type of Marker/Monument:: G	overnment Issue:			
	⊠ "Civil W □ General □ Other:	Jar" – shield		
Inscription: 127/J.J. HOWIE/F	'A./INF.			
Reverse:				
Material: Marble	granite	other:		
Gravestone Size (inches): H	eight: 17	Width: 10	Thick	kness: 2
☐ un ☐ rep	attached 🔲 1		broken biologicals chips right and left Other:	☐ vandalized ☐ stained sides
Grave Orientation: East	Marker inso	cription faces wh	at direction: 75 °	
Condition of Grave: satisfactor	y			
Surveyor: D. Hacker			Date: 1/23/07	
_		mendations		
☐ Reset/level in ground; align ☐ Drill/pin to maintain histor ☐ Consolidate w/ HCT & OH- ☐ Consider replacement with ☐ Clean with D/2 & rinse ☐ Other:	ic fabric 100 treatment	treatmer fiscal (2) ongoi treatm (3) no tre	ng, requires nent next 2-3 years atment required, re ct in 5 years	2

Grave #: 127






Cemetery: St. Elizabeths West	Grave #: 128	ZAI #: 274	Row #: 3	Photo No:
Name(s) on marker: Pride, J.C.				
Type of Marker/Monument:: G	Sovernment Issue:			
	⊠ "Civil W □ General □ Other:	Jar" – shield		
Inscription: 128/J.C. PRIDE/C	HICAGO MERC./	BATTERY./ILL.		
Reverse:				
Material: Marble	granite	other:		
Gravestone Size (inches): H	eight: 19	Width: 10	Thick	ness: 2
☐ un ☐ rep	attached 🔲 1	cracked [loose [portions missing: W N-S	broken biologicals Other: mower da	☐ vandalized ☑ stained ımage
Grave Orientation: East	Marker inso	cription faces wha	at direction: 70 °	
Condition of Grave:				
Surveyor: D. Hacker			Date: 1/23/07	
_		mendations		
 ☐ Reset/level in ground; align ☐ Drill/pin to maintain histor ☐ Consolidate w/ HCT & OH ☐ Consider replacement with ☐ Clean with D/2 & rinse ☐ Other: 	ic fabric -100 treatment	treatmer fiscal (2) ongoing treatmer (3) no tre	ng, requires nent next 2-3 years atment required, re ct in 5 years	3

Grave #: 128






ZAI #: 314 **Row #:** 3 Photo No: **Cemetery:** St. Elizabeths West Grave #: 131 Name(s) on marker: Smith, C.T. Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: **Inscription:** 131/C.T. SMITH/CO. M/11TH ILL./CAV. Reverse: other: Material: | marble granite **Gravestone Size (inches):** Height: 20 Width: 10 Thickness: 2 **Condition of Marker:** weathered cracked broken vandalized unattached loose biologicals X stained repaired portions missing: tilted: degrees: 10 E-W 5 N-S Other: **Grave Orientation:** East Marker inscription faces what direction: $85\,^{\rm o}$ Condition of Grave: satisfactory Date: 1/23/07 **Surveyor:** D. Hacker Recommendations \boxtimes Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 131





ZAI #: 28 **Row #:** 11 Photo No: **Cemetery:** St. Elizabeths West **Grave #:** 133A Name(s) on marker: Bender, Peter Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: **Inscription:** [133]/PETER BENDER/CO. C/37TH/OHIO INF. Reverse: Material: | marble granite other: Gravestone Size (inches): Height: 9 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken \rightarrow vandalized unattached loose biologicals stained repaired portions missing: chips top, right and left sides tilted: degrees: 20 E-W 5 N-S Other: sunk into ground **Grave Orientation:** East Marker inscription faces what direction: $65\,^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/24/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years (4) irreparable

Grave #: 133A






Cemetery: St. Elizabeths West	Grave #: 133	ZAI #: 29	Row #: 3	Photo No:
Name(s) on marker: Bennett, C	onnor			
Type of Marker/Monument:: G	overnment Issue:			
	⊠ "Civil W □ General □ Other:	Jar" – shield		
Inscription: 133/CONNOR BE	NNETT/CO.D/12	TH CONN./INF.		
Reverse:				
Material: Marble	granite	other:		
Gravestone Size (inches): He	eight: 18	Width: 10	Thick	ness: 2
☐ un. ☐ rep	attached 🔲 1		broken biologicals right and left sides Other: mower da	□ vandalized ☑ stained nmage
Grave Orientation: East	Marker inso	cription faces wha	at direction: 85 °	
Condition of Grave: satisfactory	7			
Surveyor: D. Hacker			Date: 1/23/07	
_		mendations		
 ☑ Reset/level in ground; align ☐ Drill/pin to maintain histor ☐ Consolidate w/ HCT & OH- ☐ Consider replacement with ☑ Clean with D/2 & rinse ☐ Other: 	c fabric 100 treatment	treatmer fiscal (2) ongoing treatmer (3) no tre	ng, requires nent next 2-3 years atment required, re ct in 5 years	2


Grave #: 133





ZAI #: 204 Row #: 4 Photo No: **Cemetery:** St. Elizabeths West **Grave #:** 136 Name(s) on marker: Landgren, Carl Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 136/CARL LANDGREN/CO. A/56TH/MASS. INF. Reverse: Material: | marble granite other: Gravestone Size (inches): Height: 19 Width: 10 Thickness: 2 Condition of Marker: vandalized weathered | 7 cracked broken unattached loose biologicals stained repaired portions missing: chipped right and left sides tilted: degrees: 10 E-W 20 N-S Other: mower damage **Grave Orientation:** East Marker inscription faces what direction: 90 $^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years (4) irreparable






Cemetery: St. Elizabeths West	Grave #: 139	ZAI #: 323	Row #: 4	Photo No:
Name(s) on marker: Stewart, Jos	nathon			
Type of Marker/Monument:: G	overnment Issue:			
- y r		Var" - shield		
Inscription: 139/JNO. STEWAR	T/CO. D/96TH/	PA. INF.		
Reverse:				
Material: 🔀 marble	granite	other:		
Gravestone Size (inches): He	eight: 20	Width: 10	Thick	eness: 2
una rep	attached 🔲	cracked [loose [portions missing:] E-W N-S	broken biologicals lower half of stone Other: flat on gro	vandalized stained
Grave Orientation:	Marker ins	cription faces wha	at direction:	
Condition of Grave: satisfactory	7			
Surveyor: D. Hacker			Date: 1/23/07	
	Recom	mendations		
 □ Reset/level in ground; align □ Drill/pin to maintain histori □ Consolidate w/ HCT & OH- □ Consider replacement with □ Clean with D/2 & rinse □ Other: 	c fabric 100 treatment	treatmer fiscal (2) ongoin treatm (3) no trea	ng, requires eent next 2-3 years atment required, re et in 5 years	1

Grave #: 139






ZAI #: 208 Row #: 4 Photo No: **Cemetery:** St. Elizabeths West Grave #: 140 Name(s) on marker: Lavell, Michael Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 140/MICH'L LAVELL/CO. I/4TH/OHIO INF. Reverse: Material: | marble granite other: Gravestone Size (inches): Height: 17 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken 7 vandalized unattached loose biologicals stained repaired portions missing: chipped tilted: degrees: 10 E-W 15 N-S Other: abrasion across shield **Grave Orientation:** East Marker inscription faces what direction: $100\,^{\circ}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 140






ZAI #: 85 Row #: 4 Photo No: **Cemetery:** St. Elizabeths West Grave #: 141 Name(s) on marker: Cook, James Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 141/JAMES COOK/CO. I/11TH N.J./INF. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 17 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken vandalized unattached loose biologicals repaired portions missing: chipped right and left sides tilted: degrees: 10 E-W 10 N-S Other: mower damage **Grave Orientation:** East Marker inscription faces what direction: 75 $^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 141






Cemetery: St. Elizabeths West	Grave #: 142	ZAI #: 350	Row #: 4	Photo No:
Name(s) on marker: Weber, Wil	liam			
Type of Marker/Monument:: G	overnment Issue:			
		/ar" - shield		
Inscription: 142/WM. WEBER/	CO. F/6TH U.S./	INF.		
Reverse:				
Material: marble	granite	other:		
Gravestone Size (inches): He	eight: 17	Width: 10	Thick	xness: 2
una rep	nttached 🔲 1		broken biologicals chips top, right and Other:	vandalized stained left sides
Grave Orientation: East	Marker inso	cription faces wha	at direction: 75 °	
Condition of Grave: satisfactory	,			
Surveyor: D. Hacker			Date: 1/23/07	
	Recom	mendations		
⊠ Reset/level in ground; align □ Drill/pin to maintain histori □ Consolidate w/ HCT & OH- □ Consider replacement with a □ Clean with D/2 & rinse □ Other:	to existing row c fabric 100 treatment	(1) unstal treatm fiscal (2) ongoing treatm (3) no tre	ng, requires nent next 2-3 years atment required, re ct in 5 years	2

Grave #: 142





Cemetery: St. Elizabeths West	Grave #: 143	ZAI #: 71	Row #: 4	Photo No:
Name(s) on marker: Clary, Jame	es			
Type of Marker/Monument:: G	overnment Issue:			
	⊠ "Civil W □ General □ Other:	Jar" – shield		
Inscription: 143/JAMES CLARY	//2D/MASS. H.A			
Reverse:				
Material: Marble	granite	other:		
Gravestone Size (inches): He	eight: 15	Width: 10	Thick	eness: 2
una rep	ittached 🔲 1	portions missing:	☐ broken ☑ biologicals chipped top, left sic Other: mower da	
Grave Orientation: East	Marker inso	cription faces wh	at direction: $80^{ m o}$	
Condition of Grave: satisfacctor	y			
Surveyor: D. Hacker			Date: 1/23/07	
	Recom	mendations		
 ☐ Reset/level in ground; align ☐ Drill/pin to maintain histori ☐ Consolidate w/ HCT & OH- ☐ Consider replacement with a clean with D/2 & rinse ☐ Other: 	c fabric 100 treatment	treatn er fiscal (2) ongoi treatn (3) no tre	ng, requires nent next 2-3 years atment required, re ct in 5 years	3

Grave #: 143






ZAI #: 294 **Row #: 2** Photo No: **Cemetery:** St. Elizabeths West **Grave #:** 148 Name(s) on marker: Schneer, Ernest Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: **Inscription:** 148/ERNEST SCH[NEE]R/CO. A/5TH/R.I. INF. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 14 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken √vandalized unattached loose biologicals stained repaired portions missing: tilted: degrees: 35 E-W 10 N-S Other: **Grave Orientation:** East Marker inscription faces what direction: 60° **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 148






ZAI #: 341 Row #: 4 Photo No: **Cemetery:** St. Elizabeths West **Grave #:** 152 Name(s) on marker: Travers, Darius Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: **Inscription:** 152/DARIUS TRAVERS/CO. D/7TH N.Y.H./ART. Reverse: Material: marble granite other: **Gravestone Size (inches):** Height: 18 Width: 10 Thickness: 2 Condition of Marker: weathered 7 cracked broken vandalized unattached loose biologicals repaired portions missing: chipped right and left sides ★ tilted: degrees: 5 E-W Other: mower damage N-S **Grave Orientation:** East Marker inscription faces what direction: 75 $^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 152






Cemetery: St. Elizabeths West	Grave #: 154	ZAI #: 91	Row #: 4	Photo No:
Name(s) on marker: Cranfield,	, J.E.			
Type of Marker/Monument:: C	Government Issue:			
	⊠ "Civil W □ General □ Other:	Jar" – shield		
Inscription: 154/J.E. CRANFIE	LD/CO. F/83D N.	Y./INF.		
Reverse:				
Material: 🔀 marble	granite	other:		
Gravestone Size (inches): H	eight: 18	Width: 10	Thick	ness: 2
ur rej	attached 🔲 1	portions missing:	☐ broken ☑ biologicals chips lower right Other: spalling a	☐ vandalized ☑ stained
Grave Orientation: East	Marker inso	cription faces wh	at direction: $80^{\rm o}$	
Condition of Grave: satisfactor	у			
Surveyor: D. Hacker			Date: 1/23/07	
_		mendations		
 ☐ Reset/level in ground; align ☐ Drill/pin to maintain histon ☐ Consolidate w/ HCT & OH ☐ Consider replacement with ☐ Clean with D/2 & rinse ☐ Other: 	ic fabric -100 treatment	treatr fiscal (2) ongo treatr (3) no tre	ing, requires nent next 2-3 years eatment required, re ect in 5 years	3

Grave #: 154





ZAI #: 164 Row #: 4 Photo No: **Cemetery:** St. Elizabeths West **Grave #:** 156 Name(s) on marker: Hess, Henry Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 156/HENRY HESS/CO. H/10TH N.Y./INF. Reverse: Material: | marble granite other: Gravestone Size (inches): Height: 20 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken 7 vandalized unattached loose biologicals stained portions missing: repaired tilted: degrees: 10 E-W 5 N-S Other: mower damage **Grave Orientation:** East Marker inscription faces what direction: 75 $^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 156






Cemetery: St. Elizabeths West	Grave #: 157	ZAI #: 266	Row #: 4	Photo No:
Name(s) on marker: O'connor, I	Daniel			
Type of Marker/Monument:: G	overnment Issue:			
,		/ar" - shield		
Inscription: 157/DAN'L O'CON	INOR/CO. D/126	TH/ILL. INF.		
Reverse:				
Material:	granite	other:		
Gravestone Size (inches): Ho	eight: 19	Width: 10	Thick	ness: 2
una rep	attached 🔲 1	cracked [loose [portions missing: W 5 N-S	broken biologicals Other: mower d	□ vandalized □ stained amage
Grave Orientation: East	Marker inso	cription faces wha	at direction: $80^{ m o}$	
Condition of Grave: satisfactory	7			
Surveyor: D. Hacker			Date: 1/23/07	
	Recom	mendations		
☐ Reset/level in ground; align ☐ Drill/pin to maintain histori ☐ Consolidate w/ HCT & OH- ☐ Consider replacement with ☐ Clean with D/2 & rinse ☐ Other:	c fabric 100 treatment	treatmer fiscal (2) ongoing treatmer (3) no tre	ng, requires nent next 2-3 years atment required, re ct in 5 years	3

Grave #: 157






ZAI #: 228 Row #: 4 Photo No: **Cemetery:** St. Elizabeths West **Grave #:** 158 Name(s) on marker: Martin, Charles Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 158/CHAS. MARTIN/CO. []/18TH N.Y./CAV. Reverse: Material: | marble granite other: Gravestone Size (inches): Height: 20 Width: 10 Thickness: 2 Condition of Marker: weathered 7 cracked broken 7 vandalized unattached loose biologicals stained repaired portions missing: chips left side ★ tilted: degrees: 5 E-W N-S Other: mower damage **Grave Orientation:** East Marker inscription faces what direction: 75 $^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years (4) irreparable

Grave #: 158





ZAI #: 108 Row #: 4 Photo No: **Cemetery:** St. Elizabeths West **Grave #:** 159 Name(s) on marker: Dorr, George Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 159/GEO. DORR/CO. A/18TH U.S.C./INF. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 18 Width: 10 Thickness: 2 Condition of Marker: weathered 7 cracked broken √vandalized unattached loose biologicals stained repaired portions missing: ★ tilted: degrees: 5 E-W Other: mower damage N-S **Grave Orientation:** East Marker inscription faces what direction: 75 $^{\rm o}$ Condition of Grave: **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years (4) irreparable

Grave #: 159





Cemetery: St. Elizabeths West	Grave #: 159a	ZAI #: 72	Row #: 4	Photo No:
Name(s) on marker: Clark, Jona	athon			
Type of Marker/Monument:: G	overnment Issue:			
	⊠ "Civil W □ General □ Other:	ar" – shield		
Inscription: 159/JNO. CLARK/	'CO. F/83D N.Y./I	NF.		
Reverse:				
Material: 🔀 marble	granite	other:		
Gravestone Size (inches): H	eight: 18	Width: 10	Thick	ness: 2
☐ un ☐ rep	attached 🔲 l		☐ broken ☑ biologicals chips top right and Other:	☐ vandalized ☑ stained left side
Grave Orientation: East	Marker insc	ription faces wh	at direction: $70^{\rm o}$	
Condition of Grave: satisfactor	y			
Surveyor: D. Hacker			Date: 1/23/07	
_		nendations		
 ☐ Reset/level in ground; align ☐ Drill/pin to maintain histor ☐ Consolidate w/ HCT & OH ☐ Consider replacement with ☐ Clean with D/2 & rinse ☐ Other: 	ic fabric 100 treatment	treatr r fiscal (2) ongoi treatr (3) no tre	ing, requires nent next 2-3 years eatment required, re ct in 5 years	3

Grave #: 159A






Cemetery: St. Elizabeths West	Grave #: 160	ZAI #: 129	Row #: 4	Photo No:
Name(s) on marker: Foley, Bart	ley			
Type of Marker/Monument:: G	overnment Issue:			
	☐ "Civil W ☐ General ☐ Other:	Jar" – shield		
Inscription: 160/BARTLEY FOI	LEY/UNASS'D/M	IASS. INF.		
Reverse:				
Material: Marble	granite	other:		
Gravestone Size (inches): H	eight: 20	Width: 10	Thick	eness: 2
☐ un ☐ rep	attached 🔲 1	cracked [loose [portions missing:	broken biologicals Other:	vandalized stained
Grave Orientation: East	Marker inso	cription faces wha	at direction: 80 °	
Condition of Grave: satisfactor	y			
Surveyor: D. Hacker			Date: 1/23/07	
	Recom	mendations		
☐ Reset/level in ground; align ☐ Drill/pin to maintain histor ☐ Consolidate w/ HCT & OH- ☐ Consider replacement with ☐ Clean with D/2 & rinse ☐ Other:	ic fabric 100 treatment	treatmer fiscal (2) ongoing treatmer (3) no treatmer	ng, requires nent next 2-3 years atment required, re et in 5 years	3

Grave #: 160






ZAI #: 89 Row #: 4 Photo No: **Cemetery:** St. Elizabeths West Grave #: 161 Name(s) on marker: Covington, Evans Type of Marker/Monument:: Government Issue: "Civil War" - shield General Other: Inscription: 161/EVANS COVINGTON/CO. E/54TH MASS./INF. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 17 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken vandalized unattached loose biologicals stained repaired portions missing: chips left side tilted: degrees: 5 E-W 5 N-S **Grave Orientation:** East Marker inscription faces what direction: 75 $^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years (4) irreparable

Grave #: 161





Cemetery: St. Elizabeths West	Grave #: 162	ZAI #: 74	Row #: 4	Photo No:
Name(s) on marker: Clark, Nath	an			
Type of Marker/Monument:: G	overnment Issue:			
,		/ar" – shield		
Inscription: 162/NATHAN CLA	ARK/CO. F/45TH	U.S.C./INF.		
Reverse:				
Material: Marble	granite	other:		
Gravestone Size (inches): He	ight: 19	Width: 10	Thick	ness: 2
una rep	ıttached 🔲 1	cracked loose portions missing: 7 5 N-S	broken biologicals chips left side Other:	vandalized stained
Grave Orientation: East	Marker inso	cription faces wh	at direction: 85 °	
Condition of Grave: satisfactory				
Surveyor: D. Hacker			Date: 1/23/07	
	Recom	mendations		
 ☐ Reset/level in ground; align ☐ Drill/pin to maintain histori ☐ Consolidate w/ HCT & OH- ☐ Consider replacement with a clean with D/2 & rinse ☐ Other: 	c fabric 100 treatment	treatn er fiscal (2) ongoi treatn (3) no tre	ng, requires nent next 2-3 years atment required, re ct in 5 years	3

Grave #: 162






Cemetery: St. Elizabeths West	Grave #: 163	ZAI #: 211	Row #: 4	Photo No:
Name(s) on marker: Lee, Walter				
Type of Marker/Monument:: G	overnment Issue:			
	☐ "Civil W ☐ General ☐ Other:	ar" – shield		
Inscription: 163/WALTER LEE	/ CO. B/9TH MA!	SS./INF.		
Reverse:				
Material: Marble	granite	other:		
Gravestone Size (inches): Ho	eight: 18	Width: 10	Thick	aness: 2
una rep	attached 🔲 1	cracked [loose [portions missing: W 5 N-S	broken biologicals Other: mower d	□ vandalized □ stained amage
Grave Orientation: East	Marker inso	cription faces wha	nt direction: 85 °	
Condition of Grave: satisfactory	7			
Surveyor: D. Hacker			Date: 1/23/07	
_	Recom	mendations		
☐ Reset/level in ground; align ☐ Drill/pin to maintain histori ☐ Consolidate w/ HCT & OH- ☐ Consider replacement with ☐ Clean with D/2 & rinse ☐ Other:	c fabric 100 treatment	treatm er fiscal (2) ongoin treatm (3) no trea	ng, requires nent next 2-3 years atment required, re et in 5 years	3

Grave #: 163






ZAI #: 235 Row #: 4 Photo No: **Cemetery:** St. Elizabeths West Grave #: 164 Name(s) on marker: Mccutcheon, Duncan Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 164/DUNCAN McCUTCHEON/CO. C/155TH PA./INF. Reverse: Material: marble granite other: Height: 19 **Gravestone Size (inches):** Width: 10 Thickness: 2 Condition of Marker: weathered 7 cracked broken vandalized unattached loose biologicals repaired portions missing: chips top, right and left sides tilted: degrees: 5 E-W 5 N-S Other: mower damage; spalling **Grave Orientation:** East Marker inscription faces what direction: $85\,^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 164





ZAI #: 285 **Row #:** 4 Photo No: **Cemetery:** St. Elizabeths West **Grave #:** 165 Name(s) on marker: Rothstad, H.T. Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 165/H.T. ROTHSTAD/CO. I/--- PA. INF. [Note: line in inscription indicates that government did not have complete information] Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 17 Width: 10 Thickness: 2 Condition of Marker: weathered | cracked broken vandalized unattached loose biologicals stained repaired portions missing: chip left side \boxtimes tilted: degrees: 5 E-W 5 N-S Other: mower damage **Grave Orientation:** East Marker inscription faces what direction: 75 $^{\rm o}$ **Condition of Grave:** satisfactory Date: 1/23/07 Surveyor: D. Hacker Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 165





Cemetery: St. Elizabeths West	Grave #: 166	ZAI #: 315	Row #: 4	Photo No:
Name(s) on marker: Smith, H.D).			
Type of Marker/Monument:: G	overnment Issue:			
	⊠ "Civil W □ General □ Other:	Jar" – shield		
Inscription: 166/H.D. SMITH/	ITH WIS./BATTE	RY		
Reverse:				
Material: Marble	granite	other:		
Gravestone Size (inches): H	eight: 18	Width: 10	Thick	eness: 2
☐ un ☐ rep	attached 🔲 1		broken biologicals chips right and left Other: mower d	
Grave Orientation: East	Marker inso	cription faces wha	at direction: $80^{\rm o}$	
Condition of Grave: satisfactory	y			
Surveyor: D. Hacker			Date: 1/23/07	
	Recom	mendations		
☐ Reset/level in ground; align ☐ Drill/pin to maintain histor ☐ Consolidate w/ HCT & OH- ☐ Consider replacement with ☐ Clean with D/2 & rinse ☐ Other:	ic fabric 100 treatment	treatmer fiscal (2) ongoing treatmer (3) no treatmer	ng, requires nent next 2-3 years atment required, re et in 5 years	3

Grave #: 166






Cemetery: St. Elizabeths West	Grave #: 167	ZAI #: 34	Row #: 4	Photo No:
Name(s) on marker: Blum, D.L.				
Type of Marker/Monument:: G	overnment Issue:			
	⊠ "Civil W □ General □ Other:	/ar" – shield		
Inscription: 167/D.L. BLUM/U	S./ARMY			
Reverse:				
Material: Marble	granite	other:		
Gravestone Size (inches): H	eight: 17	Width: 10	Thick	cness: 2
un rep	attached 🔲 1	cracked [loose [portions missing: / N-S	□ broken ☑ biologicals chips left side Other: mower c	□ vandalized ☑ stained lamage
Grave Orientation: East	Marker inso	cription faces wha	at direction: 75 °	
Condition of Grave:				
Surveyor: D. Hacker			Date: 1/23/07	
		mendations		
 ☐ Reset/level in ground; align ☐ Drill/pin to maintain histor ☐ Consolidate w/ HCT & OH- ☐ Consider replacement with ☐ Clean with D/2 & rinse ☐ Other: 	ic fabric 100 treatment	treatmer fiscal (2) ongoing treatmer (3) no tre	ng, requires nent next 2-3 years atment required, re ct in 5 years	3

Grave #: 167





ZAI #: 142 Row #: 4 Photo No: **Cemetery:** St. Elizabeths West **Grave #: 169** Name(s) on marker: Goulden, Edward Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 169/EDWARD GOULDEN/CO. A/16TH/MASS. INF. Reverse: Material: marble granite other: **Gravestone Size (inches):** Height: 17 Width: 10 Thickness: 2 Condition of Marker: weathered 7 cracked broken \rightarrow vandalized unattached loose biologicals stained repaired portions missing: chips right and left sides ★ tilted: degrees: 5 E-W Other: abrasion in shield N-S **Grave Orientation:** East Marker inscription faces what direction: $85\,^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 169






Cemetery: St. Elizabeths West	Grave #: 171	ZAI #: 62	Row #: 4	Photo No:
Name(s) on marker: Camp, Cha	arles			
Type of Marker/Monument:: G	overnment Issue:			
	⊠ "Civil W □ General □ Other:	Jar" - shield		
Inscription: 171/CHAS. CAMP	/1ST/U.S.S.S.			
Reverse:				
Material: Marble	granite	other:		
Gravestone Size (inches): H	eight: 13	Width: 10	Thic	kness: 2
☐ un ☐ rep	attached 🔲		broken biologicals chips right and left Other: mower o	vandalized stained sides damage, sunken
Grave Orientation: East	Marker inse	cription faces wha	nt direction: 75 °	
Condition of Grave: satisfactory	У			
Surveyor: D. Hacker			Date: 1/23/07	
_	Recom	mendations		
☐ Reset/level in ground; align ☐ Drill/pin to maintain histor ☐ Consolidate w/ HCT & OH- ☐ Consider replacement with ☐ Clean with D/2 & rinse ☐ Other:	ic fabric 100 treatment	treatmer fiscal (2) ongoin treatm (3) no trea	ng, requires nent next 2-3 years atment required, r et in 5 years	2

Grave #: 171






ZAI #: 83 **Row #: 2** Photo No: **Cemetery:** St. Elizabeths West Grave #: 174 Name(s) on marker: Conroy, Patrick Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 174/PATRICK CONROY/CO. A/16TH/U.S. INF. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 19 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken \rightarrow vandalized unattached loose biologicals stained repaired portions missing: chip upper left corner tilted: degrees: 60 E-W 10 N-S Other: false shield carving below **Grave Orientation:** East Marker inscription faces what direction: 60° **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years (4) irreparable

Grave #: 174






Cemetery: St. Elizabeths West	Grave #: 177	ZAI #: 7	Row #: 6	Photo No:
Name(s) on marker: Alonzo, Pe	ter			
Type of Marker/Monument:: G	overnment Issue:			
	⊠ "Civil W □ General □ Other:	Jar" – shield		
Inscription: []/PETER ALON	ZO/CO. []/47TH	I/N.Y. INF.		
Reverse:				
Material: Marble	granite	other:		
Gravestone Size (inches): H	eight: 23	Width: 10	Thic	kness: 2
☐ un ☐ rep	attached 🔲		□ broken□ biologicalschips right and leftOther: mower d	
Grave Orientation: East	Marker inso	cription faces wh	at direction: 95 °	
Condition of Grave: satisfactory	У			
Surveyor: D. Hacker			Date: 1/23/07	
_		mendations		
☐ Reset/level in ground; align ☐ Drill/pin to maintain histor: ☐ Consolidate w/ HCT & OH- ☐ Consider replacement with ☐ Clean with D/2 & rinse ☐ Other:	100 treatment	treatr fiscal (2) ongo treatr (3) no tre	ing, requires ment next 2-3 years eatment required, r ect in 5 years	2

Grave #: 177





Cemetery: St. Elizabeths West	Grave #: 177a	ZAI #: 66	Row #: 6	Photo No:
Name(s) on marker: Carty, Dav	id			
Type of Marker/Monument:: G	overnment Issue:			
- y r	⊠ "Civil W ☐ General ☐ Other:	ar" – shield		
Inscription: 177A/DAVID CAR	TY/CO. D/10TH	U.S./[INF.]		
Reverse:				
Material: Marble	granite	other:		
Gravestone Size (inches): He	eight: 12	Width: 10	Thick	ness: 2
☐ un. ☐ rep	attached 🔲 le paired 🔀 p	rracked oose oortions missing: E-W N-S	⊠ broken ⊠ biologicals base Other: flat on gro	vandalized stained
Grave Orientation:	Marker insc	ription faces wh	at direction:	
Condition of Grave: Found in vunknown	vooded area outsid	le fence; now pla	ced next to #177; gra	ave location
Surveyor: D. Hacker			Date: 1/23/07	
	Recomi	mendations		
 ☐ Reset/level in ground; align ☐ Drill/pin to maintain histor ☐ Consolidate w/ HCT & OH- ☐ Consider replacement with ☐ Clean with D/2 & rinse ☐ Other: 	c fabric 100 treatment	treatr r fiscal (2) ongo treatr (3) no tre	ing, requires nent next 2-3 years eatment required, re ect in 5 years	1

Grave #: 177A






ZAI #: 16 **Row #:** 3 Photo No: **Cemetery:** St. Elizabeths West Grave #: 180 Name(s) on marker: Bachofen, Johannes Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 180/JOHANNES BACHOFEN/CO. A/18TH/U.S. INF. Reverse: other: Material: | marble granite **Gravestone Size (inches):** Height: 11 Width: 10 Thickness: 2 Condition of Marker: weathered cracked broken vandalized loose unattached biologicals stained repaired portions missing: chips right and left sides tilted: degrees: 5 E-W 5 N-S Other: sunken **Grave Orientation:** East Marker inscription faces what direction: 250 $^{\rm o}$ Condition of Grave: satisfactory Date: 1/23/07 **Surveyor:** D. Hacker Recommendations \boxtimes Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 180






ZAI #: 395 **Row #:** 7 Photo No: **Cemetery:** St. Elizabeths West Grave #: 184 Name(s) on marker: Bushman, Henry Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: [184]/HENRY BUSHMAN/CO. E/42D/U.S. INF. Reverse: Material: | marble granite other: Gravestone Size (inches): Height: 20 Width: 10 Thickness: 2 Condition of Marker: weathered 7 cracked broken √vandalized unattached loose biologicals stained repaired portions missing: chips right and left sides tilted: degrees: 20 E-W Other: mower damage N-S **Grave Orientation:** East Marker inscription faces what direction: $85\,^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 184





Cemetery: St. Elizabeths West	Grave #: 189	ZAI #: 327	Row #: 7	Photo No:
Name(s) on marker: Sullivan, J.				
Type of Marker/Monument:: G	overnment Issue:			
	⊠ "Civil W □ General □ Other:	Jar" – shield		
Inscription: [189]/J. [SULLIV]A	N/CO. C/54TH/	V.R.C.		
Reverse:				
Material: Marble	granite	other:		
Gravestone Size (inches): He	eight: 15	Width: 10	Thick	kness: 2
una rep	nttached 🔲		broken biologicals extensive edge dan Other: spalling;	O
Grave Orientation: East	Marker inso	cription faces wha	at direction: 70 °	
Condition of Grave: satisfactory	,			
Surveyor: D. Hacker			Date: 1/23/07	
_		mendations		
 ☑ Reset/level in ground; align ☐ Drill/pin to maintain histori ☑ Consolidate w/ HCT & OH- ☐ Consider replacement with ☑ Clean with D/2 & rinse ☐ Other: 	c fabric 100 treatment	treatmer fiscal (2) ongoine treatm (3) no treatmer	ng, requires nent next 2-3 years atment required, re tt in 5 years	1

Grave #: 189





Cemetery: St. Elizabeths West	Grave #: 190	ZAI #: 2 93	Row #: 7	Photo No:
Name(s) on marker: Schafe, Fred	derick			
Type of Marker/Monument:: G	⊠ "Civil W □ General	/ar" - shield		
Inscription: []/FREDER[ICK]	☐ Other: [SCH]AFE/CO. H	I/18TH/U.S. INF.		
Reverse: Material: ⊠ marble	granite	other:		
Gravestone Size (inches): He	eight: 20	Width: 10	Thick	eness: 2
una rep	nttached 🔲	portions missing:	broken biologicals Other: sugaring	☐ vandalized ☐ stained
Grave Orientation: East	Marker inso	cription faces wha	t direction: 70 °	
Condition of Grave: satisfactory	7			
Surveyor: D. Hacker		1	Date: 1/23/07	
 ☑ Reset/level in ground; align ☐ Drill/pin to maintain histori ☐ Consolidate w/ HCT & OH- ☑ Consider replacement with ☑ Clean with D/2 & rinse ☐ Other: 	to existing row c fabric 100 treatment	treatm fiscal y (2) ongoin treatm (3) no trea	ng, requires ent next 2-3 years atment required, re t in 5 years	1

Grave #: 190






Cemetery: St. Elizabeths West	Grave #: 199	ZAI #: 251	Row #: 5	Photo No:
Name(s) on marker: Miles, Patri	ck			
Type of Marker/Monument:: G		Var" – shield		
	☐ General ☐ Other:			
Inscription: 199/PAT'K MILES	15[]TH/[]V[]			
Reverse:				
Material: \boxtimes marble	granite	other:		
Gravestone Size (inches): He	e ight: 19	Width: 10	Thick	ness: 2
una rep	ittached 🔲	cracked loose portions missing W 15 N-S	broken biologicals Other: chipped	uandalized stained
Grave Orientation: East	Marker ins	cription faces wh	nat direction: 90 °	
Condition of Grave: satisfactory				
Surveyor: D. Hacker			Date: 1/23/07	
	Recom	mendations		
 ☐ Reset/level in ground; align ☐ Drill/pin to maintain histori ☐ Consolidate w/ HCT & OH- ☐ Consider replacement with ☐ Clean with D/2 & rinse ☐ Other: 	c fabric 100 treatment	treatier fiscal (2) ongo treati (3) no tr	Priority: able, requires ment current or next l year ing, requires ment next 2-3 years eatment required, re ect in 5 years arable	1

Grave #: 199






ZAI #: 99 **Row #:** 5 Photo No: **Cemetery:** St. Elizabeths West Grave #: 200 Name(s) on marker: Desan, Peter Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 200/PETER DESAN/CO. H/87TH/N.Y. INF. Reverse: Material: | marble granite other: Gravestone Size (inches): Height: 19 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken vandalized unattached loose biologicals stained repaired portions missing: chips left side tilted: degrees: 25 E-W 10 N-S **Grave Orientation:** East Marker inscription faces what direction: 75 $^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 200






ZAI #: 183 **Row #:** 5 Photo No: **Cemetery:** St. Elizabeths West Grave #: 201 Name(s) on marker: Joseph, Moses Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: [201]/[MOSES] [JOSE]PH/ ----- /5TH/MICH. INF. [Note: line in inscription indicates that government did not have complete information] Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 14 Width: 10 Thickness: 2 Condition of Marker: weathered | cracked > broken vandalized unattached loose biologicals stained portions missing: top third of stone repaired 🔀 tilted: degrees: 20 E-W Other: **Grave Orientation:** East Marker inscription faces what direction: 70 $^{\rm o}$ **Condition of Grave:** saatisfactory **Date:** 1/23/07 Surveyor: D. Hacker Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next ☐ Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 201





Cemetery: St. Elizabeths West	Grave #: 202	ZAI #: 13	Row #: 5	Photo No:
Name(s) on marker: Arnel, Jac	cob			
Type of Marker/Monument::	Government Issue:			
	⊠ "Civil W □ General □ Other:	Jar" – shield		
Inscription: 202/JACOB ARN	EL/CO. C/1ST U.S	/INF.		
Reverse:				
Material: Marble	granite	other:		
Gravestone Size (inches):	Height: 19	Width: 10	Thick	ness: 2
u re	nattached 🔲	portions missing:	☐ broken ☑ biologicals chip right side Other: mower d	vandalized stained
Grave Orientation: East	Marker inse	cription faces wh	at direction: 80 °	
Condition of Grave: satisfacto	ry			
Surveyor: D. Hacker			Date: 1/23/07	
_		mendations		
 ☐ Reset/level in ground; alig ☐ Drill/pin to maintain histo ☐ Consolidate w/ HCT & OF ☐ Consider replacement with ☐ Clean with D/2 & rinse ☐ Other: 	I-100 treatment	treatmer fiscal (2) ongoing treatmer (3) no treatmer	ing, requires nent next 2-3 years atment required, re ct in 5 years	2






Cemetery: St. Elizabeths West	Grave #: 2 03	ZAI #: 264	Row #: 5	Photo No:
Name(s) on marker: Nos, L.E.				
Type of Marker/Monument:: G	overnment Issue:			
	⊠ "Civil W □ General □ Other:	Jar" – shield		
Inscription: 203/L.E. NOS/CO.	B/7TH N.Y./INF			
Reverse:				
Material: Marble	granite	other:		
Gravestone Size (inches): H	eight: 21	Width: 10	Thick	eness: 2
☐ un ☐ rep	attached 🔲 1	cracked [loose [portions missing: W 10 N-S	broken biologicals chips left side Other:	vandalized stained
Grave Orientation: East	Marker insc	cription faces wha	at direction: 75 °	
Condition of Grave: satisfactory	y			
Surveyor: D. Hacker			Date: 1/23/07	
_		mendations		
☐ Reset/level in ground; align ☐ Drill/pin to maintain histor ☐ Consolidate w/ HCT & OH- ☐ Consider replacement with ☐ Clean with D/2 & rinse ☐ Other:	ic fabric 100 treatment	treatmer fiscal (2) ongoing treatmer (3) no tre	ng, requires nent next 2-3 years atment required, re ct in 5 years	2

Grave #: 203






ZAI #: 337 **Row #:** 5 Photo No: **Cemetery:** St. Elizabeths West Grave #: 205 Name(s) on marker: Tobin, William Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: **Inscription:** 205/WM. TOBIN/CO. F/[]TH U.S./ART. Reverse: Material: | marble granite other: Gravestone Size (inches): Height: 19 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken vandalized unattached loose biologicals repaired portions missing: chips right and left sides tilted: degrees: 20 E-W 10 N-S Other: **Grave Orientation:** East Marker inscription faces what direction: $80\,^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 205






ZAI #: 196 **Row #:** 5 Photo No: **Cemetery:** St. Elizabeths West Grave #: 209 Name(s) on marker: Kling, Peter Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 209/PETER KLING/CO. K/15TH N.Y./CAV. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 15 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken √vandalized unattached loose biologicals stained repaired portions missing: chips right and left sides tilted: degrees: 10 E-W N-S Other: **Grave Orientation:** East Marker inscription faces what direction: 75 $^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 209






ZAI #: 306 **Row #:** 5 Photo No: **Cemetery:** St. Elizabeths West **Grave #: 210** Name(s) on marker: Skinner, Jonathon Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 210/JNO. SKINNER/CO. K/31ST N.Y./INF. Reverse: Material: | marble granite other: Gravestone Size (inches): Height: 13 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken √vandalized unattached loose biologicals stained repaired portions missing: chips right and left sides tilted: degrees: 5 E-W 5 N-S Other: sunken **Grave Orientation:** East Marker inscription faces what direction: $85\,^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 210






ZAI #: 331 **Row #:** 5 Photo No: **Cemetery:** St. Elizabeths West Grave #: 211 Name(s) on marker: Telford, James Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 211/JAMES TELFORD/CO. F/96TH ILL./INF. Reverse: | marble granite other: Material: Gravestone Size (inches): Height: 16 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken vandalized unattached loose biologicals stained portions missing: chips right and left sides repaired tilted: degrees: 10 E-W N-S Other: mower damage across shield **Grave Orientation:** East Marker inscription faces what direction: $80\,^{\rm o}$ **Condition of Grave:** satisfactory Date: 1/23/07 Surveyor: D. Hacker Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years (4) irreparable

Grave #: 211






ZAI #: 234 **Row #:** 6 Photo No: **Cemetery:** St. Elizabeths West Grave #: 212 Name(s) on marker: Mccubbins, Joshua Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 212/JOSHUA McCUBBINS/CO. F/5TH MD. INF. [Note: stonecutter's error: should be "242"] Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 20 Width: 10 Thickness: 2 Condition of Marker: weathered | cracked broken vandalized unattached loose biologicals stained portions missing: chips right and left sides repaired tilted: degrees: 10 E-W 5 N-S Other: **Grave Orientation:** East Marker inscription faces what direction: $80\,^{\rm o}$ **Condition of Grave:** satisfactory Surveyor: D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 212






ZAI #: 263 **Row #:** 5 Photo No: **Cemetery:** St. Elizabeths West **Grave #: 215** Name(s) on marker: Nagel, Julius Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: **Inscription:** 215/JULIUS NAGEL/CO. H/15TH N.Y.H./ART. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 19 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken vandalized unattached loose biologicals stained repaired portions missing: chips right and left sides tilted: degrees: 10 E-W N-S Other: **Grave Orientation:** East Marker inscription faces what direction: 80° **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 215






ZAI #: 121 **Row #:** 5 Photo No: **Cemetery:** St. Elizabeths West **Grave #: 216** Name(s) on marker: Everett, Alex Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: **Inscription:** 216/ALEX EVERETT/CO. H/195TH P.A./INF. Reverse: marble granite other: Material: **Gravestone Size (inches):** Height: 20 Width: 10 Thickness: 2 **Condition of Marker:** weathered 7 cracked broken vandalized unattached loose biologicals stained portions missing: chips left side repaired tilted: degrees: 10 E-W N-S Other: abrasion, pos mower damage **Grave Orientation:** East Marker inscription faces what direction: $85\,^{\rm o}$ Condition of Grave: satisfactory Date: 1/23/07 Surveyor: D. Hacker Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear


Grave #: 216





Cemetery: St. Elizabeths West	Grave #: 217	ZAI #: 316	Row #: 5	Photo No:
Name(s) on marker: Smith, J.D				
Type of Marker/Monument:: C	Government Issue:			
	⊠ "Civil W □ General □ Other:	Jar" – shield		
Inscription: 217/J.D. SMITH/C	CO. D/8TH N.Y./C	CAV.		
Reverse:				
Material: 🔀 marble	granite	other:		
Gravestone Size (inches): H	leight: 20	Width: 10	Thick	ness: 2
ur rej	nattached 🔲 1	portions missing:	☐ broken ☑ biologicals chip left side Other:	☐ vandalized ☑ stained
Grave Orientation: East	Marker inso	cription faces wh	at direction: $80^{\rm o}$	
Condition of Grave: satisfactor	у			
Surveyor: D. Hacker			Date: 1/23/07	
		mendations		
 ☐ Reset/level in ground; align ☐ Drill/pin to maintain histon ☐ Consolidate w/ HCT & OH ☐ Consider replacement with ☐ Clean with D/2 & rinse ☐ Other: 	ric fabric -100 treatment	treatn er fiscal (2) ongoi treatn (3) no tre	ng, requires nent next 2-3 years atment required, re ct in 5 years	3






ZAI #: 47 **Row #:** 5 Photo No: **Cemetery:** St. Elizabeths West **Grave #: 218** Name(s) on marker: Brown, W.S. Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 218/W.S. BROWN/CO. D/21ST/IOWA INF. Reverse: Material: | marble granite other: Gravestone Size (inches): Height: 17 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken 7 vandalized unattached loose biologicals stained repaired portions missing: chips right side tilted: degrees: 5 E-W 5 N-S Other: mower damage **Grave Orientation:** East Marker inscription faces what direction: $80\,^{\rm o}$ Condition of Grave: satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 218





ZAI #: 61 **Row #:** 5 Photo No: **Cemetery:** St. Elizabeths West Grave #: 220 Name(s) on marker: Callum, Martin Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: **Inscription:** 220/MARTIN CALLUM/CO []/90TH OHIO/INF. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 17 Width: 10 Thickness: 2 Condition of Marker: weathered 7 cracked broken 7 vandalized unattached loose biologicals stained repaired portions missing: chips left side ★ tilted: degrees: 5 E-W N-S Other: mower damage **Grave Orientation:** East Marker inscription faces what direction: 75 $^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 220






Cemetery: St. Elizabeths West	Grave #: 222	ZAI #: 370	Row #: 5	Photo No:
Name(s) on marker: U.S. Soldier				
Type of Marker/Monument:: Go	overnment Issue:			
,		/ar" - shield		
Inscription: 222/U.S./SOLDIER				
Reverse:				
Material: Marble	granite	other:		
Gravestone Size (inches): He	ight: 20	Width: 10	Thick	kness: 2
una rep	ttached 🔲	cracked loose portions missing W 5 N-S	☐ broken ☐ biologicals : Other: mower d	□ vandalized □ stained
Grave Orientation: East	Marker inso	cription faces wh	nat direction: 70 °	
Condition of Grave:				
Surveyor: D. Hacker			Date: 1/23/07	
	Recom	mendations		
☐ Reset/level in ground; align ☐ Drill/pin to maintain histori ☐ Consolidate w/ HCT & OH- ☐ Consider replacement with ' ☐ Clean with D/2 & rinse ☐ Other:	c fabric 100 treatment	treatr er fiscal (2) ongo treatr (3) no tre	Priority: able, requires ment current or next l year sing, requires ment next 2-3 years eatment required, re ect in 5 years arable	2

Grave #: 222






ZAI #: 283 Row #: 6 Photo No: **Cemetery:** St. Elizabeths West Grave #: 223A Name(s) on marker: Robinson, Henry Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 223/HENRY ROBINSON/----[Note: Line in inscription indicates that government did not have complete information] **Reverse:** Material: | marble granite other: **Gravestone Size (inches):** Height: 21 Width: 10 Thickness: 2 Condition of Marker: weathered | cracked broken vandalized unattached loose biologicals stained portions missing: chips right and left sides repaired \bowtie tilted: degrees: 10 E-W 10 N-S Other: **Grave Orientation:** East Marker inscription faces what direction: $85\,^{\rm o}$ **Condition of Grave:** satisfactory **Date:** 1/23/07 Surveyor: D. Hacker Recommendations ⊠ Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 223A






Cemetery: St. Elizabeths West	Grave #: 223	ZAI #: 173	Row #: 5	Photo No:
Name(s) on marker: Howard, T.	L.			
Type of Marker/Monument:: G	overnment Issue:			
		/ar" - shield		
Inscription: 223/T.L. HOWARD)/CO. L/1ST IND	o./ART.		
Reverse:				
Material: Marble	granite	other:		
Gravestone Size (inches): He	eight: 18	Width: 10	Thick	ness: 2
una rep	nttached 🔲	cracked [loose [portions missing: W N-S	broken biologicals chips left side Other: mower da	vandalized stained
Grave Orientation: East	Marker inso	cription faces wh	at direction: 80 °	
Condition of Grave: satisfactory	,			
Surveyor: D. Hacker			Date: 1/23/07	
	Recom	mendations		
 ☐ Reset/level in ground; align ☐ Drill/pin to maintain histori ☐ Consolidate w/ HCT & OH- ☐ Consider replacement with ☐ Clean with D/2 & rinse ☐ Other: 	c fabric 100 treatment	treatn er fiscal (2) ongoi treatn (3) no tre	ng, requires nent next 2-3 years atment required, re ct in 5 years	3

Grave #: 223






Cemetery: St. Elizabeths West	Grave #: 224	ZAI #: 194	Row #: 5	Photo No:
Name(s) on marker: King, Chai	eles			
Type of Marker/Monument:: C		/ar" – shield		
	General Other:	oneru		
Inscription: 224/CHAS. KING	CO. A/18TH IOW	VA/INF.		
Reverse:				
Material: Marble	granite	other:		
Gravestone Size (inches): H	eight: 20	Width: 10	Thick	ness: 2
☐ un ☐ rep	attached 🔲 1	cracked [loose [portions missing: W N-S	☐ broken ☑ biologicals chip left side Other: mower da	□ vandalized □ stained
Grave Orientation: East	Marker inso	cription faces wha	nt direction: 80 °	
Condition of Grave: satisfactor	y			
Surveyor: D. Hacker			Date: 1/23/07	
	Recom	mendations		
□ Reset/level in ground; align □ Drill/pin to maintain histor □ Consolidate w/ HCT & OH- □ Consider replacement with □ Clean with D/2 & rinse □ Other:	ic fabric -100 treatment	treatmer fiscal (2) ongoing treatmer (3) no treatmer	ng, requires lent next 2-3 years atment required, re et in 5 years	3

Grave #: 224





Cemetery: St. Elizabeths West	Grave #: 225	ZAI #: 45	Row #: 5	Photo No:
Name(s) on marker: Brown, Cha	arles			
Type of Marker/Monument:: G	overnment Issue:			
	⊠ "Civil W □ General □ Other:	Jar" – shield		
Inscription: 225/CHAS. BROW	N/CO. F/3D CAI	/INF.		
Reverse:				
Material: Marble	granite	other:		
Gravestone Size (inches): He	eight: 20	Width: 10	Thick	ness: 2
una rep	ıttached 🔲 1	cracked [loose [portions missing: W N-S	broken biologicals chips left side Other: mower da	□ vandalized □ stained nmage
Grave Orientation: East	Marker inso	cription faces wh	at direction: 85 °	
Condition of Grave: satisfactory				
Surveyor: D. Hacker			Date: 1/23/07	
	Recom	mendations		
 ☐ Reset/level in ground; align ☐ Drill/pin to maintain histori ☐ Consolidate w/ HCT & OH- ☐ Consider replacement with a clean with D/2 & rinse ☐ Other: 	c fabric 100 treatment	treatn er fiscal (2) ongoi treatn (3) no tre	ng, requires nent next 2-3 years atment required, re ct in 5 years	3






ZAI #: 312 **Row #:** 5 Photo No: **Cemetery:** St. Elizabeths West Grave #: 226 Name(s) on marker: Smith, George Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 226/GEO. SMITH/CO. I/2D OHIO/ART. Reverse: Material: | marble granite other: Gravestone Size (inches): Height: 17 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken vandalized unattached loose biologicals stained repaired portions missing: chips left side tilted: degrees: 10 E-W 10 N-S **Grave Orientation:** East Marker inscription faces what direction: 70 $^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 226






ZAI #: 237 **Row #:** 5 Photo No: **Cemetery:** St. Elizabeths West Grave #: 228 Name(s) on marker: Mcdonnely, Patrick Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 228/PAT'K McDONNELY/CO. K/61ST N.Y./INF. Reverse: Material: marble granite other: **Gravestone Size (inches):** Height: 21 Width: 10 Thickness: 2 Condition of Marker: weathered | cracked broken \rightarrow vandalized unattached loose biologicals stained repaired portions missing: chips right and left sides tilted: degrees: 10 E-W 15 N-S Other: mower damage **Grave Orientation:** East Marker inscription faces what direction: 70 $^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 228





ZAI #: 239 **Row #:** 5 Photo No: **Cemetery:** St. Elizabeths West Grave #: 228a Name(s) on marker: Mcgee, Jonathon Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 228/JNO. McGEE/CO. H/18TH N.Y./CAV. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 22 Width: 10 Thickness: 2 Condition of Marker: weathered | cracked > broken \rightarrow vandalized unattached loose biologicals stained repaired portions missing: base tilted: degrees: E-W N-S Other: flat on ground **Grave Orientation:** Marker inscription faces what direction: **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 228A






ZAI #: 218 **Row #:** 5 Photo No: **Cemetery:** St. Elizabeths West Grave #: 230 Name(s) on marker: Ludwig, Jonathon Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 230/JNO. LUDWIG/CO. D/106TH/OHIO INF. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 24 Width: 10 Thickness: 2 Condition of Marker: weathered cracked > broken \rightarrow vandalized unattached loose biologicals stained repaired portions missing: chips left edge tilted: degrees: 10 E-W 5 N-S Other: mower damage **Grave Orientation:** East Marker inscription faces what direction: 70 $^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 230






Cemetery: St. Elizabeths West	Grave #: 2 31	ZAI #: 328	Row #: 3	Photo No:		
Name(s) on marker: Ray, Sylves	ster					
Type of Marker/Monument:: Go	overnment Issue:	:				
	⊠ "Civil W □ General □ Other:	Var" – shield				
Inscription: 231/SYLVESTER R	AY/CO. I/16TH	N.Y./H.A.				
Reverse:						
Material: Marble	granite	other:				
Gravestone Size (inches): He	ight: 21	Width: 10	Thick	eness: 2		
Condition of Marker: weathered cracked broken vandalized unattached loose biologicals stained portions missing: lower half of stone tilted: degrees: E-W N-S Other: flat on ground						
Grave Orientation: NA	Marker ins	cription faces wha	ot direction:			
Condition of Grave: satisfactory						
Surveyor: D. Hacker			Date: 1/23/07			
Recommendations						
 Reset/level in ground; align Drill/pin to maintain histori Consolidate w/ HCT & OH-7 Consider replacement with a Clean with D/2 & rinse Other: 	c fabric 100 treatment	treatmer fiscal (2) ongoin treatm (3) no trea	ng, requires tent next 2-3 years atment required, re tt in 5 years	1		

Grave #: 231






ZAI #: 250 Row #: 6 Photo No: **Cemetery:** St. Elizabeths West Grave #: 237 Name(s) on marker: Michau, Pierre Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 237 / PIERRE [___]HAU / 1ST /N.H.H.A. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 19 Width: 10 Thickness: 2 Condition of Marker: weathered 7 cracked broken vandalized unattached loose biologicals stained repaired portions missing: CHIPS tilted: degrees: 100 E-W 50 N-S **Grave Orientation:** East Marker inscription faces what direction: $80\,^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 237






Cemetery: St. Elizabeths West	Grave #: 238	ZAI #: 96	Row #: 6	Photo No:
Name(s) on marker: Davis, J.A.				
Type of Marker/Monument:: G	overnment Issue:			
	⊠ "Civil W □ General □ Other:	/ar" – shield		
Inscription: 238/J.A. DAVIS/CO	D. E/74TH N.Y./I	NF.		
Reverse:				
Material: Marble	granite	other:		
Gravestone Size (inches): He	ight: 19	Width: 10	Thick	aness: 2
una rep	ıttached 🔲 1	cracked [loose [portions missing: W 5 N-S	broken biologicals chips left edge Other: mower da	□ vandalized □ stained amage
Grave Orientation: East	Marker inso	cription faces wh	at direction: 75 °	
Condition of Grave: satisfactory				
Surveyor: D. Hacker			Date: 1/23/07	
	Recom	mendations		
 ☐ Reset/level in ground; align ☐ Drill/pin to maintain histori ☐ Consolidate w/ HCT & OH- ☐ Consider replacement with f ☐ Clean with D/2 & rinse ☐ Other: 	c fabric 100 treatment	treatn er fiscal (2) ongoi treatn (3) no tre	ng, requires nent next 2-3 years atment required, re ct in 5 years	3

Grave #: 238






ZAI #: 345 **Row #:** 6 Photo No: **Cemetery:** St. Elizabeths West **Grave #: 239** Name(s) on marker: Vaughn, Michael Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: [239]/MICH'L [VAUG]HN/CO. []/7TH N.Y./H.A. Reverse: Material: | marble granite other: Gravestone Size (inches): Height: 18 Width: 10 Thickness: 2 Condition of Marker: weathered 7 cracked broken 7 vandalized unattached loose biologicals stained repaired portions missing: chips right side ★ tilted: degrees: 5 E-W Other: mower damage N-S **Grave Orientation:** East Marker inscription faces what direction: $85\,^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 239






ZAI #: 178 **Row #:** 6 Photo No: **Cemetery:** St. Elizabeths West Grave #: 240 Name(s) on marker: Jackson, Thomas Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 240/THOS. JACKSON/CO. A/58TH U.C.S./INF. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 20 Width: 10 Thickness: 2 Condition of Marker: weathered 7 cracked broken 7 vandalized unattached loose biologicals stained repaired portions missing: ★ tilted: degrees: 5 E-W N-S Other: mower damage **Grave Orientation:** East Marker inscription faces what direction: 70 $^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years (4) irreparable

Grave #: 240





Cemetery: St. Elizabeths West	Grave #: 241	ZAI #: 284	Row #: 6	Photo No:
Name(s) on marker: Rose, Chris	stopher			
Type of Marker/Monument:: G	overnment Issue:			
	⊠ "Civil W □ General □ Other:	Jar" – shield		
Inscription: 241/CHRISTOPHE	R ROSE/36TH/IN	ND. INF.		
Reverse:				
Material: Marble	granite	other:		
Gravestone Size (inches): H	eight: 22	Width: 10	Thick	mess: 2
☐ un ☐ rep	attached 🔲 🛚	cracked [loose [portions missing: W 5 N-S	broken biologicals Other:	vandalized stained
Grave Orientation: East	Marker inso	cription faces wha	nt direction: 80 °	
Condition of Grave: satisfactory	y			
Surveyor: D. Hacker			Date: 1/23/07	
	Recom	mendations		
 ☐ Reset/level in ground; align ☐ Drill/pin to maintain histor ☐ Consolidate w/ HCT & OH- ☐ Consider replacement with ☐ Clean with D/2 & rinse ☐ Other: 	ic fabric 100 treatment	treatmer fiscal (2) ongoin treatm (3) no trea	ng, requires tent next 2-3 years atment required, re tt in 5 years	3

Grave #: 241





Cemetery: St. Elizabeths West	Grave #: 244	ZAI #: 200	Row #: 6	Photo No:
Name(s) on marker: Kuese, J.A.				
Type of Marker/Monument:: G	overnment Issue:			
	⊠ "Civil W □ General □ Other:	Jar" – shield		
Inscription: 244/J.A. KUESE/C	O. A/68TH N.Y.,	INF.		
Reverse:				
Material: Marble	granite	other:		
Gravestone Size (inches): H	eight: 19	Width: 10	Thick	kness: 2
☐ un ☐ rep	attached 🔲		broken biologicals chips right and left Other: mower da	
Grave Orientation: East	Marker inso	cription faces wha	nt direction: 80 °	
Condition of Grave: satisfactory	y			
Surveyor: D. Hacker			Date: 1/23/07	
_		mendations		
 ☐ Reset/level in ground; align ☐ Drill/pin to maintain histor ☐ Consolidate w/ HCT & OH- ☐ Consider replacement with ☐ Clean with D/2 & rinse ☐ Other: 	ic fabric 100 treatment	treatmer fiscal (2) ongoing treatm (3) no treatment fiscal treatment fisca	ng, requires nent next 2-3 years atment required, re et in 5 years	3

Grave #: 244






ZAI #: 190 **Row #:** 6 Photo No: **Cemetery:** St. Elizabeths West Grave #: 246 Name(s) on marker: Kenistrick, Joseph Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 246/JOSEPH KENISTRICK/2D COL./CAV. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 18 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken vandalized unattached loose biologicals stained repaired portions missing: chips left side tilted: degrees: 10 E-W N-S Other: spalling **Grave Orientation:** East Marker inscription faces what direction: 70 $^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years (4) irreparable

Grave #: 246






ZAI #: 46 **Row #:** 6 **Cemetery:** St. Elizabeths West Grave #: 247 Photo No: Name(s) on marker: Brown, John Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 247/JOHN BROWN/31ST/U.S.C. INF. **Reverse:** | marble granite other: Material: Gravestone Size (inches): Height: 19 Width: 10 Thickness: 2 **Condition of Marker:** cracked √vandalized weathered | broken unattached loose biologicals stained portions missing: chip on left side repaired tilted: degrees: 10 E-W N-S **Grave Orientation:** East Marker inscription faces what direction: 75° Condition of Grave: This is one of two stones for this person. This appears to be the replacement, or second stone, with the complete military information in the inscription. The other stone is #247A. Surveyor: D. Hacker Date: 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires treatment next 2-3 years Other: (3) no treatment required, reinspect in 5 years (4) irreparable

Grave #: 247






ZAI #: 46 **Row #:** 6 **Cemetery:** St. Elizabeths West Grave #: 247a Photo No: Name(s) on marker: Brown, Jonathon Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 247/JNO. BROWN/ [Note: the line in the inscription indicates that the government did not have complete information] Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 20 Width: 10 Thickness: 2 Condition of Marker: | weathered cracked broken vandalized unattached loose biologicals stained repaired portions missing: 🔀 tilted: degrees: 10 E-W N-S Other: chipped **Grave Orientation:** East Marker inscription faces what direction: $85\ ^{\rm o}$ Condition of Grave: This is one of two stones for this person. This appears to be the original, or first stone, without the complete military information in the inscription. Traditionally, these stones are destroyed after the replacement is delivered. The other stone is #247. **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires 1 Other: stone should be removed from cemetery treatment next 2-3 years as a duplicate (3) no treatment required, reinspect in 5 years

Grave #: 247A





ZAI #: 14 **Row #:** 6 Photo No: **Cemetery:** St. Elizabeths West **Grave #: 248** Name(s) on marker: Arnold, Rickert Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 248/RICKERT ARNOLD/CO. D/28TH PA./INF. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 20 Width: 10 Thickness: 2 Condition of Marker: weathered 7 cracked broken 7 vandalized unattached loose biologicals stained repaired portions missing: chips on left side tilted: degrees: 15 E-W N-S Other: mower damage **Grave Orientation:** East Marker inscription faces what direction: 75 $^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 248






Cemetery: St. Elizabeths West	Grave #: 248a	ZAI #: 279	Row #: 6	Photo No:
Name(s) on marker: Richardson	n, D.A.			
Type of Marker/Monument:: G	overnment Issue:			
	⊠ "Civil W □ General □ Other:	ar" - shield		
Inscription: 248/D.A. RICHAR	DSON/CO. []/28'	TH[]/INF.		
Reverse:				
Material: 🔀 marble	granite	other:		
Gravestone Size (inches): H	eight: 17	Width: 10	Thick	xness: 2
☐ un ☐ rep	attached 🔲 l	racked [oose [oortions missing: V 5 N-S	broken biologicals Other: chipped,	□ vandalized □ stained mower damage
Grave Orientation: East	Marker insc	ription faces wha	at direction: 80 °	
Condition of Grave: satisfactor	y			
Surveyor: D. Hacker			Date: 1/23/07	
		nendations		
☐ Reset/level in ground; align ☐ Drill/pin to maintain histor ☐ Consolidate w/ HCT & OH- ☐ Consider replacement with ☐ Clean with D/2 & rinse ☐ Other:	ic fabric 100 treatment	treatm r fiscal (2) ongoin treatm (3) no trea	ng, requires nent next 2-3 years atment required, re ct in 5 years	2

Grave #: 248A






ZAI #: 185 **Row #:** 6 Photo No: **Cemetery:** St. Elizabeths West Grave #: 254 Name(s) on marker: Kanz, David Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 254/DAVID KANZ/CO. H/74TH PA./INF. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 20 Width: 10 Thickness: 2 Condition of Marker: weathered | cracked broken √vandalized unattached loose biologicals stained repaired portions missing: chips right and left side tilted: degrees: 10 E-W 5 N-S Other: mower damage **Grave Orientation:** East Marker inscription faces what direction: $80\,^{\rm o}$ Condition of Grave: **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 254






ZAI #: 84 **Row #:** 6 Photo No: **Cemetery:** St. Elizabeths West Grave #: 260 Name(s) on marker: Conway, Patrick Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 260/PAT'K. CONWAY/CO. K/10TH KY./INF. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 18 Width: 10 Thickness: 2 Condition of Marker: weathered cracked broken 7 vandalized unattached loose biologicals stained repaired portions missing: chips right side tilted: degrees: 30 E-W 30 N-S Other: mower damage **Grave Orientation:** East Marker inscription faces what direction: 90 $^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years (4) irreparable

Grave #: 260





ZAI #: 22 **Row #:** 6 Photo No: **Cemetery:** St. Elizabeths West Grave #: 261 Name(s) on marker: Batdorf, Emmanuel Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 261/EMMANUEL BATDORF/CO. B/173D P.A./INF. Reverse: Material: marble granite other: **Gravestone Size (inches):** Height: 22 Width: 10 Thickness: 2 Condition of Marker: weathered cracked broken √vandalized unattached loose biologicals stained repaired portions missing: chips right and left sides tilted: degrees: 10 E-W 5 N-S Other: mower damage **Grave Orientation:** East Marker inscription faces what direction: $80\,^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 261






ZAI #: 298 Row #: 7 Photo No: **Cemetery:** St. Elizabeths West **Grave #: 300** Name(s) on marker: Sheehan, Cornelius Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: [300]/CORNELIUS [SHEE]HAN/CO. E/68TH/PA. INF. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 14 Width: 10 Thickness: 2 Condition of Marker: weathered 7 cracked broken \rightarrow vandalized unattached loose biologicals stained portions missing: repaired tilted: degrees: 25 E-W 5 N-S Other: sugaring; adjacent to tree **Grave Orientation:** East Marker inscription faces what direction: 70 $^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 300






ZAI #: 409 **Row #:** 7 Photo No: **Cemetery:** St. Elizabeths West Grave #: 301 Name(s) on marker: Sullivan, Jonathan Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 301/JNO. SULLIVAN/CO. H/34TH/U.S. INF. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 16 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken 7 vandalized unattached loose biologicals stained portions missing: repaired tilted: degrees: 25 E-W 5 N-S Other: spalling; sugaring **Grave Orientation:** East Marker inscription faces what direction: 70 $^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years (4) irreparable

Grave #: 301






ZAI #: 40 **Row #:** 6 Photo No: **Cemetery:** St. Elizabeths West **Grave #: 305** Name(s) on marker: Braywick, M.C. Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 305/M.C. BRAYWICK/CO. I/[]TH/WIS. INF. **Reverse:** marble granite other: Material: **Gravestone Size (inches):** Height: 26 Width: 10 Thickness: 2 Condition of Marker: weathered | cracked broken vandalized unattached loose biologicals repaired portions missing: base of stone tilted: degrees: E-W N-S Other: flat on ground; paint splatter **Grave Orientation:** Marker inscription faces what direction: **Condition of Grave:** satisfactory Surveyor: D. Hacker Date: 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 305





ZAI #: 354 **Row #:** 8 Photo No: **Cemetery:** St. Elizabeths West Grave #: 306 Name(s) on marker: White, Michael Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 306/MICH'L. WHITE/CO. A/2D U.S./INF. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 18 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken 7 vandalized unattached loose biologicals stained repaired portions missing: chips right side tilted: degrees: 12 E-W 4 N-S Other: spalling **Grave Orientation:** East Marker inscription faces what direction: 70 $^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 306






Cemetery: St. Elizabeths West	Grave #: 310	ZAI #: 117	Row #: 9	Photo No:
Name(s) on marker: Elwell, Cha	arles			
Type of Marker/Monument:: G				
	⊠ "Civil W ☐ General ☐ Other:	/ar" – shield		
Inscription: 310/CHAS. ELWE	LL/6TH/N.H. INI	.		
Reverse:				
Material: Marble	granite	other:		
Gravestone Size (inches): H	eight: 15	Width: 10	Thic	kness: 2
un rep	attached 🔲 1	cracked [loose [portions missing: W 5 N-S	broken biologicals chips left side Other: abrasion	vandalized stained
Grave Orientation: East	Marker inso	cription faces wha	nt direction: 65 °	
Condition of Grave: satisfactory	y			
Surveyor: D. Hacker			Date: 1/23/07	
_		mendations		
 ☐ Reset/level in ground; align ☐ Drill/pin to maintain histor ☐ Consolidate w/ HCT & OH- ☐ Consider replacement with ☐ Clean with D/2 & rinse ☐ Other: 	ic fabric 100 treatment	treatmer fiscal (2) ongoine treatmer (3) no treatmer	ng, requires nent next 2-3 years atment required, r et in 5 years	2

Grave #: 310





ZAI #: 295 **Row #:** 9 Photo No: **Cemetery:** St. Elizabeths West **Grave #:** 311 Name(s) on marker: Schneider, Frederick Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 311/FRED'K. SCHNEIDER/* [Note: "*" indicates a raised dot as the last line in the inscription. This probably shows that the government did not have the complete information for the inscription, although usually a dash is used.] **Reverse:** Material: | marble granite other: **Gravestone Size (inches):** Height: 16 Width: 10 Thickness: 2 **Condition of Marker:** weathered cracked broken \rightarrow vandalized unattached loose ⊠ biologicals stained repaired portions missing: tilted: degrees: 19 E-W 6 N-S Other: palling **Grave Orientation:** East Marker inscription faces what direction: 65 $^{\rm o}$ **Condition of Grave:** satisfactory Surveyor: D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal vear (2) ongoing, requires Clean with D/2 & rinse Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 311






Cemetery: St. Elizabeths West	Grave #: 312	ZAI #: 70	Row #: 9	Photo No:
Name(s) on marker: Clifford, Jo	onathon			
Type of Marker/Monument:: C	Government Issue:			
	⊠ "Civil W □ General □ Other:	Jar" – shield		
Inscription: 312/JNO. CLIFFO	RD/CO. C/33D IN	ID./INF.		
Reverse:				
Material: Marble	granite	other:		
Gravestone Size (inches): H	eight: 15	Width: 10	Thick	kness: 2
un rej	attached 🔲 🛚	cracked [loose [portions missing: W 10 N-S	broken biologicals chip left side Other: mower d	□ vandalized □ stained amage
Grave Orientation: East	Marker inso	cription faces wh	at direction: 65 °	
Condition of Grave: satisfactor	y			
Surveyor: D. Hacker			Date: 1/23/07	
	Recom	mendations		
 ☑ Reset/level in ground; align ☑ Drill/pin to maintain histor ☑ Consolidate w/ HCT & OH ☑ Consider replacement with ☑ Clean with D/2 & rinse ☑ Other: 	ic fabric -100 treatment	treatn er fiscal (2) ongoi treatn (3) no tre	ng, requires nent next 2-3 years atment required, re ct in 5 years	2

Grave #: 312






Cemetery: St. Elizabeths West	Grave #: 314	ZAI #: 49	Row #: 2	Photo No:
Name(s) on marker: Bruce, Her	nry			
Type of Marker/Monument:: G	overnment Issue:			
	⊠ "Civil W □ General □ Other:	Jar" – shield		
Inscription: 314/[HENR]Y BRU	CE/[U.S. ARMY]			
Reverse:				
Material:	granite	other:		
Gravestone Size (inches): H	eight: 25	Width: 10	Thick	iness: 2
☐ un ☐ rep	attached 🔲 🛚	cracked [loose [portions missing: E-W N-S	⊠ broken ⊠ biologicals Other: flat on gr	vandalized stained
Grave Orientation: NA	Marker inso	cription faces wha	nt direction:	
Condition of Grave: entire ston	e out of ground, a	nd probably in wr	ong location	
Surveyor: D. Hacker			Date: 1/23/07	
_		mendations		
 □ Reset/level in ground; align □ Drill/pin to maintain histor □ Consolidate w/ HCT & OH- □ Consider replacement with □ Clean with D/2 & rinse □ Other: 	ic fabric 100 treatment	treatmer fiscal (2) ongoin treatm (3) no trea	ng, requires dent next 2-3 years atment required, re et in 5 years	1

Grave #: 314





ZAI #: 252 **Row #:** 3 Photo No: **Cemetery:** St. Elizabeths West **Grave #:** 315 Name(s) on marker: Miller, C.G. Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 315/C.G. MILLER/CO. B/78TH/ILL. INF. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 22 Width: 10 Thickness: 2 Condition of Marker: weathered | cracked broken 7 vandalized unattached loose biologicals stained repaired portions missing: tilted: degrees: E-W N-S Other: flat on ground **Grave Orientation:** NA Marker inscription faces what direction: **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 315






ZAI #: 69 **Row #:** 9 Photo No: **Cemetery:** St. Elizabeths West **Grave #:** 316 Name(s) on marker: Chapman, Thomas Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 316/THOS. CHAPMAN/CO. B/17TH/N.Y. CAV. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 19 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken 7 vandalized unattached loose biologicals stained repaired portions missing: chips right side tilted: degrees: 10 E-W 5 N-S **Grave Orientation:** East Marker inscription faces what direction: $65\,^{\rm o}$ Condition of Grave: **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years (4) irreparable

Grave #: 316






ZAI #: 233 **Row #:** 9 Photo No: **Cemetery:** St. Elizabeths West **Grave #:** 317 Name(s) on marker: Mccoy, James Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: **Inscription:** 317/JAMES McCOY/CO. K/[2D R.I.]INF. Reverse: Material: | marble granite other: Gravestone Size (inches): Height: 18 Width: 10 Thickness: 2 Condition of Marker: weathered 7 cracked broken 7 vandalized unattached loose biologicals stained repaired portions missing: chips left side tilted: degrees: 15 E-W 3 N-S Other: mower damage **Grave Orientation:** East Marker inscription faces what direction: 70 $^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 317






ZAI #: 356 **Row #:** 11 Photo No: **Cemetery:** St. Elizabeths West Grave #: 350 Name(s) on marker: Wilder, C.J. Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 350/C.J. WILDER/CO. F/2D MO./CAV. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 12 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken \[\text{vandalized} \] unattached loose biologicals stained repaired portions missing: chips left corner and right top tilted: degrees: 25 E-W 5 N-S Other: spalling **Grave Orientation:** East Marker inscription faces what direction: $65\,^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/24/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 350





Cemetery: St. Elizabeths West	Grave #: 353	ZAI #: 127	Row #: 11	Photo No:	
Name(s) on marker: Fichter, He	enry				
Type of Marker/Monument:: G	overnment Issue:				
	⊠ "Civil W □ General □ Other:	Jar" – shield			
Inscription: 353/HENRY [FICH	I]TER/CO. F/14TI	H N.Y./H.A.			
Reverse:					
Material: Marble	granite	other:			
Gravestone Size (inches): H	eight: 12	Width: 10	Thick	cness: 2	
☐ un ☐ rep	attached 🔲	cracked [loose [portions missing: W 5 N-S	broken biologicals chips left side Other: mower o	□ vandalized □ stained damage	
Grave Orientation: East	Marker inse	cription faces wha	at direction: 70 °		
Condition of Grave: satisfactor	y				
Surveyor: D. Hacker	veyor: D. Hacker Date: 1/24/07				
	Recom	mendations			
☐ Reset/level in ground; align ☐ Drill/pin to maintain histor ☐ Consolidate w/ HCT & OH- ☐ Consider replacement with ☐ Clean with D/2 & rinse ☐ Other:	ic fabric 100 treatment	treatmer fiscal (2) ongoing treatmer (3) no treatmer	ng, requires nent next 2-3 years atment required, re et in 5 years	2	

Grave #: 353





Cemetery: St. Elizabeths West	Grave #: 354	ZAI #: 406	Row #: 3	Photo No:				
Name(s) on marker: Reilly, Jona	athon							
Type of Marker/Monument:: G	overnment Issue:	:						
	⊠ "Civil W ☐ General ☐ Other:	Var" – shield						
Inscription: 354/JNO. REILLY/	CO. H/33D U.S./	INF.						
Reverse:								
Material:	granite	other:						
Gravestone Size (inches): He	eight: 9	Width: 10	Thick	cness: 2				
una rep	attached 🔲	cracked [loose [portions missing: E-W N-S	broken biologicals lower half of stone Other: flat on	vandalized stained ground				
Grave Orientation: NA Marker inscription faces what direction:								
Condition of Grave: satisfactory	7							
Surveyor: D. Hacker			Date: 1/23/07					
	Recom	mendations						
 ☐ Reset/level in ground; align ☐ Drill/pin to maintain histori ☐ Consolidate w/ HCT & OH- ☐ Consider replacement with ☐ Clean with D/2 & rinse ☐ Other: 	c fabric 100 treatment	treatmer fiscal (2) ongoine treatm (3) no treatment trea	ng, requires nent next 2-3 years atment required, re et in 5 years	1				





ZAI #: 330 **Row #:** 11 Photo No: **Cemetery:** St. Elizabeths West Grave #: 359 Name(s) on marker: Taylor, J.T. Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 359/J.T. TAYLOR/CO. C/83D PA./INF. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 17 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken √vandalized unattached loose biologicals stained repaired portions missing: chip left side tilted: degrees: 20 E-W 8 N-S Other: mower damage **Grave Orientation:** East Marker inscription faces what direction: 70 $^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/24/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 359






ZAI #: 346 **Row #:** 10 Photo No: **Cemetery:** St. Elizabeths West **Grave #: 360** Name(s) on marker: Villenger, Antin Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 360/ANTIN VILLENGER/CO. I/16TH/U.S. INF. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 16 Width: 10 Thickness: 2 Condition of Marker: weathered 7 cracked broken √vandalized unattached loose biologicals stained portions missing: repaired tilted: degrees: 45 E-W 15 N-S Other: **Grave Orientation:** East Marker inscription faces what direction: 75 $^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 360






ZAI #: 167 **Row #:** 10 Photo No: **Cemetery:** St. Elizabeths West **Grave #: 362** Name(s) on marker: Hirsch, Leonard Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 362/LEONARD HIRSCH/CO. B/10TH/N.J. INF. Reverse: Material: marble granite other: **Gravestone Size (inches):** Height: 23 Width: 10 Thickness: 2 Condition of Marker: weathered 7 cracked broken \(\text{vandalized} \) unattached loose biologicals X stained repaired portions missing: chips, left edge tilted: degrees: 20 E-W 5 N-S Other: mower damage **Grave Orientation:** East Marker inscription faces what direction: 75 $^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 362





ZAI #: 402 **Row #:** 10 Photo No: **Cemetery:** St. Elizabeths West Grave #: 364 Name(s) on marker: Lamercier, Alfred Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: [364]/ALFRED LAMERCIER/CO. C/[]3D/U.S. INF. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 24 Width: 10 Thickness: 2 Condition of Marker: weathered 7 cracked broken 7 vandalized unattached loose biologicals stained repaired portions missing: chips left edge ★ tilted: degrees: 12 E-W N-S Other: mower damage **Grave Orientation:** East Marker inscription faces what direction: 60° **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years (4) irreparable

Grave #: 364





ZAI #: 59 **Row #:** 10 Photo No: **Cemetery:** St. Elizabeths West **Grave #: 366** Name(s) on marker: Buttar, Michael Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: **Inscription:** [366]/MICH'L BUTTAR/CO. A/[] KY./INF. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 24 Width: 10 Thickness: 2 Condition of Marker: weathered | cracked broken vandalized unattached loose biologicals repaired portions missing: chip left edge tilted: degrees: 30 E-W 10 N-S Other: spalling; mower damage **Grave Orientation:** East Marker inscription faces what direction: 60 $^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/23/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years (4) irreparable

Grave #: 366






Cemetery: St. Elizabeths West	Grave #: 367	ZAI #: 261	Row #: 10	Photo No:
Name(s) on marker: Munroe, G	eorge			
Type of Marker/Monument:: G	overnment Issue:			
	⊠ "Civil W □ General □ Other:	Jar" – shield		
Inscription: 367/GEO. MUNRO	E/CO. E/15TH/U	U.S. INF.		
Reverse:				
Material: Marble	granite	other:		
Gravestone Size (inches): He	eight: 23	Width: 10	Thi	ckness: 2
una rep	nttached 🔲 1	portions missing:	- 0	vandalized stained s; mower damage
Grave Orientation: East	Marker inso	cription faces wha	at direction: 70 °	
Condition of Grave:				
Surveyor: D. Hacker			Date: 1/23/07	
	Recom	mendations		
 ☐ Reset/level in ground; align ☐ Drill/pin to maintain histori ☐ Consolidate w/ HCT & OH- ☐ Consider replacement with ☐ Clean with D/2 & rinse ☐ Other: 	c fabric 100 treatment	treatmer fiscal (2) ongoing treatmer (3) no treatmer	ng, requires nent next 2-3 years atment required, ct in 5 years	xt s 2

Grave #: 367





ZAI #: 411 **Row #: 19** Photo No: **Cemetery:** St. Elizabeths West **Grave #: 369** Name(s) on marker: Taufer, Jonathon Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 369/JNO. TAUFER/36TH/U.S. INF. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 17 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken \rightarrow vandalized unattached loose biologicals stained repaired portions missing: chips left edge and left corner tilted: degrees: 12 E-W 7 N-S Other: mower damage **Grave Orientation:** East Marker inscription faces what direction: 70 $^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/24/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear






ZAI #: 207 **Row #: 19** Photo No: **Cemetery:** St. Elizabeths West **Grave #: 371** Name(s) on marker: Languer, Godfrey Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 371/GODFREY LANGNER/CO. H/46TH/[O]HIO INF. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 19 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken √vandalized unattached loose biologicals stained portions missing: repaired tilted: degrees: 22 E-W 12 N-S Other: spalling **Grave Orientation:** East Marker inscription faces what direction: 70 $^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/24/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years (4) irreparable

Grave #: 371






ZAI #: 87 **Row #: 19** Photo No: **Cemetery:** St. Elizabeths West **Grave #: 372** Name(s) on marker: Cupont, Francis Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: **Inscription:** 372/FRANCIS CUPONT/CO. F/69TH/N.Y. INF. Reverse: Material: | marble granite other: Gravestone Size (inches): Height: 16 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken vandalized unattached loose biologicals stained portions missing: repaired tilted: degrees: 15 E-W 15 N-S Other: spalling; abrasion **Grave Orientation:** East Marker inscription faces what direction: 60 $^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/24/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 372






ZAI #: 278 **Row #: 19** Photo No: **Cemetery:** St. Elizabeths West **Grave #: 373** Name(s) on marker: Riedel, Bernard Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 373/BERNARD REIDEL/CO. H/18TH/U.S. INF. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 20 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken √vandalized unattached loose biologicals stained repaired portions missing: chips right and left sides tilted: degrees: 15 E-W 5 N-S Other: **Grave Orientation:** East Marker inscription faces what direction: $80\,^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/24/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 373






ZAI #: 308 **Row #: 19** Photo No: **Cemetery:** St. Elizabeths West Grave #: 374 Name(s) on marker: Slevin, Michael Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 374/MICH'L. SLEVIN/CO. B/181ST/OHIO INF. Reverse: Material: | marble granite other: Gravestone Size (inches): Height: 19 Width: 10 Thickness: 2 Condition of Marker: weathered | Cracked broken vandalized unattached loose biologicals stained portions missing: repaired tilted: degrees: 30 E-W 8 N-S Other: **Grave Orientation:** East Marker inscription faces what direction: 70 $^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/24/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires **◯** Other: injection grout treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 374





ZAI #: 292 **Row #: 19** Photo No: **Cemetery:** St. Elizabeths West **Grave #: 375** Name(s) on marker: Sawyer, Howard, Jr. Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: **Inscription:** 375/HOWARD SAWYER JR./17TH/MASS./INF. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 19 Width: 10 Thickness: 2 Condition of Marker: weathered | cracked broken vandalized unattached loose biologicals stained portions missing: repaired tilted: degrees: 18 E-W 4 N-S Other: **Grave Orientation:** East Marker inscription faces what direction: 75 $^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/24/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 375






ZAI #: 161 **Row #:** 18 Photo No: **Cemetery:** St. Elizabeths West Grave #: 380 Name(s) on marker: Helm, Joshua Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 380/JOS[HUA] HELM/CO. C/116TH/U.S.C. INF. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 17 Width: 10 Thickness: 2 Condition of Marker: weathered Cracked broken vandalized unattached loose biologicals repaired portions missing: chips right and left sides tilted: degrees: 15 E-W 8 N-S Other: mower damage **Grave Orientation:** East Marker inscription faces what direction: $80\,^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/24/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 380





ZAI #: 50 **Row #:** 18 Photo No: **Cemetery:** St. Elizabeths West Grave #: 381 Name(s) on marker: Brunner, Harrison Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: **Inscription:** 381/HARRISON BRUNNER/3D/PA. ART. Reverse: Material: marble granite other: Gravestone Size (inches): Height: 20 Width: 10 Thickness: 2 Condition of Marker: weathered Cracked broken 7 vandalized unattached loose biologicals stained repaired portions missing: tilted: degrees: 12 E-W 8 N-S Other: mower damage **Grave Orientation:** East Marker inscription faces what direction: $80\,^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/24/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear


Grave #: 381






ZAI #: 93 **Row #:** 18 Photo No: **Cemetery:** St. Elizabeths West Grave #: 382 Name(s) on marker: Crounge, Erastus Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 382/ERASTUS CROUNGE/CO. F/20TH/ME. INF. Reverse: Material: | marble granite other: Gravestone Size (inches): Height: 20 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken vandalized unattached loose biologicals stained repaired portions missing: chips left side tilted: degrees: 25 E-W 8 N-S **Grave Orientation:** East Marker inscription faces what direction: $80\,^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/24/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years (4) irreparable

Grave #: 382

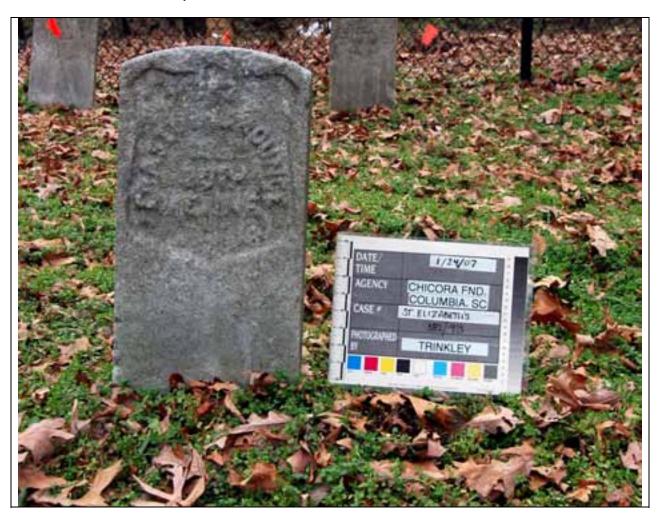



ZAI #: 77 **Row #:** 18 Photo No: **Cemetery:** St. Elizabeths West **Grave #: 383** Name(s) on marker: Coleman, Timothy Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 383/TIMOTHY COLEMAN/CO. K/[][]/L.R. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 16 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken 7 vandalized unattached loose biologicals stained portions missing: repaired tilted: degrees: 24 E-W 5 N-S Other: mower damage **Grave Orientation:** East Marker inscription faces what direction: 70 $^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/24/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 383






ZAI #: 221 **Row #:** 18 Photo No: **Cemetery:** St. Elizabeths West Grave #: 384 Name(s) on marker: Maguire, Jonathon Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 384/JNO. MAGUIRE/CO. I/7TH U.S./INF. Reverse: Material: | marble granite other: Gravestone Size (inches): Height: 16 Width: 10 Thickness: 2 Condition of Marker: weathered 7 cracked broken vandalized unattached loose biologicals X stained repaired portions missing: chips right side tilted: degrees: 25 E-W 6 N-S Other: mower damage **Grave Orientation:** East Marker inscription faces what direction: 75 $^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/24/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 384






ZAI #: 170 **Row #:** 18 Photo No: **Cemetery:** St. Elizabeths West **Grave #: 385** Name(s) on marker: Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: **Inscription:** 385 / G. HA____N / CO. __ / 4TH U.S. / INF. Reverse: Material: | marble granite other: **Gravestone Size (inches): Height:** 183/4 Width: 10 Thickness: 2 Condition of Marker: weathered cracked broken √vandalized unattached loose biologicals stained repaired portions missing: chips tilted: degrees: 24 E-W 2 N-S **Grave Orientation:** East Marker inscription faces what direction: 72 $^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/24/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 385





ZAI #: 253 **Row #: 17** Photo No: **Cemetery:** St. Elizabeths West Grave #: 388a Name(s) on marker: Miller, T. Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: [388A]/T. [MI]LLER/ ---[Note: The line at the end of the inscription indicates that the government did not have the military information for the inscription] **Reverse:** Material: | marble granite other: **Gravestone Size (inches):** Height: 21 Width: 10 Thickness: 2 **Condition of Marker:** weathered cracked broken vandalized unattached loose biologicals portions missing: chipped left corner repaired tilted: degrees: 5 E-W 15 N-S Other: **Grave Orientation:** East Marker inscription faces what direction: 70 $^{\rm o}$ **Condition of Grave:** satisfactory Surveyor: D. Hacker **Date:** 1/24/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal vear (2) ongoing, requires Clean with D/2 & rinse Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Grave #: 388A






ZAI #: 104 **Row #: 17** Photo No: **Cemetery:** St. Elizabeths West Grave #: 391 Name(s) on marker: Diggs, Albert Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 391/ALBERT DIGGS/U.S.C./INF. Reverse: Material: | marble granite other: Gravestone Size (inches): Height: 15 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken vandalized unattached loose biologicals portions missing: repaired tilted: degrees: 22 E-W 7 N-S Other: mower damage **Grave Orientation:** East Marker inscription faces what direction: 70 $^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/24/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 391






ZAI #: 118 **Row #: 17** Photo No: **Cemetery:** St. Elizabeths West **Grave #: 392** Name(s) on marker: Erne, Herbert Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: **Inscription:** [3]92/HER[BER]T ERNE/CO. []/4TH/U.S. INF. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 15 Width: 10 Thickness: 2 Condition of Marker: weathered 7 cracked broken number | vandalized unattached loose biologicals repaired portions missing: chips left side and along top margin ★ tilted: degrees: 22 E-W N-S Other: **Grave Orientation:** East Marker inscription faces what direction: 70° **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/24/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 392






ZAI #: 287 Row #: 17 Photo No: **Cemetery:** St. Elizabeths West **Grave #: 393** Name(s) on marker: Ryder, Patrick Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 393/PAT'K. [RY]DER/CO. I/1[]TH/U.S. INF. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 15 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken vandalized unattached loose biologicals X stained portions missing: repaired tilted: degrees: 14 E-W 5 N-S Other: **Grave Orientation:** East Marker inscription faces what direction: 70 $^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/24/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years (4) irreparable

Grave #: 393





ZAI #: 43 **Row #: 17** Photo No: **Cemetery:** St. Elizabeths West Grave #: 394 Name(s) on marker: Bromagem, J.M. Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 394/J.M. BROMAGEM/CORP'L/CO. A/8TH IND./CAV. Reverse: Material: | marble granite other: Gravestone Size (inches): Height: 15 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken vandalized unattached loose biologicals portions missing: repaired tilted: degrees: 25 E-W 5 N-S Other: mower damage **Grave Orientation:** East Marker inscription faces what direction: $80\,^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/24/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 394






Cemetery: St. Elizabeths West	Grave #: 395	ZAI #: 170	Row #: 15	Photo No:
Name(s) on marker: Hooten, G.	Е.			
Type of Marker/Monument:: G	overnment Issue:			
	⊠ "Civil W □ General □ Other:	ar" – shield		
Inscription: 395/G.E. HOOTEN	/CO. F/30TH/U.9	S.C. INF.		
Reverse:				
Material: Marble	granite	other:		
Gravestone Size (inches): He	eight: 17	Width: 10	Thick	aness: 2
una rep	ıttached 🔲 1	portions missing:	☐ broken ☑ biologicals Other: mower da	vandalized stained
Grave Orientation: East	Marker insc	ription faces wha	at direction: 75 °	
Condition of Grave: satisfactory	•			
Surveyor: D. Hacker		:	Date: 1/24/07	
_		mendations		
 ☑ Reset/level in ground; align ☐ Drill/pin to maintain histori ☐ Consolidate w/ HCT & OH- ☐ Consider replacement with ☑ Clean with D/2 & rinse ☑ Other: injection grout 	c fabric 100 treatment	treatm fiscal (2) ongoin treatm (3) no trea	ng, requires tent next 2-3 years atment required, re tt in 5 years	2


Grave #: 395





Cemetery: St. Elizabeths West	Grave #: 398	ZAI #: 182	Row #: 16	Photo No:
Name(s) on marker: Johnson, R	lobert			
Type of Marker/Monument:: G	overnment Issue:			
- J F	⊠ "Civil W □ General □ Other:	ar" – shield		
Inscription: 398/ROB'T. JOHNS	60N/CO. K/96TH	/OHIO INF.		
Reverse:				
Material:	granite	other:		
Gravestone Size (inches): He	eight: 24	Width: 10	Thick	ness: 2
☐ un. ☐ rep	attached 🔲 l paired 🔲 p	racked [oose [oortions missing: E-W N-S	☑ broken ☑ biologicals lower half Other: flat on gro damage	vandalized stained ound; mower
Grave Orientation:	Marker insc	ription faces wha	at direction:	
Condition of Grave: satisfactory	7			
Surveyor: D. Hacker			Date: 1/24/07	
	Recomi	nendations		
 □ Reset/level in ground; align □ Drill/pin to maintain histori □ Consolidate w/ HCT & OH- □ Consider replacement with □ Clean with D/2 & rinse □ Other: 	c fabric 100 treatment	treatm r fiscal (2) ongoing treatm (3) no treatm	ng, requires nent next 2-3 years atment required, re tt in 5 years	. 1






ZAI #: 198 **Row #:** 16 Photo No: **Cemetery:** St. Elizabeths West **Grave #: 399** Name(s) on marker: Kopp, Francis Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 399/FRANCIS KOPP/CO. K/8TH U.S./INF. Reverse: Material: | marble granite other: Gravestone Size (inches): Height: 19 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken vandalized unattached loose biologicals repaired portions missing: chip left side tilted: degrees: 16 E-W 4 N-S Other: mower damage **Grave Orientation:** East Marker inscription faces what direction: 65 $^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/24/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 399






ZAI #: 147 **Row #:** 16 Photo No: **Cemetery:** St. Elizabeths West Grave #: 400 Name(s) on marker: Grimes, E.R. Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 400/E.R. GRIMES/CO. D/16TH/N.Y. H.A. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 24 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken vandalized unattached loose biologicals stained portions missing: repaired tilted: degrees: 18 E-W 10 N-S Other: **Grave Orientation:** East Marker inscription faces what direction: $80\,^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/24/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years (4) irreparable

Grave #: 400






ZAI #: 3 **Row #:** 16 Photo No: **Cemetery:** St. Elizabeths West Grave #: 401 Name(s) on marker: Adreon, D.C. Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: **Inscription:** 401/D.C. ADREON/LHUT./8TH MD./INF. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 12 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken vandalized unattached loose biologicals stained portions missing: repaired tilted: degrees: 17 E-W 3 N-S Other: **Grave Orientation:** East Marker inscription faces what direction: 70 $^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/24/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years (4) irreparable

Grave #: 401






ZAI #: 206 **Row #:** 16 Photo No: **Cemetery:** St. Elizabeths West Grave #: 402 Name(s) on marker: Landon, William Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 402/W[M.] [L]ANDON/SGT./CO. F 10TH/U.S. INF. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 20 Width: 10 Thickness: 2 Condition of Marker: weathered 7 cracked broken 7 vandalized unattached loose biologicals stained portions missing: repaired tilted: degrees: 23 E-W 8 N-S Other: mower damage **Grave Orientation:** East Marker inscription faces what direction: 70 $^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/24/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years


Current Condition Photograph on Rear


Grave #: 402





Cemetery: St. Elizabeths West	Grave #: 404	ZAI #: 112	Row #: 15	Photo No:
Name(s) on marker: Dunbar, C	arson			
Type of Marker/Monument:: C	Sovernment Issue:			
	⊠ "Civil W □ General □ Other:	ar" – shield		
Inscription: 404/CAR[SON] DI	UNBAR/CO. H/10	2D/PA.INF.		
Reverse:				
Material: Marble	granite	other:		
Gravestone Size (inches): H	eight: 23	Width: 10	Thick	mess: 2
un rej	attached 🔲 1	eracked [oose [oortions missing: V 23 N-S	broken biologicals chips left side Other: mower d	□ vandalized □ stained amage
Grave Orientation: East	Marker insc	ription faces wha	at direction: 80 °	
Condition of Grave: satisfactor	y			
Surveyor: D. Hacker			Date: 1/24/07	
_	Recom	mendations		
 ☑ Reset/level in ground; align ☑ Drill/pin to maintain histor ☑ Consolidate w/ HCT & OH ☑ Consider replacement with ☑ Clean with D/2 & rinse ☑ Other: 	ic fabric -100 treatment	treatmr fiscal (2) ongoing treatmr (3) no tre	ng, requires nent next 2-3 years atment required, re ct in 5 years	2

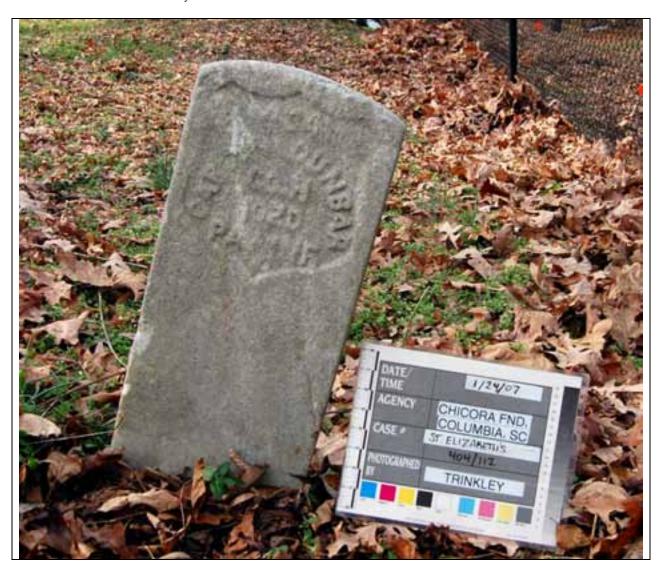




ZAI #: 241 **Row #:** 15 Photo No: **Cemetery:** St. Elizabeths West **Grave #: 405** Name(s) on marker: Mcgrath, Michael Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 405/[MICHAEL] McGRATH/CO. K/27TH/MASS. INF. Reverse: marble granite other: Material: **Gravestone Size (inches):** Height: 23 Width: 10 Thickness: 2 Condition of Marker: weathered | cracked > broken 7 vandalized unattached loose biologicals stained repaired \square portions missing: lower 1/3 tilted: degrees: N-S E-W Other: flat on ground; mower damage **Grave Orientation:** Marker inscription faces what direction: **Condition of Grave:** satisfactory Surveyor: D. Hacker Date: 1/24/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next ☐ Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear






ZAI #: 297 **Row #: 15** Photo No: **Cemetery:** St. Elizabeths West **Grave #: 406** Name(s) on marker: Shacklett, J.L. Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 406/J.L. SHACKLETT/ CO. A/10TH IND./INF. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 24 Width: 10 Thickness: 2 Condition of Marker: weathered | cracked > broken vandalized unattached loose biologicals repaired portions missing: chips left edge tilted: degrees: 24 E-W 25 N-S Other: spalling; mower damage **Grave Orientation:** East Marker inscription faces what direction: 80° **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/24/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 406





Cemetery: St. Elizabeths West	Grave #: 408	ZAI #: 286	Row #: 15	Photo No:
Name(s) on marker: Ryan, C.H	[.			
Type of Marker/Monument:: (Government Issue:			
	⊠ "Civil W □ General □ Other:	ar" – shield		
Inscription: 408/C.H. RYAN/0	CO. H/7TH U.S./IN	NF.		
Reverse:				
Material: 🔀 marble	granite	other:		
Gravestone Size (inches): H	leight: 18	Width: 10	Thic	kness: 2
uı re	nattached 🔲 1	eracked [oose [portions missing: V 18 N-S	☐ broken ☑ biologicals Other: mower d	vandalized stained
Grave Orientation: East	Marker insc	ription faces wha	at direction: 70 °	
Condition of Grave: satisfactor	y			
Surveyor: D. Hacker			Date: 1/24/07	
_		mendations		
⊠ Reset/level in ground; align □ Drill/pin to maintain histor □ Consolidate w/ HCT & OH □ Consider replacement with ☑ Clean with D/2 & rinse □ Other:	-100 treatment	treatmr fiscal (2) ongoing treatmr (3) no tre	ng, requires nent next 2-3 years atment required, re et in 5 years	2

Grave #: 408






Cemetery: St. Elizabeths West	Grave #: 411	ZAI #: 319	Row #: 15	Photo No:
Name(s) on marker: Smith, Tho	mas			
Type of Marker/Monument:: G	overnment Issue:			
	⊠ "Civil W □ General □ Other:	ar" - shield		
Inscription: 411/THOS. SMITH	/CO. C/U.S./ENG	G'RS		
Reverse:				
Material: Marble	granite	other:		
Gravestone Size (inches): H	eight: 18	Width: 10	Thick	eness: 2
☐ un ☐ rep	attached 🔲 l	cracked [oose [portions missing: V 12 N-S	broken biologicals chips left side Other: mower d	□ vandalized □ stained amage
Grave Orientation: East	Marker insc	ription faces wha	at direction: 70 °	
Condition of Grave: satisfactory	ý			
Surveyor: D. Hacker			Date: 1/24/07	
_		mendations		
☐ Reset/level in ground; align ☐ Drill/pin to maintain histor ☐ Consolidate w/ HCT & OH- ☐ Consider replacement with ☐ Clean with D/2 & rinse ☐ Other:	ic fabric 100 treatment	treatm r fiscal (2) ongoing treatm (3) no treatm	ng, requires nent next 2-3 years atment required, re et in 5 years	2

Grave #: 411






Cemetery: St. Elizabeths West	Grave #: 412	ZAI #: 32	Row #: 15	Photo No:
Name(s) on marker: Berswinger	r, Gottfried			
Type of Marker/Monument:: G		المائمة السما		
	General Other:	ar" – shield		
Inscription: 412/GOTTFRIED E	BERSWINGER/CO	o. F/37TH/IND. 1	INF.	
Reverse:				
Material:	granite	other:		
Gravestone Size (inches): H	eight: 18	Width: 10	Thick	ness: 2
☐ un ☐ rep	attached 🔲 1	eracked oose oortions missing: 14 N-S	broken biologicals chips left side Other:	☐ vandalized ☑ stained
Grave Orientation: East	Marker insc	ription faces wh	at direction: $70^{\rm o}$	
Condition of Grave: satisfactor	y			
Surveyor: D. Hacker			Date: 1/24/07	
		mendations		
☐ Reset/level in ground; align ☐ Drill/pin to maintain histor ☐ Consolidate w/ HCT & OH- ☐ Consider replacement with ☐ Clean with D/2 & rinse ☐ Other:	ic fabric 100 treatment	treatn r fiscal (2) ongoi treatn (3) no tre	ing, requires nent next 2-3 years eatment required, re ct in 5 years	2

Grave #: 412






ZAI #: 176 **Row #:** 14 Photo No: **Cemetery:** St. Elizabeths West **Grave #: 413** Name(s) on marker: Huckneys, J.L. Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 413/J.L. HUCKNEYS/CO. D/8TH/U.S. CAV. Reverse: Material: | marble granite other: Gravestone Size (inches): Height: 22 Width: 10 Thickness: 2 Condition of Marker: weathered | cracked broken 7 vandalized unattached loose biologicals stained repaired portions missing: chips at top edge tilted: degrees: 12 E-W 10 N-S Other: mower damage **Grave Orientation:** East Marker inscription faces what direction: $85\,^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/24/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 413






ZAI #: 347 **Row #:** 14 Photo No: **Cemetery:** St. Elizabeths West Grave #: 414 Name(s) on marker: Waggerman, George Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 414/GEO. WAGGERMAN/CO. K/57TH/OHIO INF. Reverse: Material: marble granite other: **Gravestone Size (inches):** Height: 19 Width: 10 Thickness: 2 Condition of Marker: weathered cracked broken 7 vandalized unattached loose biologicals stained portions missing: repaired tilted: degrees: 2 E-W 2 N-S Other: mower damage **Grave Orientation:** East Marker inscription faces what direction: $80\,^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/24/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years (4) irreparable

Grave #: 414






ZAI #: 247 **Row #:** 14 **Cemetery:** St. Elizabeths West **Grave #: 415** Photo No: Name(s) on marker: Mcafer, Jonathon Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: **Inscription:** 415/JNO. McAFER/ [Note: The line in the inscription indicates that government did not have complete information] Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 21 Width: 10 Thickness: 2 Condition of Marker: weathered | cracked broken vandalized unattached loose biologicals stained portions missing: chip left edge repaired tilted: degrees: 14 E-W 16 N-S Other: **Grave Orientation:** East Marker inscription faces what direction: 70 $^{\rm o}$ **Condition of Grave:** satisfactory **Date:** 1/24/07 Surveyor: D. Hacker Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 415






Cemetery: St. Elizabeths West	Grave #: 417	ZAI #: 305	Row #: 14	Photo No:
Name(s) on marker: Sibole, R.S.				
Type of Marker/Monument:: Go	overnment Issue:			
	⊠ "Civil W □ General □ Other:	ar" – shield		
Inscription: 417/R.S. SIBOLE/1	5TH/W. VA. INF.			
Reverse:				
Material: Marble	granite	other:		
Gravestone Size (inches): He	ight: 17	Width: 10	Thick	aness: 2
una rep	ıttached 🔲 1	eracked [oose [portions missing: V 5 N-S	broken biologicals chips left edge Other: spray pai	□ vandalized □ stained nt in shield
Grave Orientation: East	Marker insc	ription faces wh	at direction: 65 °	
Condition of Grave: satisfactory				
Surveyor: D. Hacker			Date: 1/24/07	
		mendations		
 ☑ Reset/level in ground; align ☑ Drill/pin to maintain histori ☐ Consolidate w/ HCT & OH-1 ☐ Consider replacement with ' ☑ Clean with D/2 & rinse ☐ Other: 	c fabric 100 treatment	treatn r fiscal (2) ongoi treatn (3) no tre	ng, requires nent next 2-3 years atment required, re ct in 5 years	2

Grave #: 417






ZAI #: 184 **Row #:** 14 Photo No: **Cemetery:** St. Elizabeths West **Grave #: 418** Name(s) on marker: Kaencer, Frederick Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: [418]/FRED'K. [KAEN]CER/CO. [K]/37TH/OHIO INF. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 17 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken vandalized unattached loose biologicals X stained portions missing: repaired tilted: degrees: 20 E-W 16 N-S Other: **Grave Orientation:** East Marker inscription faces what direction: 75 $^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/24/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 418






ZAI #: 20 **Row #:** 14 Photo No: **Cemetery:** St. Elizabeths West Grave #: 420 Name(s) on marker: Bailey, Jonathon Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 420/JNO. BAI[LEY]/CO. []/1ST N.H./H.A. Reverse: Material: | marble granite other: Gravestone Size (inches): Height: 23 Width: 10 Thickness: 2 Condition of Marker: weathered cracked broken 7 vandalized unattached loose biologicals stained repaired portions missing: chips left side tilted: degrees: 14 E-W 13 N-S Other: mower damage **Grave Orientation:** East Marker inscription faces what direction: $80\,^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/24/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 420






ZAI #: 64 **Row #:** 13 Photo No: **Cemetery:** St. Elizabeths West Grave #: 429 Name(s) on marker: Carpenter, Joseph Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 429/JOSEPH CARPENTER/CO. [C]/4TH/U.S.C./INF. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 21 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken \rightarrow vandalized unattached loose biologicals stained repaired portions missing: chips right and left sides tilted: degrees: 16 E-W 2 N-S Other: **Grave Orientation:** East Marker inscription faces what direction: 75 $^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/24/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 429






ZAI #: 329 **Row #:** 13 Photo No: **Cemetery:** St. Elizabeths West Grave #: 430 Name(s) on marker: Talleson, Samuel Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 430/SAM'L TALLESON/CO. D/8TH/U.S./CAV. Reverse: Material: | marble granite other: Gravestone Size (inches): Height: 23 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken 7 vandalized unattached loose biologicals stained repaired portions missing: chips left side tilted: degrees: 20 E-W 18 N-S **Grave Orientation:** East Marker inscription faces what direction: $80\,^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/24/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 430





ZAI #: 272 **Row #: 12** Photo No: **Cemetery:** St. Elizabeths West Grave #: 431 Name(s) on marker: Parker, C.H. Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 431/C.H. PARKER/CO. C/3D U.S./CAV. Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 18 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken vandalized unattached loose biologicals stained repaired portions missing: tilted: degrees: 10 E-W 13 N-S Other: **Grave Orientation:** East Marker inscription faces what direction: $65\,^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/24/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 431






ZAI #: 177 **Row #: 12** Photo No: **Cemetery:** St. Elizabeths West Grave #: 432 Name(s) on marker: Hursh, Chris Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 432/CHRIS HURSH/CO. []/134TH/OHIO INF. Reverse: Material: | marble granite other: Gravestone Size (inches): Height: 14 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken 7 vandalized unattached loose biologicals stained repaired portions missing: tilted: degrees: 40 E-W N-S Other: **Grave Orientation:** East Marker inscription faces what direction: 75 $^{\rm o}$ **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/24/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years (4) irreparable

Grave #: 432






ZAI #: 168 **Row #: 12** Photo No: **Cemetery:** St. Elizabeths West **Grave #: 433** Name(s) on marker: Holman, Liberty Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: 433/LIBERTY HOLMAN/CO. C/4TH/MASS./CAV. Reverse: Material: | marble granite other: Gravestone Size (inches): Height: 15 Width: 10 Thickness: 2 Condition of Marker: weathered | 7 cracked broken vandalized unattached loose biologicals X stained repaired portions missing: chips left edge tilted: degrees: 10 E-W 7 N-S **Grave Orientation:** East Marker inscription faces what direction: 60° **Condition of Grave:** satisfactory **Surveyor:** D. Hacker **Date:** 1/24/07 Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 433






Cemetery: St. Elizabeths West	Grave #: 434	ZAI #: 160	Row #: 12	Photo No:
Name(s) on marker: Heaton, Ra	ph			
Type of Marker/Monument:: G	overnment Issue:			
-ypc 01 1,111104,110111110		Jar" - shield		
Inscription: 434/RALPH HEAT	ON/CO. M/2D U	J.S./ART.		
Reverse:				
Material: Marble	granite	other:		
Gravestone Size (inches): He	ight: 15	Width: 10	Thick	eness: 2
una rep	ttached 🔲 1		broken biologicals extensive damage l Other: mower da	-
Grave Orientation: East	Marker inso	cription faces wha	at direction: 60°	
Condition of Grave: satisfactory				
Surveyor: D. Hacker			Date: 1/24/07	
_	Recom	mendations		
 ☐ Reset/level in ground; align ☐ Drill/pin to maintain histori ☐ Consolidate w/ HCT & OH- ☐ Consider replacement with a Clean with D/2 & rinse ☐ Other: 	c fabric 100 treatment	treatmer fiscal (2) ongoing treatmer (3) no tre	ng, requires nent next 2-3 years atment required, re ct in 5 years	2

Grave #: 434






ZAI #: 163 **Row #: 12** Photo No: **Cemetery:** St. Elizabeths West **Grave #: 438** Name(s) on marker: Herbert, Henry Type of Marker/Monument:: Government Issue: Civil War" - shield General Other: Inscription: [43]8/[HENRY HER]BERT/ ---[Note: The line in inscription indicates that the government did not have complete information] Reverse: Material: | marble granite other: **Gravestone Size (inches):** Height: 18 Width: 10 Thickness: 2 Condition of Marker: weathered | cracked broken √vandalized ⊠ stained unattached loose biologicals repaired portions missing: tilted: degrees: 34 E-W 15 N-S Other: **Grave Orientation:** East Marker inscription faces what direction: $80\,^{\rm o}$ Condition of Grave: satisfactory **Date:** 1/24/07 Surveyor: D. Hacker Recommendations Reset/level in ground; align to existing row **Priority:** Drill/pin to maintain historic fabric (1) unstable, requires Consolidate w/ HCT & OH-100 treatment treatment current or next Consider replacement with "XA" NCA marker fiscal year Clean with D/2 & rinse (2) ongoing, requires Other: treatment next 2-3 years (3) no treatment required, reinspect in 5 years

Current Condition Photograph on Rear

Grave #: 438






Cemetery: St. Elizabeths West	Grave #: A	ZAI #:	Row #: 1	Photo No:
Name(s) on marker: None				
Type of Marker/Monument:: G	overnment Issue	:		
	General	Var" – shield I Basal portion of st	tone only	
Inscription: None				
Reverse:				
Material: Marble	granite	other:		
Gravestone Size (inches): H	eight: 2	Width: 10	Thick	ness: 2
un rep	eathered attached paired ed: degrees: 15 E-	- 0	broken biologicals upper half of tombe Other:	vandalized stained stone
Grave Orientation: East	Marker ins	cription faces wh	nat direction: 110 °	
Condition of Grave: satisfactor	y			
Surveyor: D. Hacker			Date: 1/23/02	
	Recom	nmendations		
 ☐ Reset/level in ground; align ☐ Drill/pin to maintain histor ☐ Consolidate w/ HCT & OH- ☐ Consider replacement with ☐ Clean with D/2 & rinse ☐ Other: 	ic fabric 100 treatment	treats er fisca (2) ongo treats (3) no tr	Priority: able, requires ment current or next l year ving, requires ment next 2-3 years eatment required, re ect in 5 years varable	1

Grave #: A






Cemetery: St. Elizabeths West	Grave #: B	ZAI #:	Row #: 1	Photo No:
Name(s) on marker: None				
Type of Marker/Monument:: Go	overnment Issue	:		
	Genera	Var" - shield l Basal portion of sto	one only	
Inscription: None				
Reverse:				
Material: Marble	granite	other:		
Gravestone Size (inches): He	ight: 3	Width: 10	Thick	eness: 2
una rep	athered uttached aired ed: degrees:	cracked [loose [portions missing: E-W N-S	broken biologicals upper half of tombe Other:	vandalized stained stone
Grave Orientation: East	Marker ins	scription faces wha	at direction: 105 °	
Condition of Grave: satisfactory				
Surveyor: D. Hacker			Date: 1/23/07	
□ D (// 1 ' 1 - 1 '		nmendations	Detaction	
□ Reset/level in ground; align □ Drill/pin to maintain histori □ Consolidate w/ HCT & OH- □ Consider replacement with f □ Clean with D/2 & rinse □ Other:	c fabric 100 treatment	treatn fiscal (2) ongoi treatn (3) no tre	ng, requires nent next 2-3 years atment required, re ct in 5 years	1

Grave #: B






Cemetery: St. Elizabeths West Grave #: C ZAI #: Row #: east of Photo No:

last stone in Row 1

	Kow 1		
Name(s) on marker:			
Type of Marker/Monument:: Government Issue: ⊠ "Civil War" – s ☐ General	shield		
Other:			
Inscription: [] / [] / U.S. VOLS.			
Reverse:			
	other:		
Gravestone Size (inches): Height: 15½ W	idth: 10 Thickness: 13/4		
Condition of Marker:	d		
Grave Orientation: East Marker inscription	n faces what direction: $70^{ m o}$		
Condition of Grave: satisfactory			
Surveyor: D. Hacker	Date: 1/23/07		
Recommend			
□ Reset/level in ground; align to existing row □ Drill/pin to maintain historic fabric □ Consolidate w/ HCT & OH-100 treatment □ Consider replacement with "XA" NCA marker □ Clean with D/2 & rinse □ Other:	Priority: (1) unstable, requires treatment current or next fiscal year (2) ongoing, requires treatment next 2-3 years		
	(3) no treatment required, reinspect in 5 years(4) irreparable		

Grave #: C






Cemetery: St. Elizabeths West	Grave #: D	ZAI #:	Row #: 2	Photo No:
Name(s) on marker: None				
Type of Marker/Monument:: (Government Issue	:		
	General	Var" - shield l pasal portion of s	tone only	
Inscription: None				
Reverse:				
Material: Marble	granite	other:		
Gravestone Size (inches): I	Height: 10	Width: 10	Thick	eness: 2
u: re	eathered	cracked loose portions missing E-W N-S	broken biologicals upper half of stone Other:	☐ vandalized ☐ stained
Grave Orientation: East	Marker ins	cription faces w	hat direction: $60^{\rm o}$	
Condition of Grave: unknowr	Į.			
Surveyor: D. Hacker			Date: 1/23/07	
_	Recom	nmendations		
☐ Reset/level in ground; alig☐ Drill/pin to maintain histo☐ Consolidate w/ HCT & OF☐ Consider replacement with☐ Clean with D/2 & rinse☐ Other:	ric fabric I-100 treatment	er fisca (2) ongo treat (3) no tr	Priority: cable, requires timent current or next al year oing, requires timent next 2-3 years reatment required, re pect in 5 years parable	4

Grave #: D






Cemetery: St. Elizabeths West	Grave #: E	ZAI #:	Row #: 3	Photo No:
Name(s) on marker: None				
Type of Marker/Monument:: G	overnment Issue	:		
	Genera	Var" - shield l pasal portion of sto	one only	
Inscription: None				
Reverse:				
Material: marble	granite	other:		
Gravestone Size (inches): He	e ight: 5	Width: 10	Thick	eness: 2
una rep	athered	cracked [loose [portions missing: E-W N-S	broken biologicals upper half of stone Other:	☐ vandalized ☐ stained
Grave Orientation: East	Marker ins	scription faces wh	at direction:	
Condition of Grave: satisfactory	•			
Surveyor: D. Hacker			Date: 1/23/07	
		nmendations	D: 1	
□ Reset/level in ground; align □ Drill/pin to maintain histori □ Consolidate w/ HCT & OH- □ Consider replacement with f □ Clean with D/2 & rinse □ Other:	c fabric 100 treatment	treatn fiscal (2) ongoi treatn (3) no tre	ng, requires nent next 2-3 years atment required, re ct in 5 years	1

Grave #: E






Cemetery: St. Elizabeths West	Grave #: F	ZAI #:	Row #: 3	Photo No:
Name(s) on marker: None				
Type of Marker/Monument:: G	overnment Issue	:		
	Genera	Var" - shield l pasal portion of st	one only	
Inscription: None				
Reverse:				
Material: Marble	granite	other:		
Gravestone Size (inches): H	eight: 16	Width: 10	Thic	kness: 2
☐ un ☐ rep	eathered attached soaired sed: degrees:	cracked loose portions missing E-W N-S	⊠ broken □ biologicals : upper half of stone Other: flat on	
Grave Orientation: NA	Marker ins	scription faces wh	nat direction:	
Condition of Grave: unknown				
Surveyor: D. Hacker			Date: 1/23/07	
		nmendations		
 ☐ Reset/level in ground; align ☐ Drill/pin to maintain histor ☐ Consolidate w/ HCT & OH ☐ Consider replacement with ☐ Clean with D/2 & rinse ☐ Other: 	ic fabric 100 treatment	treati er fiscal (2) ongo treati (3) no tre	Priority: able, requires ment current or nex l year sing, requires ment next 2-3 years eatment required, r ect in 5 years arable	4

Grave #: F






Cemetery: St. Elizabeths West	Grave #: G	ZAI #:	Row #: 3	Photo No:
Name(s) on marker: None				
Type of Marker/Monument:: Go	overnment Issue	:		
	General	Var" - shield l pasal portion of sto	one only	
Inscription: None				
Reverse:				
Material: marble	granite	other:		
Gravestone Size (inches): He	ight: 12	Width: 10	Thick	ness: 2
una rep	ittached 🔲	- 0	broken biologicals upper half of stone Other:	☐ vandalized ☐ stained
Grave Orientation: East	Marker ins	cription faces wh	at direction: $80^{\rm o}$	
Condition of Grave: satisfactory				
Surveyor: D. Hacker			Date: 1/23/07	
□ D (// 1 ' 1 - 1'		nmendations	Delanitan	
□ Reset/level in ground; align □ Drill/pin to maintain histori □ Consolidate w/ HCT & OH-1 □ Consider replacement with / □ Clean with D/2 & rinse □ Other:	c fabric 100 treatment	treatn er fiscal (2) ongoi treatn (3) no tre	ng, requires nent next 2-3 years atment required, re ct in 5 years	1

Grave #: G






Cemetery: St. Elizabeths West	Grave #: H	ZAI #:	Row #: 11	Photo No:
Name(s) on marker: None				
Type of Marker/Monument:: Go	overnment Issue:	:		
	⊠ "Civil W □ General □ Other:	Var" – shield		
Inscription: None				
Reverse:				
Material: 🔀 marble	granite	other:		
Gravestone Size (inches): He	ight: 12	Width: 10	Thick	ness: 2
una repa	ttached 🔲		broken biologicals entire inscription are Other: spalled on	
Grave Orientation: East	Marker ins	cription faces w	what direction: $70^{ m o}$	
Condition of Grave: satisfactory				
Surveyor: D. Hacker			Date: 1/24/07	
	Recom	mendations		
 Reset/level in ground; align of Drill/pin to maintain historice Consolidate w/ HCT & OH-1 Consider replacement with a Clean with D/2 & rinse Other: engraved "US Soldier 	c fabric .00 treatment (XA" NCA marko	trea er fisc (2) ong trea (3) no t insp	Priority: table, requires tment current or next al year toing, requires tment next 2-3 years treatment required, re- pect in 5 years parable	. 1

Grave #: H






Cemetery: St. Elizabeths West	Grave #: I	ZAI #:	Row #: 14	Photo No:
Name(s) on marker: None				
Type of Marker/Monument:: Go	overnment Issue	:		
	Genera	Nar" - shield l basal portion of st	one only	
Inscription: None				
Reverse:				
Material: marble	granite	other:		
Gravestone Size (inches): He	ight: 18	Width: 10	Thick	kness: 2
una rep.	athered ttached aired ded: degrees:	cracked loose portions missing E-W N-S	☐ broken ☐ biologicals : top half of stone Other: flat on gr	vandalized stained
Grave Orientation:	Marker ins	scription faces wl	nat direction:	
Condition of Grave: unknown				
Surveyor: D. Hacker			Date: 1/24/07	
☐ Reset/level in ground; align☐ Drill/pin to maintain histori☐ Consolidate w/ HCT & OH-I☐ Consider replacement with '☐ Clean with D/2 & rinse☐ Other:	to existing row c fabric 100 treatment	treat: (2) ongo treat: (3) no tr	Priority: able, requires ment current or nex l year ing, requires ment next 2-3 years eatment required, re ect in 5 years arable	4

Grave #: I






Cemetery: St. Elizabeths West	Grave #: J	ZAI #:	Row #: 19	Photo No:
Name(s) on marker: McReau,	Charles			
Type of Marker/Monument:: Go	overnment Issue: "Civil War General Other:	r" – shield		
Inscription: 210/CHAS. MC [] [Note:The line at the end of the i information for the inscription.].	nscription indicates			the military
Reverse:				
Material: marble	granite	other:		
Gravestone Size (inches): He	ight: 18	Width: 10	Thick	ness: 2
una rep	ttached 🔲 loo		broken biologicals hips along top edg Other: mower da	
Grave Orientation: East	Marker inscri	ption faces wha	t direction: 65 °	
Condition of Grave: satisfactory				
Surveyor: D. Hacker		1	Date: 1/24/07	
 ☑ Reset/level in ground; align ☑ Drill/pin to maintain histori ☐ Consolidate w/ HCT & OH- ☐ Consider replacement with ' ☐ Clean with D/2 & rinse ☐ Other: 	to existing row c fabric 100 treatment	treatme fiscal y (2) ongoin treatme (3) no trea	ng, requires ent next 2-3 years atment required, re t in 5 years	2

Grave #: J






Cemetery: St. Elizabeths West	Grave #: K	ZAI #:	Row #:	Photo No:
Name(s) on marker: None				
Type of Marker/Monument:: G	overnment Issue	:		
	General	Var" – shield Pasal portion of st	one	
Inscription: None				
Reverse:				
Material: Marble	granite	other:		
Gravestone Size (inches): He	eight: 8	Width: 10	Thick	cness: 2
una rep	nttached 🔲	cracked loose portions missing E-W N-S	broken biologicals top portion of stone Other:	vandalized stained
Grave Orientation:	Marker ins	cription faces wl	nat direction:	
Condition of Grave: Found in w	vooded area outsi	de of fence; place	ed at cemetery gate.	
Surveyor: D. Hacker			Date: 1/24/07	
Reset/level in ground; align Drill/pin to maintain histori Consolidate w/ HCT & OH- Consider replacement with Clean with D/2 & rinse Other:	to existing row c fabric 100 treatment	treat er fisca (2) ongo treat (3) no tr	Priority: able, requires ment current or next l year ving, requires ment next 2-3 years eatment required, re	4
		(4) irrep		

Grave #: K






Cemetery: St. Elizabeths West	Grave #: L	ZAI #:	Row #:	Photo No:
Name(s) on marker: J.C.				
Type of Marker/Monument:: G	overnment Issue:			
	☐ "Civil War ☐ General ☑ Other: Cor	" - shield federate Cross		
Inscription: J.C./5.29.65				
Reverse:				
Material:	granite	other: iron		
Gravestone Size (inches): Ho	eight:	Width:	Thick	ness:
una rep	attached loc paired po	ocked [ose [rtions missing: -W N-S	broken biologicals Other: out of grosoiled	vandalized stained und; rusting,
Grave Orientation:	Marker inscri	ption faces wha	t direction:	
Condition of Grave: Found in w	vooded area outside	of fence; transfe	rred to William Wi	llis, GSA.
Surveyor: D. Hacker		1	Date: 1/24/07	
☐ Reset/level in ground; align☐ Drill/pin to maintain histori☐ Consolidate w/ HCT & OH☐ Consider replacement with☐ Clean with D/2 & rinse☐ Other: electrolytic reduction coat	to existing row ic fabric 100 treatment "XA" NCA marker	treatm fiscal y (2) ongoir treatm (3) no trea	ng, requires ent next 2-3 years atment required, re t in 5 years	1

Grave #: L





Cemetery: St. Elizabeths West	Grave #: M	ZAI #:	Row #:	Photo No:
Name(s) on marker: None				
Type of Marker/Monument:: G	overnment Issue:			
-y F 0	☐ "Civil Wa ☐ General	r" - shield nfederate Cro	ss	
Inscription: None				
Reverse:				
Material: marble	granite	other: iro	n	
Gravestone Size (inches): Ho	eight:	Width:	Thick	ness:
una rep	attached loo aired po	acked ose ortions missing -W N-S	broken biologicals supper half of cross Other: out of gro	☐ vandalized ☐ stained und; rusting,
Grave Orientation:	Marker inscri	ption faces w	hat direction:	
Condition of Grave: Found in v	vooded area outside	of fence; trans	sferred to William Wi	llis, GSA.
Surveyor: D. Hacker			Date: 1/24/07	
		endations	n	
☐ Reset/level in ground; align☐ Drill/pin to maintain histori☐ Consolidate w/ HCT & OH☐ Consider replacement with☐ Clean with D/2 & rinse☐ Other: electrolytic reduction coat	c fabric 100 treatment "XA" NCA marker	treat fisca (2) ongo p treat (3) no treat	Priority: table, requires tment current or next al year oing, requires tment next 2-3 years reatment required, re pect in 5 years parable	1

Grave #: M



APPENDIX 3. LIST OF INDIVIDUALS IDENTIFIED

The lists following provide a synopsis of the stones present in the West Campus cemetery, listed by name, stone number, ZAI number, and entry number. The stone number, as previously explained, was intended to help the government track the burial and should be a distinct identifier. The ZAI number is taken from their publication for GSA (and represents essentially an alphabetical listing). In many cases there is more than one ZAI number since there have been duplicates through poor transcription. Finally, the entry number comes from a 1974 list prepared by Mrs. B.L. Munger, Public Information Officer with St. Elizabeths. They may have been derived from documents now in the National Archives, or they have no relevance, other than that they represent yet another numbering system.

Table 9.
List of Stones Present in the 1990s But No Longer
in the West Campus Cemetery

Stone #	ZAI#	Name
49	38	Braden, Robert L.
381	42	Bricker, Henry
102	94	Curtis, John
103	123	Farrar, Samuel J.
98	134	Frazier, Ira
389	140	Gibson, Thomas
17	146	Griffin, Edward
93/138	154	Hartigan, Edward
83	171	Horan, George
16	181	Johnson, John
228A	210	Lee, John M.
2	214	Lerreux, Charles
214	223	Mann, Jordan
100	225	Marcus, Simon
385	226	Marsh, Arthur B.
376	257	Monreau, James
13	320	Spank, George
390	326	Streeter, Stephen

The spelling of the name is consistent (as closely as possible given the weathering and damage) to that on the stone. Given the poor records of St. Elizabeths, the spelling may, or may not, be correct. There are significant differences between this list and that published by All For the Union at http://www.allfortheunion.com/ste/CW.htm. We believe that our spellings are accurate for the stone – although the stone itself may contain misinformation.

Since the last inventory of the cemetery in the 1990s we have identified 23 stones that are no longer present. These are presented below in Table 9. The attrition rate is significant, given the relative obscurity of the cemetery and its location on government property.

List of Individuals by Last Name			
Name	Stone #	ZAI#	Entry #
	A		
	В		
	С		
	D		
	E		
	F		
	G		
	Н		
	I		
	K		
	M		
Adreon, D.C.	401	3	197
Allen, Jacob	21	5	16
Alonzo, Peter	177	7	130
Anderson, Peter	97	10	5
Arnel, Jacob	202	13	108
Arnold, Rickert	248	18	147
Augustus, James	8	15	8
Bachofen, Johannes	180	16, 381	132
Bacley, Freeman	124	18	74
Bailey, Isaac	76	19	52
Bailey, Jno.	420	20	210
Barney, Teddo	116	21	68
Batdorf, Emmanuel	261	22	150
Bechtel, Jno.	65	26	45
Bender, Peter	133A	28	169
Bennett, Connor	133	29	79
Berswinger, Gottfried	412	32	204
Biekert, Jno.	105	33	63
Bluholcer, Jonathan	23	23, 36	18
Blum, D.L.	167	34	102
Bole, C.G.	15	37	102
Bradley, L.S.	118	39	70
Braywick, M.C.	305	40	155
Brennan, James	40	40	37
Bromagem, J.M.	394	43	192
Brower, P.A.	75	43	51
Brown, Chas.	225	4 4 45	124
Brown, Jno.	247A	45	124
Brown, John	247 A 247	46	143
Brown, W.S.	247	46 47	119
Bruce, Henry	314	47	160
Druce, rieiny	314	'1 7	100

F	Brunner, Harrison	381	50	180
	Bushman, Henry	184	395	133
	Buttar, Mich'l	366	59	187
	C., J.	L		
	Callum, Martin	220	61	120
	Camp, Chas.	171	62	104
	Camp, Chas. Carpenter, Joseph	429	64	211
	<u> </u>	177A	66	131
	Carty, David	316	69	162
	Chapman, Thos.	159A	72	94
	Clark, Jno.	162	72 74	94 97
	Clark, Nathan			
	Clary, James	143	71	86
	Clifford, Jno.	312	70	159
	Cobb, Frederick	3	55 	6
	Coleman, Timothy	383	77	182
	Comings, W. H.	48	79	38
	Conroy, Patrick	174	83	129
	Conway, Patrick	260	84	149
	Cook, James	141	85	84
(Cook, Wm.	51	86	40
(Covington, Evans	161	89	96
(Cranfield, J.E.	154	91	89
(Crounge, Erastus	382	93	181
(Cupont, Francis	372	87	174
I	Davis, J.A.	238	96	137
I	Desan, Peter	200	99	106
I	Deurett, Isaac J.	24	103	19
I	Diggs, Albert	391	104	189
	Oolan, Pat'k	63	106	43
	Dopp, Cyrus	36	107	31
	Oorr, Geo.	159	108	93
	Dunbar, Carson	404	112	199
	Duvall, Eugene	74	114, 385	50
	Elwell, Chas.	310	117	157
	Erne, Herbert	392	118	190
	Evaston, Fred.	68	120	47
	Everett, Alex	216	121	117
	Faulkner, Henry	14	124	11
	Fichter, Henry	353	127	165
	Foley, Bartley	160	129	95
	Ford, J.C.	30	130	25
	Fox, Newton	113	132	67
	Frank, George	3A	132	2
	Gatrell, O.G.	18	138	13
		18 79	136	55
	Goodwin, Elisha	17	141	55

C 11 F1 1	1.0	1.12	100
Goulden, Edward	169	142	103
Gray, Wm.	41	144	35
Green, Leonard	126	145	75
Grimes, E.R.	400	92, 147	196
Gum, Henry	10	150	10
Han, G.	385	170	
Hannah, Jno.	82	152	57
Hayes, Peter	38	157	33
Heaton, Ralph	434	160	216
Helm, Joshua	380	161	179
Henn, F.N.	29	162	24
Herbert, Henry	438	163	217
Hesch, Moritz	81	119, 193, 213	
Hess, Henry	156	164	90
Hill, C.M.	7	166	7
Hirsch, Leonard	362	167	170
Holman, Liberty	433	168	215
Hooten, G.E.	395	170	193
Howard, T.L.	223	173	122
Howie, J.J.	127	174	76
Huckneys, J.L.	413	176	205
Hursh, Chris	432	177	214
Jackson, Thomas	240	178	139
Johnson, Rob't	398	182	194
Joseph, Moses	201	183	107
Kaencer, Fred'k	418	184	209
Kanz, David	254	185	148
Keef, E.D.	20	187	15
Kellogg, A.C.	77	188	53
Kenistrick, Joseph	246	190	145
King, Chas.	224	194	123
Kling, Peter	209	196	111
Kluce, Theo.	39	116,197	34
Kopp, Francis	398, 399	198, 199	195
Kuese, J.A.	244	200	
Lamercier, Alfred	364	383, 402	171
Landgren, Carl	136	204	80
Landon, Wm.	402	206	198
Langner, Godfrey	371	207	173
Lavell, Mich'l	140	208	83
Lawnell, William	22	209	17
Lee, Walter	163	211	98
Leeds, Wm. C.	34	212	29
Lewis, James	78	216	54
Long, Wm.	64	217	44
O' · ·			

Ludwig, Jno.	230	218	128	
Maguire, Jno.	384	221	183	
Malloy, Pat'k	67	256	46	
Martin, Chas.	158	228	92	
Mcreau, Chas.	J			
McAfer, Jno.	415	247	207	
McBride, Andrew	19	231	14	
McCormick, Dan'l	106	232	64	
McCoy, James	317	233	163	
McCubbins, Joshua	212	234	141	
McCutcheon, Duncan	164	235	99	
McDonnely, Pat'k	228	337	126	
McGee, Jno.	228A	239	127	
McGrath, Mich'l	405	241	200	
McPherson, Samuel	103	246, 376	62	
Menker, Henry	69	248	48	
Michau, Pierre	237	250	136	
Miles, Pat'k	199	251	105	
Miller, C.G.	315	252	161	
Miller, T.	388A	253	186	
Morse, Elon	60	259	41	
Mulcahy, Mich'l	50	260	39	
Munroe, Geo.	387	261	185	
Nagel, Julius	215	263	116	
Nos, L.E.	203	264	109	
Oatses, D.C.	111	265		
O'connor, Dan'l	157	266	91	
Paine, D.O.	117	271	69	
Parker, C.H.	431	272	213	
Pride, J.C.	128	274	77	
Ray, Sylvester	231	328	151	
Reilly, Jno.	354	406	166	
Richardson, D.A.	248A	279	146	
Riedel, Bernard	373	278	1 <i>7</i> 5	
Robinson, Henry	223A	283	152	
Rose, Christopher	241	284	140	
Rothstad, H.T.	165	285	100	
Ryan, C.H.	408	286	201	
Ryder, Pat'k	393	287	191	
Salley, L.M.	25	288	20	
Sauserauch, David	120	291	72	
Sawyer, Howard, Jr.	375	292	1 <i>77</i>	
Schafe, Frederick	190	293	135	
Schneer, Ernest	148	294	87	
Schneider, Fred'k	311	295	158	
- ,		=		

Shacklett, J.L.	406	297	201	
Sheehan, Cornelius	300	298, 380	153	
Short, Nelson	26	301	21	
Sibole, R.S.	417	305	208	
Skinner, Jno.	210	306	112	
Slevin, Mich'l	374	308	176	
Smart, Wm.	37	227, 309	32	
Smith, A.C.	72	310	49	
Smith, C.A.	121	313	73	
Smith, C.T.	131	314	78	
Smith, Geo.	226	312	125	
Smith, H.D.	166	315	101	
Smith, J.D.	217	316	118	
Smith, S.M.	110	318	65	
Smith, Thos.	411	319	203	
Stanley, T.A.	61	321	42	
Stewart, David	35	322	30	
Stewart, Jno.	139	323	82	
Sullivan, J.	189	327	134	
Sullivan, Jno.	301	409	154	
Talleson, Sam'l	430	329	212	
Taufer, Jno.	369	411	172	
Taylor, J.T.	359	330	167	
Telford, James	211	331	113	
Thompson, Jno.	32	332	27	
Tilton, J.B.S.	119	334	71	
Tobin, Wm.	205	337	110	
Torbert, Peter	9	340	9	
Travers, Darius	152	341	88	
Trombley, Peter	99	342	3	
U.S. Soldier	222	370	121	
Vaughn, Mich'l	239	345	138	
Villenger, Antin	360	346	168	
Waggerman, Geo.	414	347	206	
Weber, Wm.	142	350	85	
West, J.A.	28	353	22	
White, Mich'l	306	354	156	
Wilder, C.J.	350	356	164	
Willard, Rachbrook	80	357	56	
Williams, Chas.	31	358	26	
Wilson, Geo.	33	359	28	
Winterbottom, Jno.	28A	361	23	

Name	Stone #	ZAI#	Entry #
Cobb, Frederick	3	55	6
Frank, George	3A	133	2
Hill, C.M.	7	166	7
Augustus, James	8	15	8
Torbert, Peter	9	340	9
Gum, Henry	10	150	10
Faulkner, Henry	14	124	11
Bole, C.G.	15	37	12
Gatrell, O.G.	18	138	13
McBride, Andrew	19	231	14
Keef, E.D.	20	187	15
Allen, Jacob	21	5	16
Lawnell, William	22	209	17
Bluholcer, Jonathan	23	23, 36	18
Deurett, Isaac J.	24	103	19
Salley, L.M.	25	288	20
Short, Nelson	26	301	21
West, J.A.	28	353	22
Winterbottom, Jno.	28A	361	23
Henn, F.N.	29	162	24
Ford, J.C.	30	130	25
Williams, Chas.	31	358	26
Thompson, Jno.	32	332	27
Wilson, Geo.	33	359	28
Leeds, Wm. C.	34	212	28 29
Stewart, David	35	322	30
	36	107	
Dopp, Cyrus	36 37		31
Smart, Wm.	38	227, 309 157	32 33
Hayes, Peter			
Kluce, Theo.	39	116,197	34
Brennan, James	40	41	37
Gray, Wm.	41	144	35
Comings, W. H.	48	79 260	38
Mulcahy, Mich'l	50 51	260	39
Cook, Wm.	51	86	40
Morse, Elon	60	259	41
Stanley, T.A.	61	321	42
Dolan, Pat'k	63	106	43
Long, Wm.	64	217	44
Bechtel, Jno.	65	26	45
Malloy, Pat'k	67	256	46
Evaston, Fred.	68	120	47

Menker, Henry	69	248	48
Smith, A.C.	72	310	49
Duvall, Eugene	74	114, 385	50
Brower, P.A.	75	44	51
Bailey, Isaac	76	19	52
Kellogg, A.C.	77	188	53
Lewis, James	78	216	54
Goodwin, Elisha	79	141	55
Willard, Rachbrook	80	357	56
Hesch, Moritz	81	119, 193, 213	
Hannah, Jno.	82	152	57
Anderson, Peter	97	10	5
Trombley, Peter	99	342	3
McPherson, Samuel	103	246, 376	62
Biekert, Jno.	105	33	63
McCormick, Dan'l	106	232	64
Smith, S.M.	110	318	65
Oatses, D.C.	111	265	
Fox, Newton	113	132	67
Barney, Teddo	116	21	68
Paine, D.O.	117	271	69
Bradley, L.S.	118	39	70
Tilton, J.B.S.	119	334	71
Sauserauch, David	120	291	72
Smith, C.A.	121	313	73
Bacley, Freeman	124	18	74
Green, Leonard	126	145	<i>7</i> 5
Howie, J.J.	127	174	76
Pride, J.C.	128	274	77
Smith, C.T.	131	314	78
Bennett, Connor	133	29	79
Bender, Peter	133A	28	169
Landgren, Carl	136	204	80
Stewart, Jno.	139	323	82
Lavell, Mich'l	140	208	83
Cook, James	141	85	84
Weber, Wm.	142	350	85
Clary, James	143	71	86
Schneer, Ernest	148	294	87
Travers, Darius	152	341	88
Cranfield, J.E.	154	91	89
Hess, Henry	156	164	90
O'connor, Dan'l	157	266	91
Martin, Chas.	158	228	92
Dorr, Geo.	159	108	93
•			

Clark, Jno.	159A	72	94
Foley, Bartley	160	129	95
Covington, Evans	161	89	96
Clark, Nathan	162	74	97
Lee, Walter	163	211	98
McCutcheon, Duncan	164	235	99
Rothstad, H.T.	165	285	100
Smith, H.D.	166	315	101
Blum, D.L.	167	34	102
Goulden, Edward	169	142	103
Camp, Chas.	171	62	104
Conroy, Patrick	174	83	129
Alonzo, Peter	177	7	130
Carty, David	177A	66	131
Bachofen, Johannes	180	16, 381	131
Bushman, Henry	184	395	132
Sullivan, J.	189	327	134
•	190	293	134
Schafe, Frederick	199	253 251	105
Miles, Pat'k		99	
Desan, Peter	200		106
Joseph, Moses	201	183	107
Arnel, Jacob	202	13	108
Nos, L.E.	203	264	109
Tobin, Wm.	205	337	110
Kling, Peter	209	196	111
Skinner, Jno.	210	306	112
Telford, James	211	331	113
McCubbins, Joshua	212	234	141
Nagel, Julius	215	263	116
Everett, Alex	216	121	117
Smith, J.D.	217	316	118
Brown, W.S.	218	47	119
Callum, Martin	220	61	120
U.S. Soldier	222	370	121
Howard, T.L.	223	173	122
Robinson, Henry	223A	283	152
Brown, Chas.	225	45	124
Smith, Geo.	226	312	125
McDonnely, Pat'k	228	337	126
McGee, Jno.	228A	239	127
Ray, Sylvester	231	328	151
Michau, Pierre	237	250	136
Davis, J.A.	238	96	137
Vaughn, Mich'l	239	345	138

Jackson, Thomas	240	178	139	
Rose, Christopher	241	284	140	
Kuese, J.A.	244	200		
Kenistrick, Joseph	246	190	145	
Brown, John	247	46	143	
Brown, Jno.	247A	46		
Arnold, Rickert	248	18	147	
Richardson, D.A.	248A	279	146	
Kanz, David	254	185	148	
Conway, Patrick	260	84	149	
Batdorf, Emmanuel	261	22	150	
Sheehan, Cornelius	300	298, 380	153	
Sullivan, Jno.	301	409	154	
Braywick, M.C.	305	40	155	
White, Mich'l	306	354	156	
Elwell, Chas.	310	117	157	
Schneider, Fred'k	311	295	158	
Clifford, Jno.	312	70	159	
Bruce, Henry	314	49	160	
Miller, C.G.	315	252	161	
Chapman, Thos.	316	69	162	
McCoy, James	317	233	163	
Wilder, C.J.	350	356	164	
Fichter, Henry	353	127	165	
Reilly, Jno.	354	406	166	
Taylor, J.T.	359	330	167	
Villenger, Antin	360	346	168	
Hirsch, Leonard	362	167	170	
Lamercier, Alfred	364	383, 402	171	
Buttar, Mich'l	366	59	187	
Taufer, Jno.	369	411	172	
Langner, Godfrey	371	207	173	
Cupont, Francis	372	87	174	
Riedel, Bernard	373	278	175	
Slevin, Mich'l	374	308	176	
Sawyer, Howard, Jr.	375	292	177	
Helm, Joshua	380	161	179	
Brunner, Harrison	381	50	180	
Crounge, Erastus	382	93	181	
Coleman, Timothy	383	77	182	
Maguire, Jno.	384	221	183	
Han, G.	385	170		
Munroe, Geo.	387	261	185	
Miller, T.	388A	253	186	
, , , , , , , , , , , , , , , , , , ,				

APPENDIX 3. LIST OF INDIVIDUALS IDENTIFIED

Diggs, Albert	391	104	189
Erne, Herbert	392	118	190
Ryder, Pat'k	393	287	191
Bromagem, J.M.	394	43	192
Hooten, G.E.	395	170	193
Johnson, Rob't	398	182	194
Kopp, Francis	398, 399	198, 199	195
Grimes, E.R.	400	92, 147	196
Adreon, D.C.	401	3	197
Landon, Wm.	402	206	198
Dunbar, Carson	404	112	199
McGrath, Mich'l	405	241	200
Shacklett, J.L.	406	297	201
Ryan, C.H.	408	286	201
Smith, Thos.	411	319	203
Berswinger, Gottfried	412	32	204
Huckneys, J.L.	413	176	205
Waggerman, Geo.	414	347	206
McAfer, Jno.	415	247	207
Sibole, R.S.	417	305	208
Kaencer, Fred'k	418	184	209
Bailey, Jno.	420	20	210
Carpenter, Joseph	429	64	211
Talleson, Sam'l	430	329	212
Parker, C.H.	431	272	213
Hursh, Chris	432	177	214
Holman, Liberty	433	168	215
Heaton, Ralph	434	160	216
Herbert, Henry	438	163	217
	A		
	В		
	C		
	D		
	E		
	F		
	G		
	Н		
	I		
Mcreau, Chas.	J		
	K		
C., J.	L		
	M		

Cemetery Preservation Plans

Historical Research

Identification of Grave Locations and Mapping

Condition Assessments

Treatment of Stone and Ironwork

ISBN 978-1-58317-071-7



Chicora Foundation, Inc. PO Box 8664 • 861 Arbutus Drive Columbia, SC 29202-8664

Tel: 803-787-6910 Fax: 803-787-6910 www.chicora.org